

GATH7MLL  
 GATH86JF  
 GATH8HH1  
 GATH94RP  
 GATH6CEE  
 GATH7MLM  
 GATH86JG  
 GATH8HH2  
 GATH94RR  
 GATH6CEF  
 GATH7MLN  
 GATH86JH  
 GATH8HH3  
 GATH94RT  
 GATH6RH8  
 GATH7MLP  
 GATH86JJ  
 GATH8HH4  
 GATH96HF  
 GATH6RH9  
 GATH7MLR  
 GATH86JK  
 GATH8HH5  
 GATH96HG  
 GATH6RHC  
 GATH7MLT  
 GATH86JL  
 GATH8HH6  
 GATH96HK  
 GATH6RHD  
 GATH7MLW  
 GATH86JM  
 GATH8HH7  
 GATH96HL  
 GATH6RHE  
 GATH7MM0  
 GATH86JN  
 GATH8K0H  
 GATH96HM  
 GATH6RHF  
 GATH7MM1  
 GATH86JP  
 GATH8K0J  
 GATH96HN  
 GATH6RHG  
 GATH7MM2  
 GATH86JR  
 GATH8K0K  
 GATH96HR  
 GATH6RHH  
 GATH7MM3  
 GATH86JT  
 GATH8K0L  
 GATH96HT  
 GATH6RHJ  
 GATH7PPT  
 GATH86JW  
 GATH8K0M  
 GATH96HW  
 GATH6RWT  
 GATH7PPW  
 GATH86K0  
 GATH8K0N  
 GATH96J0

These engines are installed on, but not limited to, Agusta S.p.A AS-61N, AS-61N1, Sikorsky S-61L, S-61N, S-61R, and S-61NM helicopters, and the following surplus military helicopters

that have been certified in accordance with sections 21.25 or 21.27 of the Federal Aviation Regulations (14 CFR 21.25 or 21.27): Sikorsky S-61D and S-61V, Glacier CH-3E, Siller CH-3E and SH-3A, and Robinson Crane CH-3C, CH-3E, HH-3C, HH-3E, and Carson S-61L helicopters.

#### Unsafe Condition

(d) This AD results from two reports of low blade tip clearances in the compressor. We are issuing this AD to prevent low-cycle-fatigue (LCF) cracking and failure of the stage 1 compressor disk, an uncontained engine failure, and damage to the helicopter.

#### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified unless the actions have already been done.

#### Replacement of Stage 1 Compressor Disks

(f) If you have a stage 1 compressor disk, P/N 5001T20P01, with a SN listed in Table 1 of this AD, replace that stage 1 compressor disk at or before reaching a reduced LCF life limit for those affected disks of 2,100 hours time-since-new (TSN) or by December 31, 2008, whichever occurs first. GE Alert Service Bulletin (ASB) No. CT58 S/B 72-A0196, dated July 24, 2003, contains information on replacing the stage 1 compressor disk.

(g) After the effective date of this AD, do not install any stage 1 compressor disk, P/N 5001T20P01, that has a SN listed in Table 1 of this AD and has 2,100 hours TSN or more, into any engine.

#### Alternative Methods of Compliance

(h) The Manager, Engine Certification Office, has the authority to approve alternative methods of compliance for this AD if requested using the procedures found in 14 CFR 39.19.

#### Material Incorporated by Reference

(i) None.

#### Related Information

(j) GE Alert Service Bulletin No. CT58 S/B 72-A0196, dated July 24, 2003, pertains to the subject of this AD.

Issued in Burlington, Massachusetts, on February 10, 2005.

#### Francis A. Favara,

*Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 05-3190 Filed 2-18-05; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NE-50-AD; Amendment 39-13980; AD 2005-04-08]

RIN 2120-AA64

#### Airworthiness Directives; Hartzell Propeller Inc. Model HC-B3TN-5() T10282() Propellers

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is superseding an existing Priority Letter Airworthiness Directive (AD) for Hartzell Propeller Inc. model HC-B3TN-5()/T10282() propellers. That AD currently requires initial and repetitive inspections of the blade pilot tube bore area. This ad requires the same inspections. This AD results from a review of all currently effective ADs. That review determined that Priority Letter AD 88-24-15 was not published in the Federal Register to make it effective to all operators, as opposed to just the operators who received actual notice of the original Priority Letter AD. This AD also results from the discovery that the original AD omitted an airplane model with a certain Supplemental Type Certificate (STC) from the applicability. We are issuing this AD to prevent possible blade failure near the hub which can result in blade separation, engine separation, damage to the airplane, and possible loss of the airplane.

**DATES:** This AD becomes effective March 29, 2005. The Director of the Federal Register approved the incorporation by reference of certain publications listed in the regulations as of March 29, 2005.

**ADDRESSES:** Contact Hartzell Propeller Inc. Technical Publications Department, One Propeller Place, Piqua, OH 45356; telephone (937) 778-4200; fax (937) 778-4391, for the service information identified in this AD.

You may examine the AD docket at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA. You may examine the service information, at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/](http://www.archives.gov/federal_register/)

*code\_of\_federal\_regulations/  
ibr\_locations.html.*

**FOR FURTHER INFORMATION CONTACT:**

Melissa T. Bradley, Aerospace Engineer, Chicago Aircraft Certification Office, FAA, Small Airplane Directorate, 2300 East Devon Avenue, Des Plaines, IL 60018; telephone (847) 294-8110; fax (847) 294-7834.

**SUPPLEMENTARY INFORMATION:** The FAA proposed to amend 14 CFR Part 39 with a proposed airworthiness directive (AD). The proposed AD applies to Hartzell Propeller Inc. model HC-B3TN-5()/T10282() propellers. We published the proposed AD in the **Federal Register** on July 22, 2004 (69 FR 43775). That action proposed to require initial and repetitive inspections of the blade pilot tube bore area.

**Examining the AD Docket**

You may examine the AD Docket (including any comments and service information), by appointment, between 8 a.m. and 4:30 p.m., Monday through Friday, except Federal holidays. See **ADDRESSES** for the location.

**Comments**

We provided the public the opportunity to participate in the development of this AD. We have considered the one comment received.

**Request To Change the Compliance Time**

One commenter, Hartzell Propeller Inc., requests that we change the compliance time to a much more aggressive compliance requirement, to the point of grounding those operators who did not follow the Priority Letter AD, regardless of whether they were legally obligated to do so or not. The commenter states that the NPRM we published, which is 16 years beyond the Priority Letter AD effective date, extends compliance to 500 hours after the effective date of the yet-to-be published final rule AD. The Priority Letter AD either identified, or was the result of, cracks found on two blades installed in the same propeller, and two occurrences of blade separation on two other propellers. All events were from fractures initiating at the same general location in the blade bore. Hartzell issued Service Bulletin No. 161, dated May 18, 1989, as a counterpart to the Priority Letter AD. Hartzell further states that since many operators of this type of aircraft overhaul their propellers, compliance to the Priority Letter AD was likely accomplished, intentionally or otherwise, as part of the overhaul process. However, if an operator did not receive or acknowledge

the Priority Letter AD, and if they did not overhaul their propellers, they are flying at increased risk of failure. Hartzell further states that the published NPRM provides inappropriate relaxation and should be revised.

We do not agree. To justify the suggested change in compliance time, we would need supporting data. However, service history has shown that there has been no occurrence of this failure mode subsequent to the issuance of the Priority Letter AD.

**Conclusion**

We have carefully reviewed the available data, including the comment received, and determined that air safety and the public interest require adopting the AD as proposed.

**Costs of Compliance**

By adding STC SA345GL to the applicability, there are about 50 additional Hartzell Propeller Inc. model HC-B3TN-5()/T10282() propellers of the affected design in the worldwide fleet. Including the additional applicability, we estimate a total of 500 propellers have been installed on airplanes of U.S. registry and would be affected by this AD. We also estimate that it would take about 2.5 work hours per propeller blade to perform the actions, and that the average labor rate is \$65 per work hour. Based on these figures, we estimate the total cost of the AD to U.S. operators is \$243,750.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will

not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a summary of the costs to comply with this AD and placed it in the AD Docket. You may get a copy of this summary by sending a request to us at the address listed under **ADDRESSES**. Include "AD Docket No. 2003-NE-50-AD" in your request.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

■ Accordingly, under the authority delegated to me by the Administrator, the Federal Aviation Administration amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding a new airworthiness directive, Amendment 39-13980, to read as follows:

**2005-04-08 Hartzell Propeller Inc.:**  
Amendment 39-13980. Docket No. 2003-NE-50-AD.

**Effective Date**

(a) This AD becomes effective March 29, 2005.

**Affected ADs**

(b) This AD supersedes Priority Letter AD 88-24-15.

**Applicability**

(c) This AD applies to Hartzell Propeller Inc. model HC-B3TN-5()/T10282() propellers installed on the airplane and engine combinations shown in the following Table 1 (excluding propellers with blades part number (P/N) T10282N(), T10282NB(), T10282NK(), or T10282NE() installed).

TABLE 1.—APPLICABILITY

Airplane model	Propeller model	Engine model
Fairchild SA226-TC .....	HC-B3TN-5()/T10282() .....	Garrett TPE331-10UA-511G
Fairchild SA226-AT .....		
Fairchild SA226-T .....		

(d) For reference, airplanes incorporating Supplemental Type Certificates (STCs) SA344GL-D, SA4872SW, and SA345GL-D have these engine, propeller, and airplane combinations.

(e) The parentheses appearing in the propeller model number indicates the presence or absence of an additional letter(s) that varies the basic propeller model. This AD still applies regardless of whether these letters are present or absent in the propeller model designation.

#### Unsafe Condition

(f) This AD results from a review of all currently effective ADs. That review determined that Priority Letter AD 88-24-15 was not published in the **Federal Register** to make it effective to all operators, as opposed to just the operators who received actual notice of the original Priority Letter AD. This AD also results from the discovery that the original AD omitted an airplane model with a certain STC from the applicability. We are issuing this AD to prevent possible blade failure near the hub which can result in blade separation, engine separation, damage to the airplane, and possible loss of the airplane.

#### Compliance

(g) You are responsible for having the actions required by this AD performed within the compliance times specified unless the actions have already been done.

#### Required Actions

(h) Within 10 hours time-in-service (TIS) after the effective date of this AD, perform a document search to determine if the following actions have been done:

(1) The propeller blades meet the initial and repetitive compliance requirements of Priority Letter AD 88-24-15.

(2) The P/N T10282() propeller blades have been replaced with P/N T10282N(), T10282NB(), T10282NK(), or T10282NE() propeller blades.

(i) If the actions in paragraph (h)(1) or (h)(2) of this AD have not been done, then do one of the following:

(1) Inspect the blades using Paragraph 3 of the Accomplishment Instructions of Hartzell Service Bulletin (SB) No. 136, Revision Letter "I," dated April 25, 2003, within 500 hours time-since-new (TSN) or time-since-last-overhaul (TSLO) and not to exceed two years after the effective date of this AD, whichever occurs first; and thereafter within 500 service-hour intervals; or

(2) Replace with P/N T10282N(), T10282NB(), T10282NK(), or T10282NE() propeller blades as applicable, within 500 hours TSN or TSLO and not to exceed two years after the effective date of this AD, whichever occurs first.

(j) If the actions in paragraph (h)(1) of this AD have been done, but not the actions in

paragraph (h)(2) of this AD, then do the following:

(1) Inspect the blades within 500 hours since the last Hartzell SB No. 136E, or later Revision, inspection, and thereafter within 500 service hour intervals, using Paragraph 3 of the Accomplishment Instructions of Hartzell SB No. 136, Revision Letter "I," dated April 25, 2003.

(2) Replace before further flight all blades showing evidence of cracks or other unairworthy conditions, as noted in Hartzell SB No. 136, Revision Letter "I," dated April 25, 2003, with airworthy blades.

#### Hartzell SB No. 136

(k) Since Hartzell SB No. 136E was issued, the SB has been revised to 136F, 136G, 136H, and 136I. Any of these revisions are suitable for determining past compliance, as they are all approved as alternative methods of compliance (AMOC). After the effective date of this AD, compliance is restricted to SB No. 136, Revision Letter "I," or later versions when approved by an AMOC.

#### Optional Terminating Action

(l) Installation of propeller blades, P/N T10282N(), T10282NB(), T10282NK(), or T10282NE() as applicable, onto a Hartzell Propeller Inc. model HC-B3TN-5() propeller constitutes terminating action to the inspections, repairs, and replacements specified in paragraphs (i) through (j)(2) of this AD.

#### Alternative Methods of Compliance

(m) The Manager, Chicago Aircraft Certification Office, has the authority to approve alternate methods of compliance for this AD if requested using the procedures found in 14 CFR 39.19.

#### Material Incorporated by Reference

(n) You must use Hartzell SB No. 136 (HC-SB-61-136), Revision Letter "I," dated April 25, 2003, to perform the inspections required by this AD. The Director of the Federal Register approved the incorporation by reference of this service bulletin in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. You can get a copy from Hartzell Propeller Inc. Technical Publications Department, One Propeller Place, Piqua, OH 45356; telephone (937) 778-4200; fax (937) 778-4391. You can review copies at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA, or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

#### Related Information

(o) None.

Issued in Burlington, Massachusetts, on February 11, 2005.

**Jay J. Pardee,**

*Manager, Engine and Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 05-3046 Filed 2-18-05; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HOMELAND SECURITY

### Customs and Border Protection

#### 19 CFR Part 162

[CBP Dec. 05-02]

RIN 1651-AA48

#### Publication of Administrative Forfeiture Notices

**AGENCY:** Bureau of Customs and Border Protection, Homeland Security.

**ACTION:** Final rule.

**SUMMARY:** This document adopts as a final rule, a proposed amendment to the Bureau of Customs and Border Protection (CBP) Regulations published in the **Federal Register** on January 14, 2004, to raise the threshold value of seized property for which CBP must publish a forfeiture notice in a newspaper from \$2,500 to \$5,000. By changing the requirements for publication of administrative forfeiture notices, the amendment significantly reduces the publication costs incurred by CBP, which have often exceeded the value of seized property.

**EFFECTIVE DATE:** March 24, 2005.

**FOR FURTHER INFORMATION CONTACT:** Ricardo Scheller, Seizures & Penalties Branch, (202) 344-1095.

#### SUPPLEMENTARY INFORMATION:

#### Background

Section 162.45 of the Customs and Border Protection (CBP) Regulations (19 CFR 162.45) sets forth the procedure that CBP must follow when it seizes and gives notice of intent to forfeit property under administrative forfeiture proceedings, as required by section 607 of the Tariff Act of 1930, as amended (19 U.S.C. 1607). The statutory language