

compliance with the requirements of paragraph (a) of this AD.

TABLE 1.—BOEING SERVICE BULLETINS

Boeing service bulletin	Revision	Date of issue
DC10-52-221 .....	Original .....	November 5, 2001.
DC10-52-221 .....	01 .....	May 6, 2002.
MD11-52-046 .....	Original .....	November 5, 2001.
MD11-52-046 .....	01 .....	May 6, 2002.
MD11-52-046 .....	02 .....	October 8, 2002.

**Alternative Methods of Compliance**

(d) In accordance with 14 CFR 39.19, the Manager, Los Angeles Aircraft Certification Office, FAA, is authorized to approve alternative methods of compliance (AMOCs) for this AD.

**Incorporation by Reference**

(e) Unless otherwise specified in this AD, the actions must be done in accordance with Boeing Service Bulletin DC10-52-221, Revision 2, dated October 27, 2004; or Boeing Service Bulletin MD11-52-046, Revision 3, dated October 27, 2004, as applicable. This incorporation by reference was approved by the Director of the **Federal Register** in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. To get copies of this service information, contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). To inspect copies of this service information, go to the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or to the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or to the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

**Effective Date**

(f) This amendment becomes effective on August 30, 2005.

Issued in Renton, Washington, on July 14, 2005.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 05-14392 Filed 7-25-05; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2005-21023; Directorate Identifier 2004-NM-262-AD; Amendment 39-14196; AD 2005-15-07]

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Model A320-111 Airplanes and Model A320-200 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Airbus Model A320-111 airplanes and Model A320-200 series airplanes. This AD requires installing insulator and cable ties to the electrical cables of the S routes at the gaps in the raceway in the wing trailing edge and the wing tip and wing root areas. This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent injection of high voltage current into the low voltage wiring that passes through the fuel tanks, which could result in a possible fuel tank explosion.

**DATES:** Effective August 30, 2005.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of August 30, 2005.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW., Nassif Building, Room PL-401, Washington, DC.

Contact Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France, for service information identified in this AD.

**FOR FURTHER INFORMATION CONTACT:** Tim Dulin, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601

Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2141; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:**

**Examining the Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the street address stated in the **ADDRESSES** section.

**Discussion**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to certain Airbus Model A320-111 airplanes and Model A320-200 series airplanes. That NPRM was published in the **Federal Register** on April 21, 2005 (70 FR 20724). That NPRM proposed to require installing insulator and cable ties to the electrical cables of the S routes at the gaps in the raceway in the wing trailing edge and the wing tip and wing root areas.

**Comments**

We provided the public the opportunity to participate in the development of this AD. We have considered the comment that has been received on the NPRM.

**Support for the Proposed AD**

One commenter supports the NPRM.

**Explanation of Change to Applicability**

We have revised the applicability of this AD to identify model designations as published in the most recent type certificate data sheet for the affected models.

**Conclusion**

We have carefully reviewed the available data, including the comment that has been received, and determined that air safety and the public interest require adopting the AD with the change described above.

## Costs of Compliance

This AD affects about 54 airplanes of U.S. registry. The actions take about 35 work hours per airplane, at an average labor rate of \$65 per work hour. Required parts cost about \$0 per airplane. Based on these figures, the estimated cost of the AD for U.S. operators is \$122,850, or \$2,275 per airplane.

## Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in subtitle VII, part A, subpart III, section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**2005-15-07 Airbus:** Amendment 39-14196. Docket No. FAA-2005-21023; Directorate Identifier 2004-NM-262-AD.

#### Effective Date

(a) This AD becomes effective August 30, 2005.

#### Affected ADs

(b) None.  
*Applicability:* (c) This AD applies to Airbus Model A320-111 airplanes; and Model A320-211, -212, -214, -231, -232, and -233 airplanes; certificated in any category; except those modified in production by Airbus Modification 22626.

#### Unsafe Condition

(d) This AD was prompted by the results of fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent injection of high voltage current into the low voltage wiring that passes through the fuel tanks, which could result in a possible fuel tank explosion.

*Compliance:* (e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Modification

(f) Within 60 months after the effective date of this AD, install insulator and cable ties to the electrical cables of the S routes at the gaps in the raceway in the wing trailing edge and the wing tip and wing root areas, in accordance with Airbus Service Bulletin A320-24-1062, Revision 05, dated June 27, 2002.

#### Alternative Methods of Compliance (AMOCs)

(g) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

#### Related Information

(h) French airworthiness directive F-2004-173, dated October 27, 2004, also addresses the subject of this AD.

#### Material Incorporated by Reference

(i) You must use Airbus Service Bulletin A320-24-1062, Revision 05, dated June 27,

2002, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France, for a copy of this service information. You may review copies at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW., Room PL-401, Nassif Building, Washington, DC; on the internet at <http://dms.dot.gov>; or at the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on July 13, 2005.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 05-14391 Filed 7-25-05; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2005-21137; Directorate Identifier 2002-NM-86-AD; Amendment 39-14200; AD 2005-15-11]

RIN 2120-AA64

#### Airworthiness Directives; BAE Systems (Operations) Limited (Jetstream) Model 4101 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all BAE Systems (Operations) Limited (Jetstream) Model 4101 airplanes. This AD requires repetitive detailed and specialized inspections to detect fatigue damage in the fuselage, replacement of certain bolt assemblies, and corrective actions if necessary. This AD results from a review of primary airframe fatigue test results and a Maintenance Steering Group 3 (MSG-3) analysis. We are issuing this AD to detect and correct fatigue damage of the fuselage, door, engine nacelle, empennage, and wing structures, which could result in reduced structural integrity of the airplane.

**DATES:** Effective August 30, 2005.

The Director of the Federal Register approved the incorporation by reference