

compartment door, replace the seal on both partitions with a new seal, and accomplish all applicable corrective actions, by doing all the actions specified in the Accomplishment Instructions of EMBRAER Service Bulletin 145LEG-25-0060, dated November 18, 2005. All applicable corrective actions must be done before further flight.

**Note 1:** For the purposes of this AD, a general visual inspection is: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to ensure visual access to all surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

#### Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

#### Related Information

(h) Brazilian airworthiness directive 2006-02-02, dated February 24, 2006, also addresses the subject of this AD.

Issued in Renton, Washington, on March 30, 2006.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate,  
Airframe Certification Service.*

[FR Doc. 06-3440 Filed 4-10-06; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2006-24368; Directorate Identifier 2005-NM-230-AD]

RIN 2120-AA64

#### Airworthiness Directives; McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 Series Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all

McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 series airplanes. This proposed AD would require replacing the clamp bases for the fuel vent pipe with improved clamp bases. This proposed AD results from reports that the foil wrapping on existing plastic clamp bases has migrated out of position, which compromises the bonding of the fuel vent lines to the airplane structure. We are proposing this AD to ensure that the fuel vent lines are properly bonded to the airplane structure. Improper bonding could prevent electrical energy from a lightning strike from dissipating to the airplane structure, and create an ignition source, which could result in a fuel tank explosion.

**DATES:** We must receive comments on this proposed AD by May 26, 2006.

**ADDRESSES:** Use one of the following addresses to submit comments on this proposed AD.

- *DOT Docket Web site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Government-wide rulemaking Web site:* Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.

- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW., Nassif Building, room PL-401, Washington, DC 20590.

- *Fax:* (202) 493-2251.

- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for the service information identified in this proposed AD.

**FOR FURTHER INFORMATION CONTACT:** Serj Harutunian, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5254; fax (562) 627-5210.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to submit any relevant written data, views, or arguments regarding this proposed AD. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number "FAA-2006-24368; Directorate Identifier 2005-NM-230-AD" at the beginning of your comments. We

specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this proposed AD. Using the search function of that Web site, anyone can find and read the comments in any of our dockets, including the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review DOT's complete Privacy Act Statement in the **Federal Register** published on April 11, 2000 (65 FR 19477-78), or you may visit <http://dms.dot.gov>.

#### Examining the Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the DOT street address stated in the **ADDRESSES** section. Comments will be available in the AD docket shortly after the Docket Management System receives them.

#### Discussion

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings, we issued a regulation titled "Transport Airplane Fuel Tank System Design Review, Flammability Reduction and Maintenance and Inspection Requirements" (67 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 ("SFAR 88," Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type design (i.e., type certificate (TC) and supplemental type certificate (STC)) holders to substantiate that their fuel tank systems can prevent

ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews.

In evaluating these design reviews, we have established four criteria intended to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: single failures, single failures in combination with a latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken that may mitigate the need for further action.

We have determined that the actions identified in this AD are necessary to reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

Foil-wrapped plastic clamp bases are used to bond the fuel vent line to the airplane structure in parts of the fuel vent system on McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 series airplanes. We have received reports that the foil wrapping on existing plastic clamp bases has migrated out of position on several airplanes, which compromises the bonding of the fuel vent lines to the airplane structure. Bonding of the fuel vent lines to the airplane structure is critical to ensure that the electrical energy from a lightning strike dissipates to the airplane structure. This condition, if not corrected, could create an ignition source and result in a fuel tank explosion.

#### Relevant Service Information

We have reviewed Boeing Service Bulletin DC9-28-211, dated February 23, 2005. The service bulletin describes procedures for replacing existing foil-wrapped plastic clamp bases for the fuel vent line with improved metal clamp bases. These replacement procedures include verifying the electrical conductivity of the structural bracket

and vent pipe surfaces using an ohmmeter and taking corrective action if necessary. If the ohmmeter reading is more than 2.5 milliohms, the corrective action includes prepping and applying chemical conversion coating to the surface of the structural bracket and/or vent pipe, as applicable. Accomplishing the actions specified in the service information is intended to adequately address the unsafe condition.

#### FAA's Determination and Requirements of the Proposed AD

We have evaluated all pertinent information and identified an unsafe condition that is likely to exist or develop on other airplanes of this same type design. For this reason, we are proposing this AD, which would require accomplishing the actions specified in the service information described previously, except as discussed under "Differences Between the Proposed AD and Service Bulletin."

#### Differences Between the Proposed AD and Service Bulletin

Although the service bulletin recommends accomplishing the replacement of clamp bases for the fuel vent line within 10 years after the issue date of the service bulletin, we have determined that interval would not address the identified unsafe condition soon enough to ensure an adequate level of safety for the affected fleet. In developing an appropriate compliance time for this AD, we considered the manufacturer's recommendation, the degree of urgency associated with the subject unsafe condition, and the time necessary to do the replacement. In light of all of these factors, we find that a 60-month compliance time represents an appropriate interval of time for affected airplanes to continue to operate without compromising safety. This difference has been coordinated with Boeing, and Boeing concurs.

#### Costs of Compliance

There are about 640 airplanes of the affected design in the worldwide fleet. This proposed AD would affect about 413 airplanes of U.S. registry. The proposed actions would take up to 4 work hours per airplane, at an average labor rate of \$80 per work hour. Required parts would cost between \$1,004 and \$2,008 per airplane. Based on these figures, the estimated cost of the proposed AD for U.S. operators is between \$546,812 and \$961,464, or \$1,324 and \$2,328 per airplane.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue

rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in subtitle VII, part A, subpart III, section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We have determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket. See the ADDRESSES section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**McDonnell Douglas:** Docket No. FAA-2006-24368; Directorate Identifier 2005-NM-230-AD.

**Comments Due Date**

(a) The FAA must receive comments on this AD action by May 26, 2006.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to all McDonnell Douglas Model DC-9-11, DC-9-12, DC-9-13, DC-9-14, DC-9-15, DC-9-15F, DC-9-21, DC-9-31, DC-9-32, DC-9-32 (VC-9C), DC-9-32F, DC-9-32F (C-9A, C-9B), DC-9-33F, DC-9-34, DC-9-34F, DC-9-41, and DC-9-51 airplanes, certificated in any category.

**Unsafe Condition**

(d) This AD results from reports that the foil wrapping on existing plastic clamp bases has migrated out of position, which compromises the bonding of the fuel vent lines to the airplane structure. We are issuing this AD to ensure that the fuel vent lines are properly bonded to the airplane structure. Improper bonding could prevent electrical energy from a lightning strike from dissipating to the airplane structure, and create an ignition source, which could result in a fuel tank explosion.

**Compliance**

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Clamp Base Replacement**

(f) Within 60 months after the effective date of this AD, replace the existing clamp bases for the fuel vent line with improved metal clamp bases, by doing all of the applicable actions in accordance with the Accomplishment Instructions of Boeing Service Bulletin DC9-28-211, dated February 23, 2005. Any corrective action that is required following the conductivity verification, which is included in the replacement procedures, must be done before further flight.

**Alternative Methods of Compliance (AMOCs)**

(g)(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

Issued in Renton, Washington, on March 30, 2006.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 06-3441 Filed 4-10-06; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2006-24369; Directorate Identifier 2006-NM-001-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Boeing Model 737-600, -700, -700C, and -800 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede an existing airworthiness directive (AD) that applies to certain Boeing Model 737-600, -700, -700C, and -800 series airplanes. The existing AD currently requires replacing the point "D" splice fitting between windows number 1 and 2 with a new splice fitting; performing an eddy current inspection for cracking of the holes in the structure common to the new splice fitting, including doing any related investigative actions; and performing corrective actions if necessary. This proposed AD would add repetitive inspections for cracking of the skin just below each splice fitting, and related corrective actions if necessary. This proposed AD results from full-scale fuselage fatigue testing on the splice fitting that failed prior to the design objective on Boeing Model 737-800 series airplanes, and a report of a cracked splice fitting on an operational airplane. We are proposing this AD to prevent cracking of the existing fitting, which may result in cracking through the skin and consequent decompression of the flight cabin.

**DATES:** We must receive comments on this proposed AD by May 26, 2006.

**ADDRESSES:** Use one of the following addresses to submit comments on this proposed AD.

- *DOT Docket Web site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Government-wide rulemaking Web site:* Go to <http://www.regulations.gov>

and follow the instructions for sending your comments electronically.

- *Mail:* Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street SW., Nassif Building, room PL-401, Washington, DC 20590.

- *Fax:* (202) 493-2251.

- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. Contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207, for service information identified in this proposed AD.

**FOR FURTHER INFORMATION CONTACT:** Sue Lucier, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 917-6438; fax (425) 917-6590.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to submit any relevant written data, views, or arguments regarding this proposed AD. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number "Docket No. FAA-2006-24369; Directorate Identifier 2006-NM-001-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this proposed AD. Using the search function of that Web site, anyone can find and read the comments in any of our dockets, including the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review the DOT's complete Privacy Act Statement in the **Federal Register** published on April 11, 2000 (65 FR 19477-78), or visit <http://dms.dot.gov>.

**Examining the Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket