

## PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**McCauley Propeller Systems:** Docket No. FAA-2007-29176; Directorate Identifier 2007-NE-38-AD.

#### Comments Due Date

(a) The Federal Aviation Administration (FAA) must receive comments on this airworthiness directive (AD) action by November 27, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to McCauley Propeller Systems model 4HFR34C653/L106FA propellers. These propellers are installed on, but not limited to, British Aerospace Jetstream 3201 airplanes.

#### Unsafe Condition

(d) This AD results from reports of 3 hubs found cracked during propeller overhaul. We are issuing this AD to prevent failure of the propeller hub, which could cause blade separation, damage to the airplane, and loss of control of the airplane.

#### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified unless the actions have already been done.

(f) For propeller hubs with 6,000 or more operating hours time-since-new (TSN) on the effective date of this AD, perform the procedures in paragraphs (h) through (k) of this AD within 100 operating hours time-in-service (TIS) after the effective date of this AD.

(g) For propeller hubs with fewer than 6,000 operating hours TSN on the effective date of this AD, perform the procedures in paragraphs (h) through (k) of this AD before the propeller hub reaches 6,100 operating hours TSN.

#### Onetime Propeller Hub Inspection

(h) Remove and disassemble the propeller, and etch the propeller hub, using paragraphs 1.A. through 2.D. of the Accomplishment Instructions of McCauley Propeller Systems Alert Service Bulletin No. ASB254, dated August 20, 2007.

(i) Perform a onetime fluorescent penetrant inspection (FPI) of the propeller hub, using paragraphs 3.A through 3.G. of the Accomplishment Instructions of McCauley Propeller Systems Alert Service Bulletin No. ASB254, dated August 20, 2007.

(j) For hubs that pass the FPI, perform a onetime eddy current inspection of the propeller hub, using paragraphs 4.A. through 4.F. of the Accomplishment Instructions of

McCauley Propeller Systems Alert Service Bulletin No. ASB254, dated August 20, 2007.

(k) Remove cracked hubs from service and any other propeller parts found cracked, and return them within 10 days after inspection to McCauley Propeller Systems, P.O. Box 7704, Wichita, KS 67277-7704, for further evaluation.

#### Previous Credit

(l) If you performed the onetime inspection of the propeller hub using McCauley Propeller Systems Service Bulletin No. SB238A, or Alert Service Bulletin ASB254, both dated August 20, 2007, before the effective date of this AD, you have satisfied the inspection requirements of this AD.

#### Reporting Requirements

(m) Record the hub inspection results on reporting form, page 8, of McCauley Alert Service Bulletin No. ASB254, dated August 20, 2007. Within 10 days after the inspection, send the completed reporting form to McCauley Propeller Systems, P.O. Box 7704, Wichita, KS 67277-7704, telephone (316) 831-4021; fax (316) 831-3858.

(n) Under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of Management and Budget (OMB) has approved the information collection requirements contained in this AD and has assigned OMB Control Number 2120-0056.

#### Interim Action

(o) These actions are interim actions and we may take further rulemaking actions in the future.

#### Alternative Methods of Compliance

(p) The Manager, Wichita Aircraft Certification Office, has the authority to approve alternative methods of compliance for this AD if requested using the procedures found in 14 CFR 39.19.

#### Special Flight Permits

(q) Under 14 CFR part 39.23, we are limiting the special flight permits for this AD by the following conditions:

(1) The propeller must have no signs of external oil leakage from the hub; and

(2) The propeller has no current reports of abnormal operation or vibration.

#### Related Information

(r) None.

(s) Contact Jeff Janusz, Aerospace Engineer, Wichita Aircraft Certification Office, FAA, Small Airplane Directorate, 1801 Airport Road, Wichita, KS 67209; e-mail: [jeff.janusz@faa.gov](mailto:jeff.janusz@faa.gov); telephone: (316) 946-4148; fax: (316) 946-4107, for more information about this AD.

Issued in Burlington, Massachusetts, on September 24, 2007.

#### Thomas A. Boudreau,

*Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.*

[FR Doc. E7-19194 Filed 9-27-07; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2007-29337; Directorate Identifier 2007-NM-150-AD]

RIN 2120-AA64

#### Airworthiness Directives; BAE Systems (Operations) Limited Model BAe 146 and Model Avro 146-RJ Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Corrosion has been reported beneath the heat shield which is located around the APU (auxiliary power unit) exhaust outlet. Such corrosion could result in the fuselage being unable to sustain horizontal and vertical stabiliser loads. This is considered as potentially hazardous/catastrophic. \* \* \*

The unsafe condition is that the horizontal or vertical stabilizer might collapse under excessive load, resulting in loss of control of the airplane. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by October 29, 2007.

**ADDRESSES:** You may send comments by any of the following methods:

- *DOT Docket Web Site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* Room W12-140 on the ground floor of the West Building, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

- *Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments.

### Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Todd Thompson, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1175; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2007-29337; Directorate Identifier 2007-NM-150-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2007-0075, dated March 20, 2007 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

Corrosion has been reported beneath the heat shield which is located around the APU (auxiliary power unit) exhaust outlet. Such corrosion could result in the fuselage being unable to sustain horizontal and vertical stabiliser loads. This is considered as potentially hazardous/catastrophic. This AD mandates inspections necessary to address the identified unsafe condition.

The unsafe condition is that the horizontal or vertical stabilizer might collapse under excessive load, resulting

in loss of control of the airplane. Corrective actions include repetitive detailed visual inspections for corrosion, pitted fasteners, or pillowing of the APU heat shield and surrounding skin and, if applicable, removal of the heat shield and repair. You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

BAE Systems (Operations) Limited has issued Inspection Service Bulletin ISB.53-191, dated October 25, 2006. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 1 product of U.S. registry. We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$80 per work-hour. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$160, or \$160 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

2. The FAA amends § 39.13 by adding the following new AD:

**BAE Systems (Operations) Limited**

(Formerly British Aerospace Regional Aircraft): Docket No. FAA-2007-29337; Directorate Identifier 2007-NM-150-AD.

**Comments Due Date**

(a) We must receive comments by October 29, 2007.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to BAE Systems (Operations) Limited Model BAe 146 and Model Avro 146-RJ airplanes; certificated in any category; all models, all serial numbers.

**Subject**

(d) *Air Transport Association (ATA) of America Code 53: Fuselage.*

**Reason**

(e) The mandatory continuing airworthiness information (MCAI) states:

Corrosion has been reported beneath the heat shield which is located around the APU (auxiliary power unit) exhaust outlet. Such corrosion could result in the fuselage being unable to sustain horizontal and vertical stabiliser loads. This is considered as potentially hazardous/catastrophic. This AD mandates inspections necessary to address the identified unsafe condition.

The unsafe condition is that the horizontal or vertical stabilizer might collapse under excessive load, resulting in loss of control of the airplane. Corrective actions include repetitive detailed visual inspections for corrosion, pitted fasteners, or pillowing of the APU heat shield and surrounding skin and, if applicable, removal of the heat shield and repair.

**Actions and Compliance**

(f) Unless already done, do the following actions.

(1) Within 12 months after the effective date of this AD and thereafter at intervals not to exceed 24 months, perform a detailed visual inspection of the APU heat shield and surrounding skin, in accordance with paragraph 2.C. of BAE Systems (Operations) Limited Inspection Service Bulletin ISB.53-191, dated October 25, 2006.

(2) If any corrosion, pitted fastener, or pillowing is found during any detailed visual inspection required by paragraph (f)(1) of this AD, before the next flight, remove the APU heat shield and repair the affected area in accordance with paragraph 2.D. of BAE Systems (Operations) Limited Inspection Service Bulletin ISB.53-191, dated October 25, 2006.

(3) For any airplane modified in accordance with BAE Systems (Operations) Limited Modification Service Bulletin SB.53-193-60732A, dated November 1, 2006, the repetitive interval specified in paragraph (f)(1) of this AD may be extended to 48 months.

**FAA AD Differences**

**Note:** This AD differs from the MCAI and/or service information as follows: No differences.

**Other FAA AD Provisions**

(g) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Todd Thompson, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-1175; fax (425) 227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

**Related Information**

(h) Refer to MCAI European Aviation Safety Agency Airworthiness Directive 2007-0075, dated March 20, 2007; BAE Systems (Operations) Limited Inspection Service Bulletin ISB.53-191, dated October 25, 2006; and BAE Systems (Operations) Limited Modification Service Bulletin SB.53-193-60732A, dated November 1, 2006; for related information.

Issued in Renton, Washington, on September 21, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-19197 Filed 9-27-07; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2007-29336; Directorate Identifier 2007-NM-143-AD]

RIN 2120-AA64

**Airworthiness Directives; Airbus Model A300, A310, and A300-600 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

\* \* \* accidents which occurred to in-service aircraft caused by the violent opening of the passenger door related to excessive residual pressure in the cabin.

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by October 29, 2007.

**ADDRESSES:** You may send comments by any of the following methods:

- *DOT Docket Web Site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* Room W12-140 on the ground floor of the West Building, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

- *Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any