

U.S. Office of Personnel Management.  
**John Berry,**  
*Director.*

Accordingly, the U.S. Office of Personnel Management is amending 5 CFR part 532 as follows:

**PART 532—PREVAILING RATE SYSTEMS**

■ 1. The authority citation for part 532 continues to read as follows:

**Authority:** 5 U.S.C. 5343, 5346; § 532.707 also issued under 5 U.S.C. 552.

**Appendix B to Subpart B of Part 532—Nationwide Schedule of Nonappropriated Fund Regular Wage Surveys**

■ 2. Appendix B to subpart B is amended by removing, under the State of New Jersey, “Monmouth.”

**Appendix D to Subpart B of Part 532—Nonappropriated Fund Wage and Survey Areas**

■ 3. Appendix D to subpart B is amended for the State of New Jersey by removing the wage area listing for Monmouth, New Jersey, and revising the wage area listing for Burlington, New Jersey, to read as follows:

*	*	*	*	*
	<b>NEW JERSEY</b>			
	<b>Burlington</b>			
	<i>Survey Area</i>			
New Jersey:				
Burlington				
	<i>Area of application. Survey area plus:</i>			
Delaware:				
New Castle				
New Jersey:				
Atlantic				
Cape May				
Monmouth				
Ocean				
Salem				
	*	*	*	*

[FR Doc. 2011-21776 Filed 8-24-11; 8:45 am]

**BILLING CODE 6325-39-P**

**DEPARTMENT OF TRANSPORTATION  
 Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2011-0907; Directorate Identifier 2011-NM-146-AD; Amendment 39-16790; AD 2011-18-08]**

**RIN 2120-AA64**

**Airworthiness Directives; Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

There has been one reported case of an aft equipment bay fire occurring due to arcing of chafed integrated drive generator (IDG) power cables. Additionally, the hydraulic line support brackets located at the fuselage station (FS) 672 have been found broken in service on several aeroplanes. A broken hydraulic line support bracket at FS 672 could result in inadequate clearance between the IDG power cables and hydraulic lines, potentially resulting in chafing of the IDG power cables. Chafed IDG power cables can generate high energy arcing, which can result in an uncontrolled fire in the aft equipment bay.

\* \* \* \* \*

This AD requires actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** This AD becomes effective September 9, 2011.

We must receive comments on this AD by October 11, 2011.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between

9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Assata Dessaline, Aerospace Engineer, Avionics and Flight Test Branch, ANE-172, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone (516) 228-7301; fax (516) 794-5531.

**SUPPLEMENTARY INFORMATION:**

**Discussion**

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2011-18, dated July 7, 2011 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

There has been one reported case of an aft equipment bay fire occurring due to arcing of chafed integrated drive generator (IDG) power cables. Additionally, the hydraulic line support brackets located at the fuselage station (FS) 672 have been found broken in service on several aeroplanes. A broken hydraulic line support bracket at FS 672 could result in inadequate clearance between the IDG power cables and hydraulic lines, potentially resulting in chafing of the IDG power cables. Chafed IDG power cables can generate high energy arcing, which can result in an uncontrolled fire in the aft equipment bay.

This [TCCA] directive mandates the detailed visual inspection [for chafing and damage] and, if required, rectification of the IDG power cables and hydraulic line support bracket.

You may obtain further information by examining the MCAI in the AD docket.

**FAA’s Determination and Requirements of This AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are issuing this

AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between the AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have required different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the AD.

#### FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because chafed IDG power cables can generate high energy arcing, which can result in an uncontrolled fire in the aft equipment bay. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in fewer than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2011-0907; Directorate Identifier 2011-NM-146-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2011-18-08 Bombardier, Inc.:** Amendment 39-16790. Docket No. FAA-2011-0907; Directorate Identifier 2011-NM-146-AD.

#### Effective Date

- (a) This airworthiness directive (AD) becomes effective September 9, 2011.

#### Affected ADs

- (b) None.

#### Applicability

(c) This AD applies to Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category, serial numbers 7003 and subsequent.

#### Subject

(d) Air Transport Association (ATA) of America Code 24: Electrical power.

#### Reason

(e) The mandatory continued airworthiness information (MCAI) states:

There has been one reported case of an aft equipment bay fire occurring due to arcing of chafed integrated drive generator (IDG) power cables. Additionally, the hydraulic line support brackets located at the fuselage station (FS) 672 have been found broken in service on several aeroplanes. A broken hydraulic line support bracket at FS 672 could result in inadequate clearance between the IDG power cables and hydraulic lines, potentially resulting in chafing of the IDG power cables. Chafed IDG power cables can generate high energy arcing, which can result in an uncontrolled fire in the aft equipment bay.

\* \* \* \* \*

#### Compliance

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Actions

(g) Within 45 days after the effective date of this AD, do a detailed inspection for chafed or damaged IDG power cables from fuselage station FS652 to FS672, between stringers 8R and 10R, and for cracked or broken hydraulic line support brackets at FS672.

(1) If chafing or damage is found on any IDG power cable, before further flight, replace the IDG power cable using a method approved by either the Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, or Transport Canada Civil Aviation (TCCA) (or its delegated agent).

(2) If any cracking or breaking is found on any hydraulic line support bracket at FS672, before further flight, replace the hydraulic line support bracket using a method approved by either the Manager, New York ACO, ANE-170, FAA, or TCCA (or its delegated agent).

#### Reporting

(h) Submit a report of the findings of the inspection required by paragraph (g) of this

AD to Bombardier Regional Aircraft Customer Response Center, 13100 Boulevard Henri-Fabre, Mirabel, Quebec, Canada J7N 3C6; telephone: 1-514-855-8500; fax: 1-514-855-8501; e-mail:

*thd.crj@aero.bombardier.com*, at the applicable time specified in paragraph (h)(1) or (h)(2) of this AD. The report must include any finding of chafing of the IDG power cable or broken hydraulic line support bracket, the airplane serial number, and the number of landings and flight hours on the airplane.

(1) If the inspection was done on or after the effective date of this AD: Submit the report within 10 days after the inspection.

(2) If the inspection was done before the effective date of this AD: Submit the report within 10 days after the effective date of this AD.

#### FAA AD Differences

**Note 1:** This AD differs from the MCAI and/or service information as follows: No differences.

#### Other FAA AD Provisions

(i) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* A Federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and

suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave., SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

#### Related Information

(j) Refer to MCAI Canadian Airworthiness Directive CF-2011-18, dated July 7, 2011, for related information.

#### Material Incorporated by Reference

(k) None.

Issued in Renton, Washington, on August 12, 2011.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2011-21619 Filed 8-24-11; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

**[Docket No. FAA-2011-0439; Airspace Docket No. 11-ANM-10]**

#### **Amendment of Class D and Class E Airspace and Establishment of Class E Airspace; Casper, WY**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action amends Class D and Class E airspace at Casper, Natrona County International Airport, Casper, WY, by adjusting the geographic coordinates of the airport. This action also establishes Class E En Route Domestic airspace at the airport to improve the safety and management of IFR operations.

**DATES:** Effective date, 0901 UTC, October 20, 2011. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

**FOR FURTHER INFORMATION CONTACT:** Eldon Taylor, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue, SW., Renton, WA 98057; telephone (425) 203-4537.

#### **SUPPLEMENTARY INFORMATION:**

#### **History**

On June 21, 2011, the FAA published in the **Federal Register** a notice of proposed rulemaking to amend controlled airspace at Casper, WY (76 FR 36017). Interested parties were invited to participate in this rulemaking effort by submitting written comments

on the proposal to the FAA. No comments were received.

Class D and Class E airspace designations are published in paragraphs 5000, 6002, 6004, 6005 and 6006, respectively, of FAA Order 7400.9U dated August 18, 2010, and effective September 15, 2010, which is incorporated by reference in 14 CFR 71.1. The Class D and Class E airspace designations listed in this document will be published subsequently in that Order.

#### **The Rule**

This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 by amending Class D airspace, Class E surface airspace, Class E airspace designated as an extension, and Class E airspace extending upward from 700/1,200 feet above the surface, by adjusting the geographic coordinates of Casper, Natrona County International Airport to be in concert with the FAA's aeronautical database. Also, this action establishes Class E en route domestic airspace extending upward from 1,200 feet above the surface to facilitate vectoring of Instrument Flight Rules (IFR) traffic from en route airspace to the airport. This enhances the safety and management of IFR operations at the airport.

The FAA has determined this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this regulation: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that will only affect air traffic procedures and air navigation, it is certified this rule, when promulgated, will not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the U.S. Code. Subtitle 1, section 106 discusses the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in subtitle VII, part A, subpart I, section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of