

**(w) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on October 24, 2012.

(i) Boeing Alert Service Bulletin 737–53A1214, Revision 4, dated December 16, 2011.

(ii) Reserved.

(4) The following service information was approved for IBR on May 10, 1999 (64 FR 19879, April 23, 1999).

(i) Boeing 737 Nondestructive Test Manual D6–37239, Part 6, Section 53–10–54, dated December 5, 1998.

(ii) Boeing 737 Nondestructive Test Manual D6–37239, Part 6, Section 51–00–00, Figure 23, dated November 5, 1995.

(5) For The Boeing Company service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H–65, Seattle, Washington 98124–2207; telephone 206–544–5000, extension 1; fax 206–766–5680; Internet <https://www.myboeingfleet.com>.

(6) You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425–227–1221.

(7) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 31, 2012.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012–22334 Filed 9–18–12; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA–2012–0644; Directorate Identifier 2012–NM–011–AD; Amendment 39–17193; AD 2012–18–16]

**RIN 2120–AA64**

**Airworthiness Directives; The Cessna Aircraft Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain The Cessna Aircraft Company Model 750 airplanes. This AD was prompted by reports of direct current (DC) generator overvoltage events. This AD requires replacing the auxiliary power unit (APU) generator control unit (GCU). We are issuing this AD to prevent DC generator overvoltage events, which could result in smoke in the cockpit and loss of avionics and electrical systems.

**DATES:** This AD is effective October 24, 2012.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of October 24, 2012.

**ADDRESSES:** For service information identified in this AD, contact Cessna Aircraft Co., P.O. Box 7706, Wichita, Kansas 67277; telephone 316–517–6215; fax 316–517–5802; email [citationpubs@cessna.textron.com](mailto:citationpubs@cessna.textron.com); Internet <https://www.cessnasupport.com/newlogin.html>.

You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800–647–5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

[www.regulations.gov](http://www.regulations.gov); or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800–647–5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Christine Abraham, Aerospace Engineer, Electrical Systems and Avionics Branch, ACE–119W, FAA, Wichita Aircraft Certification Office, 1801 Airport Road, Room 100, Mid-Continent Airport, Wichita, Kansas 67209; telephone: 316–946–4165; fax: 316–946–4107; email: [christine.abraham@faa.gov](mailto:christine.abraham@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM published in the **Federal Register** on June 25, 2012 (77 FR 37827). That NPRM proposed to require replacing the auxiliary power unit (APU) generator control unit (GCU).

**Comments**

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (77 FR 37827, June 25, 2012) or on the determination of the cost to the public.

**Conclusion**

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed.

**Costs of Compliance**

We estimate that this AD affects 58 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement .....	2 work-hours × \$85 per hour = \$170 .....	\$2,400	\$2,570	\$149,060

According to the manufacturer, all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for

affected individuals. As a result, we have included all costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2012-18-16 The Cessna Aircraft Company:** Amendment 39-17193; Docket No.

FAA-2012-0644; Directorate Identifier 2012-NM-011-AD.

#### (a) Effective Date

This AD is effective October 24, 2012.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to The Cessna Aircraft Company Model 750 airplanes, certificated in any category, having serial numbers -0222, -0225 through -0306 inclusive, and -0308.

#### (d) Subject

Joint Aircraft System Component (JASC)/ Air Transport Association (ATA) of America Code 24, Electrical power.

#### (e) Unsafe Condition

This AD was prompted by reports of direct current (DC) generator overvoltage events. We are issuing this AD to prevent DC generator overvoltage events, which could result in smoke in the cockpit and loss of avionics and electrical systems.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Replacement

Except as required by paragraph (h) of this AD: Within 6 months after the effective date of this AD, replace the auxiliary power unit generator control unit (GCU) having part number (P/N) 9914752-2 with one having P/N 9914752-6, in accordance with the Accomplishment Instructions of Cessna Service Bulletin SB750-24-30, dated December 5, 2011.

#### (h) Exceptions

(1) Where the Accomplishment Instructions of Cessna Service Bulletin SB750-24-30, dated December 5, 2011, state that operators must return the GCU having P/N 9914752-2 to the manufacturer, this AD does not require that action.

(2) Where the Accomplishment Instructions of Cessna Service Bulletin SB750-24-30, dated December 5, 2011, state that the operator must record that the service bulletin has been completed, this AD does not require that action.

#### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Wichita Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in the Related Information section of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (j) Related Information

For more information about this AD, contact Christine Abraham, Aerospace Engineer, Electrical Systems and Avionics Branch, ACE-119W, FAA, Wichita Aircraft Certification Office, 1801 Airport Road, Room 100, Mid-Continent Airport, Wichita, Kansas 67209; telephone: 316-946-4165; fax: 316-946-4107; email: [christine.abraham@faa.gov](mailto:christine.abraham@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Cessna Service Bulletin SB750-24-30, dated December 5, 2011.

(ii) Reserved.

(3) For service information identified in this AD, contact Cessna Aircraft Co., P.O. Box 7706, Wichita, Kansas 67277; telephone 316-517-6215; fax 316-517-5802; email [citationpubs@cessna.textron.com](mailto:citationpubs@cessna.textron.com); Internet <https://www.cessnasupport.com/newlogin.html>.

(4) You may view this service information at FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on September 4, 2012.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2012-22337 Filed 9-18-12; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2011-0997; Directorate Identifier 2011-NM-043-AD; Amendment 39-16963; AD 2012-04-07]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

##### Correction

In rule document 2012-4498 appearing on pages 12989-12991 of the issue of Monday, March 5, 2012 make the following correction: