

high-power flight conditions typical of SAR operations. Additionally, AFCS hard-over, slow-over, and oscillatory malfunctions, particularly in yaw, require evaluation. AFCS malfunction testing must include a single or a combination of failures (for example, erroneous data from and loss of the radio altimeter, attitude, heading, and altitude sensors) which are not shown to be extremely improbable.

(6) The flight demonstration must include the following environmental conditions:

- (i) Swell into wind.
- (ii) Swell and wind from different directions.
- (iii) Cross swell.
- (iv) Swell of different lengths (short and long swell).

Issued in Fort Worth, Texas, on September 25, 2012.

Kimberly K. Smith,

Manager, Rotorcraft Directorate, Aircraft Certification Service.

[FR Doc. 2012-24676 Filed 10-4-12; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2012-0798; Directorate Identifier 2012-CE-023-AD; Amendment 39-17208; AD 2012-20-02]

RIN 2120-AA64

Airworthiness Directives; Alpha Aviation Concept Limited Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for Alpha Aviation Concept Limited Model R2160 Airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as possible installation of non-conforming air filter elements that are not fitted with metallic mesh and could internally collapse resulting in disruption of the powerplant operation. We are issuing this AD to require actions to address the unsafe condition on these products.

DATES: This AD is effective November 9, 2012.

The Director of the Federal Register approved the incorporation by reference

of a certain publication listed in the AD as of November 9, 2012.

ADDRESSES: You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Alpha Aviation, 59 Hautapu Road, RD 1, Cambridge 3493, New Zealand; telephone: +64 7 827 0528; fax: +64 7 929 2878; Internet: www.alphaaviation.co.nz/publications.shtml. You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

FOR FURTHER INFORMATION CONTACT: Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4146; fax: (816) 329-4090; email: karl.schletzbaum@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on July 30, 2012 (77 FR 44511). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

This emergency AD with the effective date 11 June 2012 is prompted by a report from EASA of finding a non conforming air filter fitted to an overseas aircraft during maintenance. Investigation revealed that air filters with P/N 57.34.00.010 supplied by CEAPR between June 2009 and April 2012 may not have the metallic mesh inside the filter. This AD mandates an inspection of air filters with P/N 57.34.00.010 to determine if a metallic mesh is fitted.

Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (77 FR 44511, July 30, 2012) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (77 FR 44511, July 30, 2012).

Costs of Compliance

We estimate that this AD will affect 10 products of U.S. registry. We also estimate that it will take about .5 work-hour per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this AD on U.S. operators to be \$425, or 42.50 per product.

In addition, we estimate that any necessary follow-on actions will take about .5 work-hour and require parts costing \$100 for a cost of \$142.50 per product. We have no way of determining the number of products that may need these actions.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and

Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

2012-20-02 Alpha Aviation Concept

Limited: Amendment 39-17208; Docket No. FAA-2012-0798; Directorate Identifier 2012-CE-023-AD.

(a) Effective Date

This airworthiness directive (AD) becomes effective November 9, 2012.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Alpha Aviation Concept Limited Model R2160 airplanes, all serial numbers, certificated in any category.

(d) Subject

Air Transport Association of America (ATA) Code 71: Power Plant.

(e) Reason

This AD was prompted by reports of possible installation of non-conforming air filter elements that are not fitted with

metallic mesh and could internally collapse resulting in disruption of the powerplant operation. We are issuing this AD to inspect the air filter element and replace if applicable.

(f) Actions and Compliance

Unless already done, do the following actions following Alpha Aviation Service Bulletin AA-SB-71-006, dated May 2012:

(1) Within the next 30 days time-in-service (TIS) after November 9, 2012 (the effective date of this AD), inspect the air filter part number (P/N) 57.34.00.010 to determine if it has been fitted with a perforated metal liner.

(2) If, after the inspection required in paragraph (f)(1) of this AD, the air filter part number (P/N) 57.34.00.010 is found to include the perforated metal liner, no further action is required.

(3) If, after the inspection required in paragraph (f)(1) of this AD, the air filter is found to not contain the perforated metal liner, before further flight, replace the air filter with a new air filter P/N 57.34.00.010 that does contain the perforated metal liner.

(4) After November 9, 2012 (the effective date of this AD), do not install any air filter P/N 57.34.00.010 that does not have the perforated metal liner depicted in Alpha Aviation Service Bulletin AA-SB-71-006, dated May 2012.

(g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4146; fax: (816) 329-4090; email: karl.schletzbaum@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, a federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of

information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

(h) Related Information

Refer to MCAI DCA/R2000/41 issued by the Civil Aviation Authority (CAA), which is the aviation authority for New Zealand, dated June 8, 2012; and Alpha Aviation Service Bulletin AA-SB-71-006, dated May 2012, for related information. For service information related to this AD, contact Alpha Aviation, 59 Hautapu Road, RD 1, Cambridge 3493, New Zealand; telephone: +64 7 827 0528; fax: +64 7 929 2878; Internet: www.alphaaviation.co.nz/publications.shtml. You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Alpha Aviation Service Bulletin AA-SB-71-006, dated May 2012.

(ii) Reserved.

(3) For Alpha Aviation service information identified in this AD, contact Alpha Aviation, 59 Hautapu Road, RD 1, Cambridge 3493, New Zealand; telephone: +64 7 827 0528; fax: +64 7 929 2878; Internet: www.alphaaviation.co.nz/publications.shtml.

(4) You may view this service information at FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on September 26, 2012.

Earl Lawrence,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012-24278 Filed 10-4-12; 8:45 am]

BILLING CODE 4910-13-P