

## The Withdrawal

Accordingly, we withdraw the NPRM, Docket No. FAA-2012-0805, Directorate Identifier 2012-NM-117-AD, which was published in the **Federal Register** on August 8, 2012 (77 FR 47329).

Issued in Renton, Washington, on June 13, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-14861 Filed 6-20-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-0463; Directorate Identifier 2012-NM-165-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A330-200, -200 Freighter, and -300 series airplanes. This proposed AD was prompted by a report that a certain wire harness located in the tail cone has wiring of a narrower gauge than design requires. This proposed AD would require replacing the affected wire harness. We are proposing this AD to prevent damage to the affected wiring, which could create an ignition source in an area that might contain fuel vapors, possibly resulting in an uncontrolled fire and subsequent loss of the airplane.

**DATES:** We must receive comments on this proposed AD by August 5, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

• *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS—Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: (425) 227-1138; fax: (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2013-0463; Directorate Identifier 2012-NM-165-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

##### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2012-0182, dated September 11, 2012 (referred to

after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

On a production aeroplane, it has been discovered that wires in harness 5877VB, installed in the Tail Cone (Section 19.1) and connected to the Auxiliary Power Unit starter, have a section smaller [narrower] than required by design. Section 19 is a flammable fluid leakage zone, adjacent to a fuel tank (trim tank) and is open with Section 19.1. The results of the investigation show that this issue is a manufacturing quality issue. Airbus identified a list of other aeroplanes that are affected.

This condition, if not corrected, could damage the wiring which may create an ignition source in an area that may contain fuel vapours, possibly resulting in an uncontrolled fire and subsequent loss of the aeroplane.

\* \* \* \* \*

For the reasons described above, this [EASA] AD requires the replacement of the affected wiring harness.

You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

Airbus has issued Mandatory Service Bulletin A330-92-3116, dated April 25, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 1 product of U.S. registry. We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$2,920 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control

warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$3,260, or \$3,260 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**Airbus:** Docket No. FAA-2013-0463; Directorate Identifier 2012-NM-165-AD.

##### (a) Comments Due Date

We must receive comments by August 5, 2013.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to Airbus Model A330-201, -202, -203, -223, -223F, -243 -243F, -301, -302, -303, -321, -322, -323, -341, -342, and -343 airplanes; certificated in any category; manufacturer serial numbers 1070, 1127, 1133, 1135, 1137, 1138, 1141, 1143, 1145, 1146, 1147, 1149, 1150, 1151, 1153, 1155, 1156, 1157, 1159, 1160, 1161, 1165, 1167, 1168, 1169, 1171, 1172, 1173, 1174, 1177, 1178, 1181, 1183, 1184, 1186, 1187, 1188, 1189, 1191, 1195, 1196, and 1202.

##### (d) Subject

Air Transport Association (ATA) of America Code 92.

##### (e) Reason

This AD was prompted by a report that a certain wire harness located in the tail cone has wiring of a narrower gauge than design requires. We are issuing this AD to prevent damage to the affected wiring, which could create an ignition source in an area that might contain fuel vapors, possibly resulting in an uncontrolled fire and subsequent loss of the airplane.

##### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

##### (g) Actions

Within 24 months after the effective date of this AD: Replace wiring harness 5877VB located in section 19.1, Frame 91 to Frame 96, in accordance with the Accomplishment Instructions of Airbus Mandatory Service Bulletin A330-92-3116, dated April 25, 2012.

##### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

- (1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your

request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: (425) 227-1138; fax: (425) 227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

##### (i) Related Information

(1) Refer to European Aviation Safety Agency (EASA) Mandatory Continuing Airworthiness Information (MCAI) Airworthiness Directive 2012-0182, dated September 11, 2012, for related information.

(2) For service information identified in this AD, contact Airbus SAS—Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax + 33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 12, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-14864 Filed 6-20-13; 8:45 am]

**BILLING CODE 4910-13-P**

## FEDERAL COMMUNICATIONS COMMISSION

### 47 CFR Part 15

[ET Docket No. 13-49; DA 13-1388]

### Unlicensed National Information Infrastructure (U-NII) Devices in the 5 GHz Band

**AGENCY:** Federal Communications Commission.

**ACTION:** Proposed rule; extension of comment period.

**SUMMARY:** This document extends the deadline for filing reply comments to the Notice of Proposed Rule Making (NPRM), released February 20, 2013. It