

AD terminates the repetitive inspection requirement required by AD 91-22-08, Amendment 39-8068 (56 FR 57233, November 8, 1991) for airplanes with line number 1103 and subsequent.

**(l) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in the Related Information section of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(m) Related Information**

(1) For more information about this AD, contact Galib Abumeri, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Blvd., Suite 100, Lakewood, CA 90712-4137; phone: 562-627-5324; fax: 562-627-5210; email: [Galib.Abumeri@faa.gov](mailto:Galib.Abumeri@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on July 5, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-17253 Filed 7-17-13; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2013-0624; Directorate Identifier 2013-NM-071-AD]

**RIN 2120-AA64**

**Airworthiness Directives; ATR-GIE Avions de Transport Régional Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain ATR-GIE Avions de Transport Régional Model ATR72-101, -201, -102, -202, -211, -212, and -212A airplanes. This proposed AD was prompted by reports of airplane incidents and accidents that have occurred because of low-level fuel tank situations and fuel starvation that resulted in engine flameouts. This proposed AD would require installing a fuel quantity indicator (FQI) equipped with a locking adaptor on the electrical connector. We are proposing this AD to prevent an engine flame-out, which could result in reduced controllability of the airplane.

**DATES:** We must receive comments on this proposed AD by September 3, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact ATR-GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

For service information identified in this proposed AD, contact ATR-GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1137; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0624; Directorate Identifier 2013-NM-071-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2013-0047, dated March 4, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

Large aeroplane incidents and accidents have occurred because of fuel tank low level situations, or because of fuel starvation, resulting in one or several engine(s) flame-out. The results of the investigation into an ATR 72 accident in August 2005 have shown that overruling standard operational procedures and maintenance practices have led to this kind of occurrence.

Consequently, additional actions to help avoid maintenance errors, like installation of a wrong gauge or wrong indicator, need to be taken.

Although it is recognized that the fuel (indicating) system of the ATR42/72 type design is compliant with the applicable requirements, the risk of other maintenance errors will be mitigated by making installation of an ATR 42 Fuel Quantity Indicator (FQI) on an ATR 72 aeroplane mechanically impossible through a specific design change on the ATR 72.

For the reasons described above, this [EASA] AD requires modification of the ATR 72 FQI by installing a locking adaptor on the electrical connector.

We are proposing this AD to prevent an engine flame-out, which could result in reduced controllability of the airplane. You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

Avions de Transport Régional has issued Service Bulletin ATR72–28–1026, dated February 26, 2013. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 25 products of U.S. registry. We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$3,882 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$101,300, or \$4,052 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**ATR–GIE Avions de Transport Régional:**  
Docket No. FAA–2013–0624; Directorate Identifier 2013–NM–071–AD.

#### (a) Comments Due Date

We must receive comments by September 3, 2013.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to ATR–GIE Avions de Transport Régional Model ATR72–101, –201, –102, –202, –211, –212, and –212A airplanes, certificated in any category, except airplanes that have received ATF modification 5948 in production.

#### (d) Subject

Air Transport Association (ATA) of America Code 28, Fuel.

#### (e) Reason

This AD was prompted by reports of airplane incidents and accidents that have occurred because of low-level fuel tank situations and fuel starvation that resulted in engine flameouts. We are issuing this AD to prevent an engine flame-out, which could result in reduced controllability of the airplane.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Installation

At the applicable compliance times specified in paragraph (g)(1) or (g)(2) of this AD: Install a fuel quantity indicator (FQI) equipped with a locking adaptor on the electrical connector, in accordance with the Accomplishment Instructions of Avions de Transport Régional Service Bulletin ATR72–28–1026, dated February 26, 2013.

(1) For airplanes on which a fuel secondary low level detection system is not installed: Within 24 months after the effective date of this AD.

(2) For airplanes on which a fuel secondary low level detection system is installed: Within 36 months after the effective date of this AD.

**Note 1 to paragraph (g) of this AD:** The fuel secondary low level detection system may have been installed through the embodiment of ATR modification 04686 in production, or as applicable, through ATR Service Bulletins ATR72–28–1013 or ATR72–28–1022 in service.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1137; fax (425) 227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency Airworthiness Directive 2013-0047, dated March 4, 2013; and Avions de Transport Régional Service Bulletin ATR72-28-1026, dated February 26, 2013; for related information.

(2) For service information identified in this AD, contact ATR-GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on July 11, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-17293 Filed 7-17-13; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2013-0545; Directorate Identifier 2013-NM-048-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 727 airplanes. This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. This proposed AD would require an inspection for cracks in the main wheel well pressure floor and a preventive modification or permanent repair, as applicable. We are proposing this AD to prevent cracking in the main wheel well pressure floor, which could result in reduced structural integrity of the airplane, and decompression of the cabin.

**DATES:** We must receive comments on this proposed AD by September 3, 2013.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington 98057-3356. For information on the availability of

this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Galib Abumeri, Aerospace Engineer, Airframe Branch, ANM 120L, FAA, Los Angeles Aircraft Certification Office (ACO), 3960 Paramount Blvd., Suite 100, Lakewood, CA 90712 4137; phone: 562-627-5324; fax: 562-672-5210; email: [galib.abumeri@faa.gov](mailto:galib.abumeri@faa.gov).

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0545; Directorate Identifier 2013-NM-048-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

As described in FAA Advisory Circular 120-104 ([http://www.faa.gov/documentLibrary/media/Advisory\\_Circular/120-104.pdf](http://www.faa.gov/documentLibrary/media/Advisory_Circular/120-104.pdf)), several programs have been developed to support initiatives that will ensure the continued airworthiness of aging airplane structure. The last element of those initiatives is the requirement to establish a LOV of the engineering data that support the structural maintenance program under 14 CFR 26.21. This proposed AD is the result of an assessment of the previously established programs by The Boeing Company during the process of establishing the