

Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**Bombardier, Inc.:** Docket No. FAA–2013–0798; Directorate Identifier 2013–NM–087–AD.

#### (a) Comments Due Date

We must receive comments by November 12, 2013.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc. Model BD–100–1A10 (Challenger 300) airplanes, certificated in any category, serial numbers 20003 and subsequent.

#### (d) Subject

Air Transport Association (ATA) of America Code 24, Electrical power.

#### (e) Reason

This AD was prompted by multiple reports of erratic electrical status indications on the push button annunciators and the engine instrument and crew alerting system. Certain of those reported incidents resulted in the airplane experiencing a momentary loss of electrical power and loss of flight displays. We are issuing this AD to prevent loss of electrical power, which could result in the loss of flight displays and reduced controllability of the airplane.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Direct Current Power Centers (DCPC) Modification

For airplanes having serial numbers 20003 through 20405 inclusive: Within 800 flight hours after the effective date of this AD or within 24 months after the effective date of this AD, whichever occurs first, modify the left-hand DCPC, right-hand DCPC, and auxiliary DCPC, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 100–24–23, dated November 26, 2012.

#### (h) Parts Installation Limitation

As of the effective date of this AD, no person may install a DCPC having a part number specified in paragraph (h)(1) through (h)(9) of this AD on any airplane, unless the DCPC serial number has a suffix “R” beside the serial number.

- (1) 970GC02Y04
- (2) 970GC02Y05
- (3) 970GC02Y06
- (4) 975GC02Y04
- (5) 975GC02Y05
- (6) 975GC02Y06
- (7) 320GC03Y04
- (8) 320GC03Y05
- (9) 320GC03Y06

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District

Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2013–05, dated February 22, 2012, for related information, which can be found in the AD docket on the Internet at <http://www.regulations.gov>.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on September 17, 2013.

#### Ross Landes,

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013–23335 Filed 9–24–13; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2013–0799; Directorate Identifier 2012–NM–153–AD]

RIN 2120–AA64

#### Airworthiness Directives; ATR–GIE Avions de Transport Régional Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain ATR–GIE Avions de Transport Régional

Model ATR42 and Model ATR72 airplanes. This proposed AD was prompted by reports of defective sealing between the nacelle lower fairing and the underwing box. This proposed AD would require a one-time general visual inspection for damaged (worn, torn, or abraded) or missing seals between the nacelle lower fairing and the underwing box of both the left-hand and right-hand engine nacelles, and replacement of the seal and/or shims if necessary. We are proposing this AD to prevent the decrease of the fire extinguishing agent efficiency, which could delay fire extinction and allow fire propagation out of the nacelle fire protected area, resulting in damage to the airplane.

**DATES:** We must receive comments on this proposed AD by November 12, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact ATR-GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket

contains this proposed AD, the MCAI, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt. **FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-227-1137; fax: 425-227-1149; email: [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2013-0799; Directorate Identifier 2012-NM-153-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2012-0160, dated August 24, 2012 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

Some cases of defective sealing have been reported on in-service aeroplanes on Left-Hand (LH) and Right-Hand (RH), between the nacelle lower fairing and the underwing box.

Investigation results have shown that this issue was due to either damaged or missing seal and/or incorrect adjustment of the nacelle lower fairing.

This condition, if not detected and corrected, may decrease the extinguishing agent efficiency, delay the fire extinction and allow fire propagation out of the nacelle fire protected area, possibly resulting in damage to the aeroplane.

For the reasons described above, this [EASA] AD requires a one-time [general visual] inspection of the affected area [between the nacelle lower fairing and the underbox wing for damaged (worn, torn, or abraded) or missing seals] and, depending on findings, accomplishment of applicable corrective actions to restore the area integrity.

Corrective actions include replacing the seal and/or shims. You may obtain further information by examining the MCAI in the AD docket.

**Relevant Service Information**

ATR-GIE Avions de Transport Régional has issued Service Bulletins ATR42-54-0029 and ATR72-54-1023, both dated July 18, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

**Differences Between This AD and the MCAI or Service Information**

The MCAI and service bulletins refer only to an inspection of the gaps and seal conditions between the nacelle lower fairing and the underwing box. This AD requires a general visual inspection for damaged or missing seals between the nacelle lower fairing and the underwing box.

**Costs of Compliance**

We estimate that this proposed AD affects 42 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection .....	4 work-hours × \$85 per hour = \$340 .....	\$0	\$340	\$14,280

We estimate the following costs to do any necessary replacements that would be required based on the results of the proposed inspection. We have no way of determining the number of aircraft that might need these replacements:

## ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replacement .....	36 work-hours × \$85 per hour = \$3,060 .....	\$341	\$3,401

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this proposed AD is 2120-0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW., Washington, DC 20591. ATTN: Information Collection Clearance Officer, AES-200.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a

substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new AD:

**ATR—GIE Avions de Transport Régional:**  
Docket No. FAA-2013-0799; Directorate Identifier 2012-NM-153-AD.

**(a) Comments Due Date**

We must receive comments by November 12, 2013.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to the airplanes identified in paragraph (c)(1) and (c)(2) of this AD.

(1) ATR—GIE Avions de Transport Régional Model ATR42-200, -300, -320, and -500 airplanes, certificated in any category, manufacturer serial number 003 through 623 inclusive.

(2) ATR—GIE Avions de Transport Régional Model ATR72-101, -201, -102, -202, -211, -212, and -212A airplanes, certificated in any category, manufacturer serial number 108 through 710 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 54, Nacelles/pylons.

**(e) Reason**

This AD was prompted by reports of defective sealing between the nacelle lower fairing and the underwing box. We are issuing this AD to prevent the decrease of the fire extinguishing agent efficiency, which could delay fire extinction and allow fire propagation out of the nacelle fire protected area, resulting in damage to the airplane.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Inspection and Corrective Actions**

Within 5,000 flight hours after the effective date of this AD: Do a one-time general visual inspection for damaged (worn, torn, or abraded) and missing shims and seals, between the nacelle lower fairing and the underwing box of both the left-hand and right-hand engine nacelles, in accordance with the Accomplishment Instructions of Avions de Transport Régional Service Bulletin ATR42-54-0029; or ATR72-54-1023, both dated July 18, 2012; as applicable. If any seal or shim is damaged or missing, before further flight, replace, as applicable, in accordance with the Accomplishment Instructions of Avions de Transport Régional Service Bulletin ATR42-54-0029; or ATR72-54-1023, both dated July 18, 2012; as applicable.

**(h) Reporting**

At the applicable time specified in paragraph (h)(1) or (h)(2) of this AD: Submit a report using the applicable Accomplishment Report of Avions de Transport Régional Service Bulletin ATR42-54-0029; or ATR72-54-1023, both dated July 18, 2012; to ATR Engineering, Service Bulletin Group, 1 Allée Pierre Nadot, 31712 Blagnac Cedex, France; phone: +33 (0)5 62 21 62 21; fax: +33 (0)5 62 21 69 41; email: [techdesk@atr.fr](mailto:techdesk@atr.fr).

(1) If the inspection was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(2) If the inspection was done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-227-1137; fax: 425-227-1149; email: [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov). Information may be emailed to: [9-ANM-11-AMOC-REQUESTS@faa.gov](mailto:9-ANM-11-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) Airworthiness Directive 2012-0160, dated August 24, 2012, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov>.

(2) For service information identified in this AD, contact ATR—GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may review copies of this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on September 17, 2013.

**Ross Landes,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-23315 Filed 9-24-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-0797; Directorate Identifier 2013-NM-007-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 767-300 and 767-300F series airplanes. This proposed AD was prompted by reports of malfunctions in the flight deck display units resulting in blanking, blurring, or loss of color on the display. This proposed AD would require modification and installation of components in the main equipment center. For certain other airplanes this proposed AD would require modification, replacement, and installation of flight deck air relief system (FDARS) components. We are proposing this AD to prevent malfunctions of the flight deck display units, which could affect the ability of the flightcrew to read the displays for airplane attitude, altitude, or airspeed, and consequently reduce the ability of the flightcrew to maintain control of the airplane.

**DATES:** We must receive comments on this proposed AD by November 12, 2013.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax*: 202-493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For Boeing service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Francis Smith, Aerospace Engineer, Cabin Safety and Environmental Controls Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, Washington 98057-3356; phone: 425-917-6596; fax: 425-917-6590; email: [francis.smith@faa.gov](mailto:francis.smith@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2013-0797; Directorate Identifier 2013-NM-007-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the