

flight hours, this AD requires compliance within the corresponding time in total flight cycles/total flight hours; except for tables for post-repair and post-modification airplanes, this AD requires compliance within the corresponding time after accomplishing the repair or modification.

#### (o) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (k) of this AD, if those actions were performed before the effective date of this AD using the applicable service bulletin specified in paragraphs (o)(1) through (o)(4) of this AD.

(1) Airbus Mandatory Service Bulletin A300-54-0071, Revision 02, dated August 25, 2000 (for Model A300 B2-203, B2K-3C, B4-103, B4-203, and B4-2C airplanes), which is not incorporated by reference in this AD.

(2) Airbus Mandatory Service Bulletin A300-54-0071, Revision 03, dated October 5, 2012 (for Model A300 B2-203, B2K-3C, B4-103, B4-203, and B4-2C airplanes), which is not incorporated by reference in this AD.

(3) Airbus Mandatory Service Bulletin A310-54-2016, Revision 04, dated November 16, 2007; or Airbus Mandatory Service Bulletin A310-54-2016, Revision 05, dated October 5, 2012 (for Model A310-221, -222, -322, -324, and -325 airplanes), which are not incorporated by reference in this AD.

(4) Airbus Mandatory Service Bulletin A300-54-6011, Revision 02, dated August 25, 2000 (for Model A300 B4-620, B4-622R, and B4-622 airplanes), which is not incorporated by reference in this AD.

#### (p) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-2125; fax (425) 227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they were approved by the State of Design Authority (or its delegated agent, or by the Design Approval Holder with a State of Design Authority's design organization approval). For a repair method to be approved, the

repair approval must specifically refer to this AD. You are required to ensure the product is airworthy before it is returned to service.

(3) *Previous AMOCs*: AMOCs approved previously for AD 2000-12-12, Amendment 39-11790 (65 FR 39072, June 23, 2000), are approved as AMOCs for the corresponding provisions of this AD.

#### (q) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency Airworthiness Directive 2013-0216, dated September 17, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2013-1066.

(2) For service information identified in this AD, contact Airbus SAS—EAW (Airworthiness Office), 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on December 19, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-31186 Filed 12-27-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-1067; Directorate Identifier 2013-NM-164-AD]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC-8-400 series airplanes. This proposed AD was prompted by reports of missing clamps that are required to provide positive separation between the alternating current (AC) feeder cables and the hydraulic line of the landing gear alternate extension. This proposed AD would require inspecting for missing clamps, and related investigative and corrective actions if necessary. We are proposing this AD to detect and correct

chafing of the AC feeder cable. A chafed and arcing AC feeder cable could puncture the adjacent hydraulic line, which, in combination with the use of the alternate extension system, could result in an in-flight fire.

**DATES:** We must receive comments on this proposed AD by February 13, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Assata Dessaline, Aerospace Engineer, Avionics and Service Branch, ANE-172, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone (516) 228-7301; fax (516) 794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments

to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2013–1067; Directorate Identifier 2013–NM–164–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF–2013–16, dated June 14, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

During production checks, it was found that the appropriate clamps required to provide positive separation between the AC feeder cables and the hydraulic line of the landing gear alternate extension were omitted. The AC feeder cable could sag and be in direct contact with the swage fitting of the landing gear alternate extension hydraulic line, resulting in chafing of the AC feeder cable. The chafed and arcing AC feeder cable could puncture the adjacent hydraulic line. In combination with the use of the alternate extension system, this could result in an in-flight fire.

This [TCCA] AD mandates the [general visual] inspection [for missing clamps], and rectification [related investigative and corrective actions] as necessary, for proper clamp installation.

The related investigative action is a general visual inspection of the AC power feeder cables and the hydraulic line for damage due to chafing. The corrective actions include repair of chafed parts, and replacement of missing clamps. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA–2013–1067.

### Relevant Service Information

Bombardier, Inc. has issued Bombardier Service Bulletin 84–24–53, Revision A, dated May 16, 2013. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

### Costs of Compliance

We estimate that this proposed AD affects 78 airplanes of U.S. registry.

We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$13,260, or \$170 per product.

In addition, we estimate that any necessary follow-on actions would take about 2 work-hours and require parts costing \$11, for a cost of \$181 per product. We have received no definitive data that would enable us to provide cost estimates for the on-condition repair of the AC power feeder cables and hydraulic lines specified in this proposed AD. We have no way of determining the number of aircraft that might need these actions.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications

under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA–2013–1067; Directorate Identifier 2013–NM–164–AD.

#### (a) Comments Due Date

We must receive comments by February 13, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc. Model DHC–8–400, –401, and –402 airplanes, certificated in any category, serial numbers 4001 through 4347 inclusive.

#### (d) Subject

Air Transport Association (ATA) of America Code 24, Electrical power.

#### (e) Reason

This AD was prompted by reports of missing clamps that are required to provide positive separation between the alternating current (AC) feeder cables and the hydraulic line of the landing gear alternate extension.

We are issuing this AD to detect and correct chafing of the AC feeder cable. A chafed and arcing AC feeder cable could puncture the adjacent hydraulic line, which, in combination with the use of the alternate extension system, could result in an in-flight fire.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Clamp Inspection, Related Investigative Actions, and Corrective Actions

Within 6,000 flight hours or 36 months after the effective date of this AD, whichever occurs earlier: Do a general visual inspection for installation of clamps between the AC feeder cables and hydraulic line; and do all applicable related investigative and corrective actions; in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-24-53, Revision A, dated May 16, 2013. Do all applicable related investigative and corrective actions before further flight.

#### (h) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 84-24-53, dated May 11, 2012.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they were approved by the State of Design Authority (or its delegated agent, or the DAH with a State of Design Authority's design organization approval). For a repair method to be approved, the repair approval must specifically refer to this AD. You are required to ensure the product is airworthy before it is returned to service.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2013-16, dated

June 14, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2013-1067.

(2) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on December 20, 2013.

**Jeffrey E. Duven,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-31188 Filed 12-27-13; 8:45 am]

**BILLING CODE 4910-13-P**

## ENVIRONMENTAL PROTECTION AGENCY

### 40 CFR Part 52

[EPA-R06-OAR-2013-0439; FRL-9904-87-Region-6]

### Approval and Promulgation of Air Quality Implementation Plans; Texas; Stage II Vapor Recovery Program and Control of Air Pollution From Volatile Organic Compounds

**AGENCY:** Environmental Protection Agency (EPA).

**ACTION:** Proposed rule.

**SUMMARY:** The Environmental Protection Agency (EPA) is proposing to approve revisions to the Texas State Implementation Plan (SIP) submitted by the Texas Commission on Environmental Quality (TCEQ). The EPA is proposing to approve revisions to regulations that control emissions of volatile organic compounds (VOCs) at gasoline dispensing facilities (GDFs) in Texas. The revisions address the maintenance and removal of Stage II vapor recovery equipment at GDFs. The EPA is also proposing to approve related revisions to the Stage II SIP narrative that pertain to the maintenance and removal of Stage II vapor recovery equipment and demonstrate that the absence of Stage II equipment in the Beaumont-Port Arthur (BPA), Dallas-Fort Worth (DFW) and Houston-Galveston Brazoria (HGB) areas, and in El Paso County would not interfere with attainment of the national ambient air quality standards (NAAQS) for ozone, reasonable further progress (RFP) or any other requirement of the Clean Air Act

(CAA or Act). The EPA is proposing to approve these revisions pursuant to section 110 of the Act and the EPA's regulations and consistent with the EPA's guidance.

**DATES:** Comments must be received on or before January 29, 2014.

**ADDRESSES:** Submit your comments, identified by Docket ID No. EPA-R06-OAR-2013-0439, by one of the following methods:

- [www.regulations.gov](http://www.regulations.gov). Follow the on-line instructions.

- *E-Mail:* Ms. Carrie Paige at [paige.carrie@epa.gov](mailto:paige.carrie@epa.gov).

- *Mail:* Mr. Guy Donaldson, Chief, Air Planning Section (6PD-L), Environmental Protection Agency, 1445 Ross Avenue, Suite 1200, Dallas, Texas 75202-2733.

*Instructions:* Direct your comments to Docket ID No. EPA-R06-OAR-2013-0439. EPA's policy is that all comments received will be included in the public docket without change and may be made available online at <http://www.regulations.gov>, including any personal information provided, unless the comment includes information claimed to be Confidential Business Information (CBI) or other information the disclosure of which is restricted by statute. Do not submit information through <http://www.regulations.gov> or email, if you believe that it is CBI or otherwise protected from disclosure. The <http://www.regulations.gov> Web site is an "anonymous access" system, which means that EPA will not know your identity or contact information unless you provide it in the body of your comment. If you send an email comment directly to EPA without going through <http://www.regulations.gov>, your email address will be automatically captured and included as part of the comment that is placed in the public docket and made available on the Internet. If you submit an electronic comment, EPA recommends that you include your name and other contact information in the body of your comment along with any disk or CD-ROM submitted. If EPA cannot read your comment due to technical difficulties and cannot contact you for clarification, EPA may not be able to consider your comment. Electronic files should avoid the use of special characters and any form of encryption and should be free of any defects or viruses. For additional information about EPA's public docket, visit the EPA Docket Center homepage at <http://www.epa.gov/epahome/dockets.htm>.

*Docket:* The index to the docket for this action is available electronically at [www.regulations.gov](http://www.regulations.gov) and in hard copy