

**Pratt & Whitney Canada Corporation:** Docket No. FAA-2014-0159; Directorate Identifier 2014-NE-01-AD.

**(a) Comments Due Date**

We must receive comments by June 9, 2014.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Pratt & Whitney Canada Corporation (P&WC) model PW150A turboprop engines, serial number PCE-FA0916 and earlier.

**(d) Reason**

This AD was prompted by reports of damage to a high-pressure fuel line, which could result in a high-pressure fuel leak into the engine nacelle. We are issuing this AD to prevent high-pressure fuel leaks, which could cause engine fire and damage to the engine and the airplane.

**(e) Actions and Compliance**

Comply with this AD within the compliance times specified, unless already done.

(1) At the next shop visit, but before 36 months from the effective date of this AD, reroute the igniter cables and install new support brackets in accordance with Accomplishment Instructions, paragraph 3.B., of P&WC Service Bulletin (SB) No. PW150-72-35274, Revision 1, dated May 3, 2012.

(2) Reserved.

**(f) Definition**

For the purpose of this AD, a shop visit is when the engine is disassembled to the extent necessary to gain access to the igniter cables.

**(g) Credit for Previous Action**

If you performed the actions of paragraph (e) of this AD before the effective date of this AD using P&WC SB No. PW150-72-35274, Initial Issue, dated March 23, 2012, you met the requirements of this AD.

**(h) Alternative Methods of Compliance (AMOCs)**

The Manager, Engine Certification Office, FAA, may approve AMOCs to this AD. Use the procedures found in 14 CFR 39.19 to make your request.

**(i) Related Information**

(1) For more information about this AD, contact Wego Wang, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7134; fax: 781-238-7199; email: [wego.wang@faa.gov](mailto:wego.wang@faa.gov).

(2) Refer to MCAI Transport Canada AD CF-2014-09, dated February 12, 2014, for more information. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2014-0159.

(3) P&WC SB No. PW150-72-35274, Revision 1, dated May 3, 2012, pertains to the

subject of this AD and can be obtained from P&WC using the contact information in paragraph (i)(4) of this AD.

(4) For service information identified in this AD, contact Pratt & Whitney Canada Corp., 1000 Marie-Victorin, Longueuil, Quebec, Canada, J4G 1A1; phone: 800-268-8000; fax: 450-647-2888; Internet: [www.pwc.ca](http://www.pwc.ca).

(5) You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on April 3, 2014.

**Colleen M. D'Alessandro,**

*Assistant Directorate Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2014-08009 Filed 4-9-14; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2014-0193; Directorate Identifier 2013-NM-234-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A318, A319, A320, and A321 series airplanes. This proposed AD was prompted by a report of a crack found in the fuselage during a fatigue test campaign. This proposed AD would require repetitive rototest inspections for cracking; corrective actions if necessary; and modification of the torsion box, which would terminate the repetitive inspections. We are proposing this AD to prevent cracking in the side box beam flange of the fuselage, which could affect the structural integrity of the airplane.

**DATES:** We must receive comments on this proposed AD by May 27, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

• *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus, Airworthiness Office—EAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0193; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Branch, ANM 116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1405; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0193; Directorate Identifier 2013-NM-234-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2013–0261, dated October 28, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

During the full scale fatigue test campaign of the A320 family type design, a crack was reported in the fuselage side box beam flange at frame (FR) 43 level, both sides.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

For the reason describe above, this [EASA] AD requires repetitive inspections of the fuselage side box beam flange at FR43, and, depending on findings, corrective action(s) [repair]. This [EASA] AD also requires a modification, which constitutes terminating action for the repetitive inspections.

The modification includes related investigative and corrective actions. The related investigative actions include a rotoprobe inspection of the holes for cracks, and a high frequency eddy current (HFEC) inspection for cracks. The corrective action includes repair. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA–2014–0193.

### Relevant Service Information

Airbus has issued Service Bulletin A320–53–1251, Revision 01, dated October 18, 2013, and Service Bulletin A320–53–1258, dated October 18, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

### Repair Approvals

In many FAA transport ADs, when the service information specifies to contact the manufacturer for further instructions if certain discrepancies are found, we typically include in the AD a requirement to accomplish the action using a method approved by either the FAA or the State of Design Authority (or its delegated agent).

We have recently been notified that certain laws in other countries do not allow such delegation of authority, but some countries do recognize design approval organizations. In addition, we have become aware that some U.S. operators have used repair instructions that were previously approved by a State of Design Authority or a Design Approval Holder (DAH) as a method of compliance with this provision in FAA ADs. Frequently, in these cases, the previously approved repair instructions come from the airplane structural repair manual or the DAH repair approval statements that were not specifically developed to address the unsafe condition corrected by the AD. Using repair instructions that were not specifically approved for a particular AD creates the potential for doing repairs that were not developed to address the unsafe condition identified by the MCAI AD, the FAA AD, or the applicable service information, which could result in the unsafe condition not being fully corrected.

To prevent the use of repairs that were not specifically developed to correct the unsafe condition, certain requirements of this proposed AD would require that the repair approval specifically refer to the FAA AD. This change is intended to clarify the method of compliance and to provide operators with better visibility of repairs that are specifically developed and approved to correct the unsafe condition. In addition, we use the phrase “its delegated agent, or the DAH with State of Design Authority design organization approval, as applicable” in this proposed AD to refer to a DAH authorized to approve certain required repairs for this proposed AD.

### Costs of Compliance

We estimate that this proposed AD affects 851 airplanes of U.S. registry.

We also estimate that it would take about 178 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$31,334 per product. Based on these figures, we estimate the cost of this proposed AD on

U.S. operators to be \$39,540,864, or \$46,464 per product.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2014–0193; Directorate Identifier 2013–NM–234–AD.

#### (a) Comments Due Date

We must receive comments by May 27, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus Model A318–111, –112, –121, and –122 airplanes; Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–111, –211, –212, –214, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes; certificated in any category; all manufacturer serial numbers on which Airbus modification 21202 has been embodied in production, except those on which modification 152569 has been embodied in production.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Reason

This AD was prompted by a report of a crack found in the side box beam flange of the fuselage at the frame (FR) 43 level during a fatigue test campaign. We are issuing this AD to prevent cracking in the side box beam flange of the fuselage, which could affect the structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Inspection

At the time specified in paragraph (g)(1) or (g)(2) of this AD, whichever occurs later: Do a rototest inspection for cracking of the beam flange of the stiffener 15 side box on the left- and right-hand sides in the FR43 area, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320–53–1258, dated October 18, 2012. Repeat the inspection thereafter at intervals not to exceed 7,500 flight cycles or 15,000 flight hours, whichever occurs first.

(1) Before exceeding 24,000 flight cycles or 48,000 flight hours, whichever occurs first since the airplane's first flight.

(2) Within 3,000 flight cycles or 6,000 flight hours, whichever occurs first after the effective date of this AD.

#### (h) Corrective Action

If any crack is found during any inspection required by paragraph (g) of this AD: Before

further flight, repair using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or European Aviation Safety Agency (EASA) (or its delegated agent, or the Design Approval Holder (DAH) with EASA design organization approval). For a repair method to be approved, the repair approval must specifically refer to this AD.

#### (i) Modification

Before exceeding 48,000 flight cycles or 96,000 flight hours, whichever occurs first since the airplane's first flight: Modify the fittings on the left- and right-hand sides of the torsion box, including doing all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320–53–1251, Revision 01, dated October 18, 2013; except where Airbus Service Bulletin A320–53–1251, Revision 01, dated October 18, 2013, specifies to contact Airbus for repair, before further flight, repair using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or European Aviation Safety Agency (EASA) (or its delegated agent, or the Design Approval Holder (DAH) with EASA design organization approval). For a repair method to be approved, the repair approval must specifically refer to this AD.

#### (j) Terminating Action

Modification of the airplane as required by paragraph (i) of this AD constitutes terminating action for the repetitive inspections required by paragraph (g) of this AD.

#### (k) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (i) of this AD, if those actions were performed before the effective date of this AD using Airbus Service Bulletin A320–53–1251, November 16, 2012, which is not incorporated by reference in this AD.

#### (l) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM–116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM 116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone (425) 227 1405; fax (425) 227–1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they were approved by the State of Design Authority (or its delegated agent, or the DAH with a State of Design Authority's design organization approval, as applicable). For a repair method to be approved, the repair approval must specifically refer to this AD. You are required to ensure the product is airworthy before it is returned to service.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2013–0261, dated October 28, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA–2014–0193.

(2) For service information identified in this AD, contact Airbus, Airworthiness Office—EAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on April 1, 2014.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014–08071 Filed 4–9–14; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF HEALTH AND HUMAN SERVICES

### 42 CFR Part 85a

[Docket No. CDC–2014–0001; NIOSH–271]

RIN 0920–AA51

### Occupational Safety and Health Investigations of Places of Employment

**AGENCY:** Centers for Disease Control and Prevention, HHS.

**ACTION:** Notice of proposed rulemaking; withdrawal.

**SUMMARY:** The National Institute for Occupational Safety and Health (NIOSH) in the Centers for Disease Control and Prevention (CDC) within the Department of Health and Human Services (HHS) is withdrawing a previously published notice of proposed rulemaking that solicited public comment on minor technical amendments to regulatory text.

**DATES:** The notice of proposed rulemaking published at 79 FR 2809,