

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2014-0430; Directorate Identifier 2014-NM-083-AD]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes**AGENCY:** Federal Aviation Administration (FAA), DOT.**ACTION:** Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all The Boeing Company Model 767 airplanes. This proposed AD was prompted by a report of a rotary actuator for the trailing edge (TE) flap that had slipped relative to its mating reaction ring, which is attached to the flap support rib. This proposed AD would require repetitive inspections for corrosion of the fixed ring gear and reaction ring splines of the rotary actuator assembly for each support position, and related investigative and corrective actions if necessary. We are proposing this AD to detect and correct reaction ring gears and rotary actuator gears from becoming disengaged with flaps extended and causing an uncommanded roll due to flap blowback, overload, or flap departure from the airplane, which could compromise safe flight and landing of the airplane.

DATES: We must receive comments on this proposed AD by August 25, 2014.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202-493-2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at

the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0430; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Allen Rauschendorfer, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6487; fax: 425-917-6590; email: Allen.Rauschendorfer@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0430; Directorate Identifier 2014-NM-083-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We have received a report of a TE flap rotary actuator that had slipped relative to its mating reaction ring, which is attached to the flap support rib. This occurred on a Model 767-300ER airplane that was delivered in June 1997 and had accumulated approximately 79,000 total flight hours and 14,000 total flight cycles in service. Removal of the reaction ring and actuator revealed that the mating splines were severely

corroded. The manufacturer determined that, if the corrosion were to affect the mating splines on either surface (actuator or ring) to the point where they could no longer effectively engage, the actuator would be prone to possible slippage. Due to the similarity of the design, the potential condition could develop at multiple flap supports. Should degradation reach the point where both actuators on a single flap were unable to react to the torsion created by air loads, an uncommanded flap retraction, or blowback could occur. The condition of uncommanded roll with flaps extended, due to flap blowback, overload, or flap departure from the airplane, could compromise safe flight and landing of the airplane.

Relevant Service Information

We reviewed Boeing Alert Service Bulletin 767-27A0229, dated March 4, 2014. For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for Docket No. FAA-2014-0430.

FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing the repetitive inspections for corrosion of the fixed ring gear and reaction ring splines of the rotary actuator assembly for each support position, and related investigative and corrective actions if necessary, specified in the service information described previously.

The phrase "related investigative actions" is used in this proposed AD. "Related investigative actions" are follow-on actions that (1) are related to the primary actions, and (2) further investigate the nature of any condition found. Related investigative actions in an AD could include, for example, inspections.

The phrase "corrective actions" is used in this proposed AD. "Corrective actions" are actions that correct or address any condition found. Corrective actions in an AD could include, for example, repairs.

Explanation of "RC" Steps in Service Information

The FAA worked in conjunction with industry, under the Airworthiness Directive Implementation Aviation Rulemaking Committee, to enhance the

AD system. One enhancement was a new process for annotating which steps in the service information are required for compliance (RC) with an AD. Differentiating these steps from other tasks in the service information is expected to improve an owner's/operator's understanding of crucial AD requirements and help provide consistent judgment in AD compliance. The actions specified in the service information described previously include steps that are labeled as RC

(required for compliance) because these steps have a direct effect on detecting, preventing, resolving, or eliminating an identified unsafe condition.

As noted in the specified service information, steps labeled as RC must be done to comply with the proposed AD. However, steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or done using accepted methods different from those identified in the service information without obtaining approval

of an alternative method of compliance (AMOC), provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC will require approval of an AMOC.

Costs of Compliance

We estimate that this proposed AD affects 389 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection	60 work-hours × \$85 per hour = \$5,100 per inspection cycle.	\$0	\$5,100 per inspection cycle.	\$1,983,900 per inspection cycle.

We estimate the following costs to do any necessary repairs that would be

required based on the results of the proposed inspection. We have no way of

determining the number of aircraft that might need these repairs:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Actuator repair	4 work-hours × \$85 per hour = \$340 per actuator	\$0	\$340 per actuator.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA-2014-0430; Directorate Identifier 2014-NM-083-AD.

(a) Comments Due Date

We must receive comments by August 25, 2014.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 767-200, -300, -300F, and -400ER series airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report of a trailing edge (TE) flap rotary actuator that had slipped relative to its mating reaction ring, which is attached to the flap support rib. We are issuing this AD to detect and correct reaction ring gears and rotary actuator gears from becoming disengaged with flaps extended and causing an uncommanded roll due to flap blowback, overload, or flap departure from the airplane, which could compromise safe flight and landing of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Repetitive Inspections, Related Investigative Actions, and Corrective Actions

Except as provided by paragraph (h) of this AD, at the applicable time specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 767-27A0229, dated March 4, 2014: Do a detailed inspection for corrosion of the rotary actuator assembly fixed ring gear and reaction ring splines for each support position; and do all applicable related investigative and corrective actions if necessary; in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 767-27A0229, dated March 4, 2014. Do all applicable related investigative and corrective actions before further flight. Repeat the inspection of the rotary actuator assembly fixed ring gear and reaction ring splines for each support position thereafter at the applicable intervals specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 767-27A0229, dated March 4, 2014.

(h) Exception to the Requirements of Paragraph (g) of This AD

Where paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 767-27A0229, dated March 4, 2014, specifies a compliance time "after the original issue date of this service bulletin," this AD requires compliance within the specified compliance time "after the effective date of this AD."

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane and the approval must specifically refer to this AD.

(4) If the service information contains steps that are labeled as RC (Required for Compliance), those steps must be done to comply with this AD; any steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated

from, done as part of other actions, or done using accepted methods different from those identified in the specified service information without obtaining approval of an AMOC, provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC require approval of an AMOC.

(j) Related Information

(1) For more information about this AD, contact Allen Rauschendorfer, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6487; fax: 425-917-6590; email: Allen.Rauschendorfer@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 26, 2014.

Jeffrey E. Duven,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-16004 Filed 7-8-14; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2014-0429; Directorate Identifier 2014-NM-039-AD]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 747-400 and 747-400F series airplanes. This proposed AD was prompted by reports of cracking in the main equipment center (MEC) drip shield and exhaust plenum. This proposed AD would require installing a fiberglass reinforcing overcoat on the MEC drip shield. We are proposing this AD to prevent water penetration into the MEC, which could result in an electrical short and potential loss of several functions essential for safe flight.

DATES: We must receive comments on this proposed AD by August 25, 2014.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0429; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Francis Smith, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-917-6596; fax: 425-917-6590; email: Francis.Smith@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-