

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA–2015–0823; Directorate Identifier 2014–NM–211–AD.

##### (a) Comments Due Date

We must receive comments by May 28, 2015.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to Bombardier, Inc. Model CL–600–2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category, serial numbers 7003 and subsequent.

##### (d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

##### (e) Reason

This AD was prompted by results of a design review indicating that the burst pressure of the flexible hose, used to vent oxygen from the high-pressure relief valve of the oxygen cylinder overboard, was lower than the opening pressure of the high-pressure relief valve, which could cause the flexible hose to burst before it can vent the excess oxygen overboard. We are issuing this AD to prevent the accumulation of oxygen in an enclosed space, which could result in an uncontrolled oxygen-fed fire if an ignition source is nearby.

##### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

##### (g) Replacement

Before the accumulation of 5,800 total flight hours or within 44 months after the effective date of this AD, whichever occurs first, replace all oxygen hose assemblies

having part number (P/N) 38026–4–0280–000 with new, improved assemblies having P/N 601R44045–1, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 601R–35–018, dated May 21, 2013.

##### (h) Parts Installation Prohibition

As of the effective date of this AD, no person may install an oxygen hose assembly, P/N 38026–4–0280–000, on any airplane.

##### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE–170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

##### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2014–36, dated October 17, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0823.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email [thd.crij@aero.bombardier.com](mailto:thd.crij@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on March 27, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015–08073 Filed 4–10–15; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2015–0684; Directorate Identifier 2014–NM–215–AD]

RIN 2120–AA64

#### Airworthiness Directives; Viking Air Limited (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Viking Air Limited (Type Certificate Previously Held by Bombardier, Inc.) Model DHC–7–1 and DHC–7–100 airplanes. This proposed AD was prompted by reports of cracks that were discovered in the outboard nacelles upper longeron channels and angles. This proposed AD would require a one-time detailed visual inspection for cracking in the outboard nacelles upper longeron channels and angles; and repair if necessary. We are proposing this AD to detect and correct cracks in the outboard nacelles upper longeron channels and angles, which could lead to the loss of stiffness in the forward engine mount; and possible catastrophic failure.

**DATES:** We must receive comments on this proposed AD by May 28, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Viking Air Limited, 9574 Hampden Road, Sidney, British Columbia V8L 8V5, Canada; telephone 250–656–7227; fax 250–656–0673; email [technical.publications@vikingair.com](mailto:technical.publications@vikingair.com); Internet <http://www.vikingair.com>. You may view this

referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0684; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Aziz Ahmed, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228 7329; fax 516-794 5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2015-0684; Directorate Identifier 2014-NM-215-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

##### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2014-34, dated October 2, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Viking Air Limited (Type Certificate Previously Held by

Bombardier, Inc.) Model DHC-7-1 and DHC-7-100 airplanes. The MCAI states:

Longitudinal cracks were discovered in the outboard nacelles upper longeron channels and angles at station XN1 78. The cracks were partially hidden by bearing blocks, Part Number (P/N) 75420978, at the nacelle latch locations. Undetected, these cracks may lead to the loss of stiffness in the forward engine mount; which may lead to a catastrophic failure.

Required actions include a one-time detailed visual inspection for cracking of the outboard nacelles upper longeron channels and angles. Corrective actions include repair, if necessary. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0684.

#### Related Service Information Under 1 CFR Part 51

Viking Air Limited has issued Service Bulletin V7-54-02, Revision NC, dated December 14, 2012. The service information describes procedures for an inspection for cracks in the outboard nacelles upper longeron channels and angles; and repair if necessary. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI. This service information is reasonably available; see **ADDRESSES** for ways to access this service information.

#### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

#### Costs of Compliance

We estimate that this proposed AD affects 10 airplanes of U.S. registry.

We also estimate that it would take about 3 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$2,550, or \$255 per product.

We have received no definitive data that would enable us to provide cost

estimates for the on-condition actions specified in this proposed AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

#### Viking Air Limited (Type Certificate

Previously Held by Bombardier, Inc.):

Docket No. FAA-2015-0684; Directorate Identifier 2014-NM-215-AD.

#### (a) Comments Due Date

We must receive comments by May 28, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all Viking Air Limited (Type Certificate previously held by Bombardier, Inc.) Model DHC-7-1 and DHC-7-100 airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 54, Nacelles/Pylons.

#### (e) Reason

This AD was prompted by reports of cracks that were discovered in the outboard nacelles upper longeron channels and angles. We are issuing this AD to detect and correct cracks in the outboard nacelles upper longeron channels and angles, which could lead to the loss of stiffness in the forward engine mount; and possible catastrophic failure.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Inspection and Repair

Within 6 months after the effective date of this AD, do a one-time detailed visual inspection for cracking in the outboard nacelles upper longeron channels and angles, in accordance with the Accomplishment Instructions of Viking Air Limited Service Bulletin V7-54-02, Revision NC, dated December 14, 2012. If any cracking is found during the inspection required by this paragraph: Before further flight, repair using a method approved by the Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Viking Air Limited's (Type Certificate Previously Held by Bombardier, Inc.) TCCA Design Approval Organization (DAO).

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational

Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or TCCA; or Viking Air Limited's (Type Certificate Previously Held by Bombardier, Inc.) TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

#### (i) Special Flight Permits

Special flight permits, as described in Section 21.197 and Section 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199), are not allowed.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-34, dated October 2, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0684.

(2) For service information identified in this AD, contact Viking Air Limited, 9574 Hampden Road, Sidney, British Columbia V8L 8V5, Canada; telephone 250-656-7227; fax 250-656-0673; email [technical.publications@vikingair.com](mailto:technical.publications@vikingair.com); Internet <http://www.vikingair.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on March 27, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-08074 Filed 4-10-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-0822; Directorate Identifier 2014-NM-210-AD]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, Model CL-600-2D15 (Regional Jet Series 705) airplanes, Model CL-600-2D24 (Regional Jet Series 900) airplanes, and Model CL-600-2E25 (Regional Jet Series 1000) airplanes. This proposed AD was prompted by results of a design review indicating that the burst pressure of the flexible hose, used to vent oxygen from the high-pressure relief valve of the oxygen cylinder overboard, was lower than the opening pressure of the high-pressure relief valve, which could cause the flexible hose to burst before it can vent the excess oxygen overboard. This proposed AD would require replacing the oxygen hose assembly with a new, improved assembly. We are proposing this AD to prevent the accumulation of oxygen in an enclosed space, which could result in an uncontrolled oxygen-fed fire if an ignition source is nearby.

**DATES:** We must receive comments on this proposed AD by May 28, 2015.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0822; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday,