

Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1138; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Reporting Requirements:* A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0222, dated October 6, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1981.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 3, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-14229 Filed 6-12-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-1429; Directorate Identifier 2014-NM-246-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A319-113, A319-114, A320-211, and A320-212 airplanes. This proposed AD was prompted by a report that the aft mount pylon bolts of the CFM56-5 engines may have been installed using the wrong torque values. This proposed AD would require identification of engines that were installed using the wrong torque values and re-torque of the four aft mount pylon bolts of those engines. We are proposing this AD to detect and correct improper torque of the aft mount pylon bolts, which, if combined with any maintenance damage, could lead to aft engine mount failure, possibly resulting in engine detachment and consequent reduced control of the airplane.

**DATES:** We must receive comments on this proposed AD by July 30, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus, Airworthiness Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1429; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-1405; fax: 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-1429; Directorate Identifier 2014-NM-246-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness

Directive 2014–0258, dated November 28, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus Model A319–113, A319–114, A320–211, and A320–212 airplanes. The MCAI states:

In the Aircraft Maintenance Manual (AMM) revision dated May 2013, a wrong torque value was added in AMM task 71–00–00–400–040–A01 “Installation of the power plant with Engine Positioner TWW75E”. Temporary Revisions (TR) dated March 2014 were published by Airbus to correct the information and with AMM revision dated May 2014, Task 71–00–00–400–040–A01 was corrected to include the correct values. Notwithstanding those actions, static and fatigue analyses have concluded that this under-torque scenario negatively impacts the assembly performance, reducing the aft mount capability.

This condition, if not corrected and if combined with any maintenance damage, could lead to aft engine mount failure, possibly resulting in engine detachment and consequent reduced control of the aeroplane.

For the reasons described above, this [EASA] AD requires identification of CFM56–5 engines (those listed in TCDS EASA.E.067 [<http://easa.europa.eu/document-library/type-certificates/easae067>]) that were installed by using the wrong torque data of AMM instructions mentioned above and re-torque of the four aft mount pylon bolts of those engines.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–1429.

#### Related Service Information Under 14 CFR Part 51

Airbus has issued Service Bulletin A320–71–1063, including Appendix 01, dated August 13, 2014. The service information describes procedures to detect and correct improper torque of the aft mount pylon bolts. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this NPRM.

#### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this

AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

We estimate that this proposed AD affects 126 airplanes of U.S. registry.

We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$21,420, or \$170 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2015–1429; Directorate Identifier 2014–NM–246–AD.

#### (a) Comments Due Date

We must receive comments by July 30, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the airplanes, certificated in any category, identified in paragraphs (c)(1) and (c)(2) of this AD, all manufacturer serial numbers.

(1) Airbus Model A319–113 and –114 airplanes.

(2) Airbus Model A320–211 and –212 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 71, Powerplant.

#### (e) Reason

This AD was prompted by a report that the aft mount pylon bolts of the CFM56–5 engines may have been installed using the wrong torque values. We are issuing this AD to detect and correct improper torque of the aft mount pylon bolts, which, if combined with any maintenance damage, could lead to aft engine mount failure, possibly resulting in engine detachment and consequent reduced control of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Inspection for Incorrect Torque Values

Within 6 months or 1,500 flight cycles, whichever occurs first after the effective date of this AD, determine the method used to install the engines, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320–71–1063, including Appendix 01, dated August 13, 2014. A review of airplane maintenance records is acceptable in lieu of this inspection if the method used to install the engines can be

conclusively determined from that review. For any engine replaced as specified in the Airbus A318/A319/A320/A321 Aircraft Maintenance Manual (AMM), Task 71-00-00-400-040-A01, "Installation of the Power Plant with Engine Positioner TWW 75E," dated May 2013; Within 6 months or 1,500 flight cycles, whichever occurs first after the effective date of this AD, re-torque the 4 aft mount pylon bolts using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus' EASA Design Organization Approval (DOA).

Note 1 to paragraph (g) of this AD: Additional guidance for the re-torque can be found in Airbus A318/A319/A320/A321 AMM Temporary Revision 71-030, dated March 14, 2014, or Airbus A318/A319/A320/A321 AMM Task 71-00-00-400-040-A01, "Installation of the Power Plant with Engine Positioner TWW 75E," dated May 2014.

#### (h) Parts Installation Limitation

As of the effective date of this AD, no person may install a CFM56-5 engine, on any airplane, unless the engine is installed in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-71-1063, including Appendix 01, dated August 13, 2014.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-1405; fax: 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0258, dated November 28, 2014, for related information. This MCAI may be found in the AD docket

on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1429.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 3, 2015.

**Michael Kaszycki**,

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-14228 Filed 6-12-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-1428; Directorate Identifier 2015-NM-026-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 777-200 and -300 series airplanes. This proposed AD was prompted by reports of fatigue cracking of a certain chord of the pivot bulkhead. This proposed AD would require repetitive inspections for cracking of the left side and right side forward outer chords of the pivot bulkhead, and related investigative and corrective actions if necessary. This proposed AD provides a modification of the pivot bulkhead, which would terminate the repetitive inspections. We are proposing this AD to detect and correct fatigue cracking of the outer flanges of the left and right side forward outer chords of the pivot bulkhead, which could result in a severed forward outer chord and consequent loss of horizontal stabilizer control.

**DATES:** We must receive comments on this proposed AD by July 30, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; phone: 206-544-5000, extension 1; fax: 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1428.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1428; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Narinder Luthra, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6513; fax: 425-917-6590; email: [narinder.luthra@faa.gov](mailto:narinder.luthra@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-1428; Directorate Identifier 2015-NM-026-AD" at the beginning of your comments. We specifically invite