

Bombardier Service Bulletin 84-32-118, dated April 8, 2014.

**Note 1 to paragraph (g) of this AD:** Reinstalling the hand pump lever of the parking brake to the right-hand side equipment bay (Bombardier ModSum 4-113804) may be done at the operator's discretion.

#### (h) Optional Installation

Incorporation of ModSum 4-113723 by relocating the hand pump lever of the parking brake from the right-hand side nacelle to the right-hand side equipment bay, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-32-99, Revision A, dated October 2, 2012, is acceptable for compliance with the modification specified in paragraph (g) of this AD, provided the incorporation of ModSum 4-113723 is done within the compliance time specified in paragraph (g) of this AD.

#### (i) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (h) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 84-32-99, dated January 26, 2012, which is not incorporated by reference in this AD.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (k) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-18, dated June 19, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2015-0680-0002>.

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 84-32-99, Revision A, dated October 2, 2012.

(ii) Bombardier Service Bulletin 84-32-118, dated April 8, 2014.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 10, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-20583 Filed 9-1-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2014-0777; Directorate Identifier 2014-NM-088-AD; Amendment 39-18257; AD 2015-17-24]**

**RIN 2120-AA64**

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain The Boeing Company Model 787-8 airplanes. This AD was prompted by numerous reports of failures of the proximity sensor within the slat skew detection mechanism assembly (DMA) leading to slats up landing events. This AD requires replacing the slat skew DMAs with new slat skew DMAs, and marking the existing identification plates on the slat with the new part

number. We are issuing this AD to prevent failure of the proximity sensor, which could result in the slats being shut down and a slats up high speed landing. This condition, in combination with abnormal landing conditions such as a short runway or adverse weather conditions, could result in a runway excursion.

**DATES:** This AD is effective October 7, 2015.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 7, 2015.

**ADDRESSES:** For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0777.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0777; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

Douglas Tsuji, Senior Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-917-6546; fax: 425-917-6590; email: [douglas.tsuji@faa.gov](mailto:douglas.tsuji@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company

Model 787–8 airplanes. The NPRM published in the **Federal Register** on November 28, 2014 (79 FR 70802). The NPRM was prompted by numerous reports of failures of the proximity sensor within the slat skew DMA leading to slats up landing events. The NPRM proposed to require replacing the slat skew DMAs with new slat skew DMAs, and marking the existing identification plates on the slat with the new part number. We are issuing this AD to prevent failure of the proximity sensor, which could result in the slats being shut down and a slats up high speed landing. This condition, in combination with abnormal landing conditions such as a short runway or adverse weather conditions, could result in a runway excursion.

**Comments**

We gave the public the opportunity to participate in developing this AD. The following presents the comments received on the NPRM (79 FR 70802, November 28, 2014) and the FAA’s response to each comment.

**Support for the NPRM (79 FR 70802, November 28, 2014)**

United Airlines (UAL) stated that it supports the NPRM (79 FR 70802, November 28, 2014).

**Requests To Correct the Location of the Part Numbers Affected**

Boeing and UAL requested a correction of the location of the identified part numbers affected in paragraphs (h)(2) and (h)(3) of the proposed AD (79 FR 70802, November 28, 2014). UAL stated that the part numbers affected in paragraphs (h)(2) and (h)(3) of the proposed AD are the wing leading edge slat assemblies, not the DMA. Boeing also commented that the part numbers are for a complete slat assembly (structure with DMA installed) and not just the DMA.

We agree with the request. The intent of this AD is to prohibit installation of a defective slat skew DMA. Boeing Alert Service Bulletin B787–81205–SB270021–00, Issue 001, dated March 20, 2014, provides instructions to modify the existing slat assembly by replacing the defective slat skew DMA and then marking the existing slat assembly identification plate with a new part number. Therefore, we have revised paragraphs (h)(2) and (h)(3) of this AD to remove the text “slat skew DMA in” and just refer to the existing part numbers of the slat assembly, which contain the defective slat skew DMA.

**Conclusion**

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this AD with the changes described previously

and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (79 FR 70802, November 28, 2014) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (79 FR 70802, November 28, 2014).

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this AD.

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Alert Service Bulletin B787–81205–SB270021–00, Issue 001, dated March 20, 2014. The service information describes procedures for replacing the slat skew DMAs with new slat skew DMAs, and marking the existing identification plates on the slat with the new part number. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this AD.

**Costs of Compliance**

We estimate that this AD affects 15 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement .....	11 work-hours X \$85 per hour = \$935 .....	\$0	\$935	\$14,025

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition

that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2015-17-24 The Boeing Company:**

Amendment 39-18257 ; Docket No. FAA-2014-0777; Directorate Identifier 2014-NM-088-AD.

**(a) Effective Date**

This AD is effective October 7, 2015.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 787-8 airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin B787-81205-SB270021-00, Issue 001, dated March 20, 2014.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight Controls.

**(e) Unsafe Condition**

This AD was prompted by numerous reports of failures of the proximity sensor within the slat skew detection mechanism assembly (DMA) leading to slats up landing events. We are issuing this AD to prevent failure of the proximity sensor, which could result in the slats being shut down and a slats up high speed landing. This condition, in combination with abnormal landing conditions such as a short runway or adverse weather conditions, could result in a runway excursion.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Replacement**

Within 24 months after the effective date of this AD: Replace the slat skew DMAs in slat number 5 and slat number 8 with new slat skew DMAs, and mark the existing identification plates on the slat with the new part number, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin B787-81205-SB270021-00, Issue 001, dated March 20, 2014.

**(h) Parts Installation Prohibitions**

(1) As of the effective date of this AD, no person may install a slat skew DMA, part number P683A0001-03, on any airplane.

(2) As of the effective date of this AD, no person may install on any airplane, a slat assembly number 5, having part number 145Z0201-11-8, 145Z0201-21-4, 145Z0201-21-3, 145Z0201-21-5, 145Z0201-21-8, 145Z0201-21-9, 145Z0201-31-1, or 145Z0201-33-1.

(3) As of the effective date of this AD, no person may install on any airplane, a slat

assembly number 8, having part number 145Z0201-12-8, 145Z0201-22-4, 145Z0201-22-3, 145Z0201-22-5, 145Z0201-22-8, 145Z0201-22-9, 145Z0201-32-1, or 145Z0201-34-1.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(j) Related Information**

For more information about this AD, contact Douglas Tsuji, Senior Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-917-6546; fax: 425-917-6590; email: [douglas.tsuji@faa.gov](mailto:douglas.tsuji@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin B787-81205-SB270021-00, Issue 001, dated March 20, 2014.

(ii) Reserved.

(3) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(4) You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 21, 2015.

**Kevin Hull,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-21474 Filed 9-1-15; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2014-0779; Directorate Identifier 2014-NM-052-AD; Amendment 39-18260; AD 2015-18-02]**

**RIN 2120-AA64**

**Airworthiness Directives; Lockheed Martin Corporation/Lockheed Martin Aeronautics Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Lockheed Martin Corporation/Lockheed Martin Aeronautics Company Model 382, 382B, 382E, 382F, and 382G airplanes. This AD requires replacing the center wing box (CWB) and certain outer wings. This AD was prompted by an evaluation by the design approval holder (DAH) indicating that the CWB and outer wings are subject to widespread fatigue damage (WFD). We are issuing this AD to prevent fatigue cracking of the outer wings and the lower surface of the CWB, which could result in reduced structural integrity of the airplane.

**DATES:** This AD is effective September 17, 2015.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of September 17, 2015.

We must receive comments on this AD by October 19, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-