

(3) The second inspection interval is defined as the total flight hours accumulated divided by the total number of flight cycles accumulated between the initial and second threshold.

#### (n) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g)(1) of this AD, if those actions were performed before the effective date of this AD using Airbus Service Bulletin A310-57-2096, dated May 6, 2008; or Airbus Service Bulletin A310-57-2096, Revision 01, dated August 5, 2010.

#### (o) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-2125; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (p) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0200R1, dated September 19, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov>

by searching for and locating Docket No. FAA-2015-3985.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on September 28, 2015.

**Michael Kaszycki**,

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-25758 Filed 10-9-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-3661; Directorate Identifier 2015-NE-24-AD]

RIN 2120-AA64

#### Airworthiness Directives; Dowty Propellers Constant Speed Propellers

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Dowty Propellers R352/6-123-F/1, R352/6-123-F/2, and R410/6-123-F/35 model propellers. This proposed AD was prompted by reports of dowel hole cracks in the face of the rear hub half. This proposed AD would require a records review to determine repair status and marking the affected propeller hubs as required. This proposed AD would also require installing dowel hole liners as necessary. We are proposing this AD to prevent loss of structural integrity of the propeller hub, which could result in damage to the propeller and damage to the airplane.

**DATES:** We must receive comments on this proposed AD by December 14, 2015.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Mail:* Docket Management Facility, U.S. Department of Transportation, 1200 New Jersey Avenue SE., West Building

Ground Floor, Room W12-140, Washington, DC 20590-0001.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

• *Fax:* 202-493-2251.

For service information identified in this proposed AD, contact Dowty Propellers, 114 Powers Court, Sterling, VA 20166; phone: 703-421-4434; fax: 703-450-0087; email: [technicalsupport@dowty.com](mailto:technicalsupport@dowty.com); Internet: [www.dowty.com/services/repair-and-overhaul](http://www.dowty.com/services/repair-and-overhaul). You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3661; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the mandatory continuing airworthiness information (MCAI), the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Michael Schwetz, Aerospace Engineer, Boston Aircraft Certification Office, FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7761; fax 781-238-7170; email: [michael.schwetz@faa.gov](mailto:michael.schwetz@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this NPRM. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-3661; Directorate Identifier 2015-NE-24-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We

will also post a report summarizing each substantive verbal contact with FAA personnel concerning this NPRM.

### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA AD 2015-0158, dated July 30, 2015 (referred to hereinafter as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

Cracking around the hub location dowel holes in the face of the rear hub half has occurred sporadically. Previous investigations found no manufacturing defects in cracked hubs and concluded that the hub cracking was caused by damage to the dowel holes during propeller installation.

Since that original SB was issued, three hubs have been found to show cracking around the location dowel holes. The hubs were all found cracked within a short period of time and all had low time since new.

This condition, if not detected, can adversely affect the structural integrity of the propeller hub, with possible damage to the propeller and to the aeroplane.

You may obtain further information by examining the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3661.

### Related Service Information Under 14 CFR Part 51

Dowty Propellers has issued Alert Service Bulletin (ASB) No. F50-61-A165, Revision 2, dated July 28, 2015. The service information describes procedures for installing liners in the hub location dowel holes in the face of the rear hub half and marking the hub with the repair number. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this NPRM.

### Other Related Service Information

Dowty Propellers has issued Component Maintenance Manual, 61-10-34, Repair No. 53, dated May 15, 2013. The service information describes procedures for installing liners in the hub location dowel holes and marking the repair number on modified hubs.

### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of the United Kingdom, and is approved for operation in the United States. Pursuant to our bilateral agreement with the European Community, EASA has notified us of the unsafe condition described in the

MCAI and service information referenced above. We are proposing this NPRM because we evaluated all information provided by EASA and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design. This NPRM would require marking and inspecting the affected propeller hubs to determine repair status and installing dowel hole liners as necessary.

### Costs of Compliance

We estimate that this proposed AD would affect 4 propellers installed on airplanes of U.S. registry. We also estimate that it would take about 5 hours per propeller to comply with this proposed AD. The average labor rate is \$85 per hour. Required parts cost about \$322 per propeller. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$2,988.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Dowty Propellers:** Docket No. FAA-2015-3661; Directorate Identifier 2015-NE-24-AD.

#### (a) Comments Due Date

We must receive comments by December 14, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Dowty Propellers R352/6-123-F/1, R352/6-123-F/2, and R410/6-123-F/35 model propellers, part numbers (P/Ns) 660715001, 660715004, and 660715005 with hub P/Ns 660715201, 660715255, 660720217, 660720241, 660720252, 660720260, and 660720288, installed.

#### (d) Reason

This AD was prompted by reports of dowel hole cracks in the face of the rear hub half. We are issuing this AD to prevent loss of structural integrity of the propeller hub, which could result in damage to the propeller and damage to the airplane.

#### (e) Actions and Compliance

Comply with this AD within the compliance times specified, unless already done.

(1) At the next removal of the propeller from the airplane, or within 7,500 flight hours (FHs), whichever occurs first, after the effective date of this AD do the following:

(i) Review propeller maintenance records to determine if the affected propeller hub has been repaired in accordance with Dowty Propellers Alert Service Bulletin (ASB) No. F50-61-A165 Revision 2, dated July 28, 2015.

(ii) If, during the maintenance records review required by paragraph (e)(1)(i) of this AD, an affected hub is found not repaired then, before next flight, install liners into the hub location dowel holes and mark the hub. Use Dowty Propellers ASB No. F50-61-A165 Revision 2, dated July 28, 2015 to install the liners and mark the hub.

(iii) If, during the maintenance records review required by paragraph (e)(1)(i) of this AD, an affected hub is found repaired then, before next flight, mark the hub using Dowty Propellers ASB No. F50-61-A165 Revision 2, dated July 28, 2015.

#### (f) Credit for Previous Actions

(1) You may take credit for maintenance records reviews and installations that are required by paragraph (e) of this AD if you performed these actions before the effective date of this AD using Dowty Propellers ASB No. F50-61-A165 Revision 1, dated May 12, 2015 or initial issue dated November 19, 2012.

(2) You may take credit for any maintenance records reviews or corrective actions that are required by paragraph (e) of this AD if you performed these actions before the effective date of this AD using Component Maintenance Manual (CMM) 61-10-34, Repair No. 53, dated August 11, 2008, which relates to repair scheme 650510057.

#### (g) Alternative Methods of Compliance (AMOCs)

The Manager, Boston Aircraft Certification Office, FAA, may approve AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request.

#### (h) Related Information

(1) For more information about this AD, contact Michael Schwetz, Aerospace Engineer, Boston Aircraft Certification Office, FAA, 12 New England Executive Park, Burlington, MA 01803; phone: 781-238-7761; fax: 781-238-7170; email: [michael.schwetz@faa.gov](mailto:michael.schwetz@faa.gov).

(2) Refer to MCAI European Aviation Safety Agency AD 2015-0158, dated July 30, 2015, for more information. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2015-3661.

(3) Dowty Propellers ASB No. F50-61-A165 Revision 2, dated July 28, 2015 and CMM 61-10-34, Repair No. 53, dated August 11, 2008 can be obtained from Dowty Propellers, using the contact information in paragraph (h)(4) of this proposed AD.

(4) For service information identified in this proposed AD, contact Dowty Propellers, 114 Powers Court, Sterling, VA 20166; phone: 703-421-4434; fax: 703-450-0087; email: [technicalsupport@dowty.com](mailto:technicalsupport@dowty.com); Internet: [www.http://dowty.com/services/repair-and-overhaul](http://dowty.com/services/repair-and-overhaul).

(5) You may view this service information at the FAA, Engine & Propeller Directorate, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on October 1, 2015.

**Colleen M. D'Alessandro,**

*Directorate Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2015-25643 Filed 10-9-15; 8:45 am]

**BILLING CODE 4910-13-P**

## SECURITIES AND EXCHANGE COMMISSION

### 17 CFR Part 210

[Release No. 33-9929A; 34-75985A; IC-31849A; File No. S7-20-15]

**RIN 3235-AL77**

### Request for Comment on the Effectiveness of Financial Disclosures About Entities Other Than the Registrant

**AGENCY:** Securities and Exchange Commission.

**ACTION:** Request for comment; correction.

**SUMMARY:** The Securities and Exchange Commission published a document in the *Federal Register* of October 1, 2015, seeking public comment regarding the financial disclosure requirements in Regulation S-X for certain entities other than a registrant. The RIN was omitted from this document. This correction is being published to add the RIN to that document.

**FOR FURTHER INFORMATION CONTACT:** Todd E. Hardiman, Associate Chief Accountant, at (202) 551-3516, Division of Corporation Finance; Duc Dang, Special Counsel, at (202) 551-3386, Office of the Chief Accountant; or Matthew Giordano, Chief Accountant, at (202) 551-6892, Division of Investment Management, Securities and Exchange Commission, 100 F Street NE., Washington, DC 20549.

#### Correction

In the *Federal Register* of October 1, 2015, in FR Doc. 2015-24875, on page 59083, in the second column, in the heading of the document, the RIN is added to read as 3235-AL77.

Dated: October 7, 2015.

**Brent J. Fields,**

*Secretary.*

[FR Doc. 2015-25948 Filed 10-9-15; 8:45 am]

**BILLING CODE 8011-01-P**

## DEPARTMENT OF THE TREASURY

### Internal Revenue Service

#### 26 CFR Part 1

[REG-115452-14]

**RIN 1545-BM12**

### Disguised Payments for Services; Extension of Comment Period

**AGENCY:** Internal Revenue Service (IRS), Treasury.

**ACTION:** Notice of proposed rulemaking; extension of comment period.

**SUMMARY:** This document extends the comment period for a notice of proposed rulemaking (REG-115452-14) that was published in the *Federal Register* on Thursday, July 23, 2015. The proposed regulations relate to disguised payments for services under section 707(a)(2)(A) of the Internal Revenue Code.

**DATES:** Written or electronic comments and requests for a public hearing for the notice of proposed rulemaking published on July 23, 2015 (80 FR 43652), is extended to November 16, 2015.

**ADDRESSES:** Send submissions to CC:PA:LPD:PR (REG-115452-14), Room 5203, Internal Revenue Service, P.O. Box 7604, Ben Franklin Station, Washington, DC 20044. Submissions may be hand-delivered Monday through Friday between the hours of 8 a.m. and 4 p.m. to CC:PA:LPD:PR (REG-115452-14), Courier's Desk, Internal Revenue Service, 1111 Constitution Avenue NW., Washington, DC, or sent electronically, via the Federal eRulemaking Portal at <http://www.regulations.gov> (indicate IRS and REG-115452-14).

**FOR FURTHER INFORMATION CONTACT:** Jacklyn M. Goldberg at (202) 317-6850 (not a toll free number).

**SUPPLEMENTARY INFORMATION:** A notice of proposed rulemaking that appeared in the *Federal Register* on Thursday, July 23, 2015 (80 FR 43652) announced that written and electronic comments and requests for a public hearing must be received by October 21, 2015. Due to an intense public interest, the comment due date to receive electronic comments and requests for a public hearing has been extended to Monday, November 16, 2015.

**Martin V. Franks,**

*Chief, Publications and Regulations Branch, Legal Processing Division, Associate Chief Counsel, (Procedure and Administration).*

[FR Doc. 2015-25940 Filed 10-7-15; 4:15 pm]

**BILLING CODE 4830-01-P**