

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Dassault Aviation: Docket No. FAA-2016-7420; Directorate Identifier 2015-NM-017-AD.

(a) Comments Due Date

We must receive comments by August 15, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to the Dassault Aviation airplanes, certificated in any category, identified in paragraphs (c)(1) through (c)(5) of this AD, all airplanes.

- (1) Model FAN JET FALCON airplanes.
- (2) Model FAN JET FALCON SERIES C, D, E, F, and G airplanes.
- (3) Model MYSTERE-FALCON 200 airplanes.
- (4) Model MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes.
- (5) Model MYSTERE-FALCON 50 airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 52, Doors.

(e) Reason

This AD was prompted by a report that, during approach for landing, the main entry door detached from an airplane. We are issuing this AD to detect and correct defective crew/passenger doors. Such a condition could result in the in-flight opening or detachment of the crew/passenger door, which could result in loss of control of the airplane and injury to persons on the ground.

(f) Compliance

Comply with this AD within the compliance times specified.

(g) Main Entry/Passenger/Crew Door Check or Functional Test

Within 65 days after the effective date of this AD, unless done within 6 months before the effective date of this AD, do the applicable functional test or door lock check

specified in paragraph (g)(1), (g)(2), or (g)(3) of this AD, and do all applicable corrective actions, using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). Do all applicable corrective actions before further flight.

(1) For Model FAN JET FALCON airplanes; Model FAN JET FALCON SERIES C, D, E, F, and G airplanes; and Model MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes: A functional test of the passenger/crew door warning system.

(2) For Model MYSTERE-FALCON 200 airplanes: A check of the door locking indicator system.

(3) For Model MYSTERE-FALCON 50 airplanes: A check of the door lock indication.

(h) Main Entry/Passenger/Crew Door Closing Inspections, Adjustments, and Operational Tests and Corrective Actions

Within 330 flight hours or 13 months, whichever occurs first after the effective date of this AD, unless already done: Do the applicable door closing inspections, adjustments, and operational tests, and do all applicable corrective actions, in accordance with the Accomplishment Instructions of the applicable service information identified in paragraph (h)(1), (h)(2), or (h)(3) of this AD. Do all applicable corrective actions before further flight.

(1) For Model FAN JET FALCON airplanes; Model FAN JET FALCON SERIES C, D, E, F, and G airplanes; and Model MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes: Dassault Service Bulletin F20-789, also referred to as 789, dated December 9, 2014.

(2) For Model MYSTERE-FALCON 200 airplanes: Dassault Service Bulletin F200-133, also referred to as 133, dated December 9, 2014.

(3) For Model MYSTERE-FALCON 50 airplanes: Dassault Service Bulletin F50-531, also referred to as 531, dated December 9, 2014.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax: 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal

inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the EASA; or Dassault Aviation's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015-0007, dated January 15, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7420.

(2) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 21 2016.

Dorr Anderson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-15290 Filed 6-30-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2016-7421; Directorate Identifier 2015-NM-145-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702), CL-600-2D15 (Regional Jet Series 705), CL-600-2D24 (Regional Jet Series 900) airplanes, and CL-600-2E25 (Regional Jet Series 1000) airplanes. This proposed AD was prompted by a determination that wear and possible leakage of the high-pressure seal in the cylinder of the No. 3 hydraulic system

reservoir could occur and prevent the system from reaching normal operating pressure. This proposed AD would require repetitive operational checks for wear and leakage of the high-pressure seal in the cylinder of the reservoir of the No. 3 hydraulic system, and corrective actions if necessary. We are proposing this AD to detect and correct a malfunctioning temperature indication of the No. 3 hydraulic system. High hydraulic fluid temperature combined with a temperature transducer malfunction could result in unannounced overheating of the hydraulic system and consequent ignition sources inside the fuel tank, which, combined with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

DATES: We must receive comments on this proposed AD by August 15, 2016.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:*
 - Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.
- For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7421; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone (516) 228-7318; fax (516) 794-5531.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2016-7421; Directorate Identifier 2015-NM-145-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2015-27, dated September 14, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Bombardier, Inc. Model CL-600-2C10 (Regional Jet Series 700, 701, & 702), CL-600-2D15 (Regional Jet Series 705); CL-600-2D24 (Regional Jet Series 900) airplanes; and CL-600-2E25 (Regional Jet Series 1000) airplanes. The MCAI states:

It was discovered that the high-pressure seal in the cylinder of the No. 3 hydraulic system reservoir with P/N 960450-1 could wear and leak. This can cause high hydraulic fluid temperature and/or prevent the system from reaching normal operating pressure. High hydraulic fluid temperature, in combination with a temperature transducer malfunction, could result in an unannounced overheat of the hydraulic system that could result in a potential ignition source within the fuel system.

This [Canadian] AD mandates the repetitive operational check of the hydraulic system No. 3 fluid temperature indication as an interim mitigating action.

Required actions include repeating any operational check that fails until the operational check passes. You may examine the MCAI in the AD docket on

the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7421.

Related Service Information Under 1 CFR Part 51

We reviewed Bombardier Service Bulletin 670BA-29-018, Revision A, dated October 13, 2015. The service information describes procedures for performing an operational check for wear and leakage of the high-pressure seal in the cylinder of the reservoir of the No. 3 hydraulic system. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Costs of Compliance

We estimate that this proposed AD affects 509 airplanes of U.S. registry. We also estimate that it would take about 1 work-hour per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$43,265, or \$85 per airplane.

We have received no definitive data that would enable us to provide a cost estimate for the on-condition actions specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in

air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Bombardier, Inc.: Docket No. FAA–2016–7421; Directorate Identifier 2015–NM–145–AD.

(a) Comments Due Date

We must receive comments by August 15, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to the Bombardier, Inc. airplanes identified in paragraph (c)(1), (c)(2), or (c)(3) of this AD, certificated in any category, equipped with No. 3 hydraulic system reservoir having part number 960450–1.

(1) Model CL–600–2C10 (Regional Jet Series 700, 701, & 702), CL–600–2D15 (Regional Jet Series 705), having serial numbers 10002 through 10999 inclusive.

(2) Model CL–600–2D24 (Regional Jet Series 900) airplanes, having serial numbers 15001 through 15990 inclusive.

(3) Model CL–600–2E25 (Regional Jet Series 1000) airplanes, having serial numbers 19001 through 19990 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 29, Hydraulic power.

(e) Reason

This AD was prompted by a determination that wear and possible leakage of the high-pressure seal in the cylinder of the No. 3 hydraulic system reservoir could occur. We are issuing this AD to detect and correct a malfunctioning temperature indication of the No. 3 hydraulic system. High hydraulic fluid temperature combined with a temperature transducer malfunction could result in unannounced overheating of the hydraulic system and consequent ignition sources inside the fuel tank, which, combined with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Operational Check and Repair, if Necessary

Within 660 flight hours or 4 months after the effective date of this AD, whichever occurs first: Perform an operational check for wear and leakage of the high-pressure seal in the cylinder of the reservoir of the No. 3 hydraulic system, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 670BA–29–018, Revision A, dated October 13, 2015. If the operational check fails, before further flight, do applicable corrective actions and repeat the operational check and applicable corrective actions until the operational check passes. Repeat the operational check thereafter at intervals not to exceed 660 flight hours or 4 months, whichever occurs first.

(h) Credit for Previous Actions

This paragraph provides credit for the applicable actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 670BA–29–018, dated June 25, 2015, which is not incorporated by reference in this AD.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

- (1) Alternative Methods of Compliance (AMOCs): The Manager, New York Aircraft

Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE–170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2015–27, dated September 14, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7421.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on June 21, 2016.

Dorr Anderson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016–15289 Filed 6–30–16; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA–2016–6985; Airspace Docket No. 16–AGL–16]

Proposed Amendment of Class E Airspace for the Following Illinois Towns; Carmi, IL; De Kalb, IL; Harrisburg, IL; Kewanee, IL; Litchfield, IL; Paris, IL; and Taylorville, IL

AGENCY: Federal Aviation Administration (FAA), DOT.