

(2) For airplanes with an extended wing tip that has been modified using Saab Service Bulletin 340-27-099: Deactivate the stall speed curves in the SWC having P/N 0020AK7.

(h) Replacement of SWCs

Within 3 months after the effective date of this AD: Do the replacement specified in paragraph (h)(1) or (h)(2) of this AD, as applicable.

(1) For airplanes with basic wing tips: Replace all SWCs with new, improved SWCs having P/N 0020AK6-1, in accordance with the Accomplishment Instructions of Saab Service Bulletin 340-27-121, dated July 11, 2014.

(2) For airplanes with extended wing tips: Replace all SWCs with new, improved SWCs having P/N 0020AK7-1, in accordance with the Accomplishment Instructions of Saab Service Bulletin 340-27-122, dated July 11, 2014.

(i) Concurrent Modification

Before or concurrently with the accomplishment of the applicable requirements of paragraph (h) of this AD, do the actions specified in paragraph (i)(1) or (i)(2) of this AD, as applicable to airplane configuration.

(1) For airplanes on which either Saab AB Mod No. 2650 or Mod No. 2859 is not installed: Modify the stall warning and identification system, in accordance with the Accomplishment Instructions of Saab Service Bulletin 340-27-120, dated July 11, 2014.

(2) For airplanes on which either Saab AB Mod No. 2650 or Mod No. 2859 is installed, or on which both mods are installed: Modify the stall warning and identification system, in accordance with the Accomplishment Instructions of Saab Service Bulletin 340-27-109, dated April 14, 2014.

(j) Parts Installation Prohibitions

After the replacement required by paragraph (h) of this AD, no person may install any SWC having P/N 0020AK, 0020AK1, 0020AK2, 0020AK4, 0020AK6, 0020AK7, or 0020AK3 MOD 1, on any airplane.

(k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1112; fax 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight

standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Saab AB, Saab Aeronautics' EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0218, dated September 29, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-6544.

(2) For service information identified in this AD, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email saab340.techsupport@saabgroup.com; Internet <http://www.saabgroup.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 23, 2016.

Dorr M. Anderson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-15927 Filed 7-11-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2016-7426; Directorate Identifier 2015-NM-199-AD]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737-100, -200, and -200C series airplanes. This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. This proposed AD would require repetitive detailed,

high frequency eddy current (HFEC), and ultrasonic inspections of the center section rear spar upper clevis lugs and horizontal stabilizer rear spar upper lugs, as applicable, for any cracking, and related investigative and corrective actions if necessary. For certain airplanes, this proposed AD would require replacement of the center section rear spar upper chord with a new part and a serviceable center section assembly. This proposed AD would also require repetitive HFEC and fluorescent dye penetrant inspections of the center section for cracking of the front and rear spar upper clevis lugs or horizontal stabilizer front and rear spar upper lugs, and related investigative and corrective actions if necessary. We are proposing this AD to detect and correct cracking in the rear spar upper clevis lugs of the center section, and in the rear spar upper lugs of the horizontal stabilizer which could result in the loss of structural integrity and controllability of the airplane.

DATES: We must receive comments on this proposed AD by August 26, 2016.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone: 206-544-5000, extension 1; fax: 206-766-5680; Internet: <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7426.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for

and locating Docket No. FAA–2016–7426; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Payman Soltani, Aerospace Engineer, Airframe Branch, ANM–120L, FAA, Los Angeles Aircraft Certification Office (ACO), 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5313; fax: 562–627–5210; email: Payman.Soltani@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2016–7426; Directorate Identifier 2015–NM–199–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

As described in FAA Advisory Circular 120–104 (http://www.faa.gov/documentLibrary/media/Advisory_Circular/120-104.pdf), several programs have been developed to support initiatives that will ensure the continued airworthiness of aging airplane structure. The last element of those initiatives is the requirement to establish a LOV of the engineering data that support the structural maintenance program under 14 CFR 26.21. This proposed AD is the result of an assessment of the previously established

programs by the DAH during the process of establishing the LOV for the affected airplanes. The actions specified in this proposed AD are necessary to complete certain programs to ensure the continued airworthiness of aging airplane structure and to support an airplane reaching its LOV.

This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its LOV of the engineering data that support the established structural maintenance program. An operator detected a cracked center section at the rear spar upper chord clevis lug. This condition, if not corrected, could result in cracking in the rear spar clevis lugs of the horizontal stabilizer center section, which could result in loss of structural integrity and controllability of the airplane.

Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015. The service information describes procedures for repetitive detailed, HFEC, and ultrasonic inspections of the center section rear spar upper clevis lugs and rear spar upper lugs of the horizontal stabilizer; HFEC and fluorescent dye penetrant inspections for cracking in the front and rear spar upper clevis lugs of the center section and the front and rear spar upper lugs of the horizontal stabilizer. For certain airplanes, the service information describes procedures for replacement of the center section rear spar upper chord with a new part and replacing the center section with a serviceable center section assembly, or installing bushings and sleeves as applicable. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in

the service information described previously, except as discussed under “Differences Between This Proposed AD and the Service Information.” For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7426.

The phrase “related investigative actions” is used in this NPRM. Related investigative actions are follow-on actions that (1) are related to the primary action, and (2) further investigate the nature of any condition found. Related investigative actions in an AD could include, for example, inspections.

The phrase “corrective actions” is also used in this NPRM. Corrective actions are actions that correct or address any condition found. Corrective actions in an AD could include, for example, repairs.

Differences Between This Proposed AD and the Service Information

Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, specifies to contact the manufacturer for certain instructions, but this proposed AD would require accomplishment of repair methods, modification deviations, and alteration deviations in one of the following ways:

- In accordance with a method that we approve; or
- Using data that meet the certification basis of the airplane, and that have been approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) whom we have authorized to make those findings.

Where Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, specifies a compliance time or repeat interval as “Horizontal Stabilizer Center Section flight cycles” or “Horizontal Stabilizer flight cycles,” this AD requires compliance for the corresponding time or repeat interval in airplane flight cycles.

Costs of Compliance

We estimate that this proposed AD affects 84 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Repetitive detailed, HFEC, and ultrasonic inspections.	9 work-hours × \$85 per hour = \$765 per inspection cycle.	\$0	\$765 per inspection cycle.	\$64,260 per inspection cycle.

ESTIMATED COSTS—Continued

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Repetitive HFEC and fluorescent dye penetrant inspections. Replacement	118 work-hours × \$85 per hour = \$10,030 per inspection cycle. Up to 252 work-hours × \$85 per hour = \$21,420 per inspection cycle.	0 25,000	\$10,030 per inspection cycle. Up to \$46,420 per inspection cycle.	\$842,520 per inspection cycle. Up to \$3,899,280 per inspection cycle.

We estimate the following costs to do any necessary inspections, repairs, and replacements that would be required

based on the results of the proposed inspection. We have no way of determining the number of aircraft that

might need these inspections, repairs, and replacements:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Bolt and Bushing Removal/Inspection, Fabrication, and Installation. Repair and replacement	101 work-hours × \$85 per hour = \$8,585 Up to 252 work-hours × \$85 per hour = \$21,420 per inspection cycle.	\$0 25,000	\$8,585. Up to \$46,420 per inspection cycle.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2016–7426; Directorate Identifier 2015–NM–199–AD.

(a) Comments Due Date

We must receive comments by August 26, 2016.

(b) Affected ADs

This AD affects AD 84–23–05, Amendment 39–4949 (49 FR 45744, November 20, 1984); and AD 86–12–05, Amendment 39–5321 (51 FR 18771, May 22, 1986).

(c) Applicability

This AD applies to The Boeing Company Model 737–100, –200, and –200C series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(d) Subject

Air Transport Association (ATA) of America Code 55, Stabilizers.

(e) Unsafe Condition

This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. We are issuing this AD to detect and correct cracking in the rear spar upper clevis lugs of the center section, and in the rear spar upper lugs of the horizontal stabilizer which could result in the loss of structural integrity and controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspections, Related Investigative and Corrective Actions (Service Information Tables 1 and 3)

At the applicable time specified in table 1 or table 3 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD: Do detailed, high frequency eddy current (HFEC), and ultrasonic inspections of the center section rear spar upper clevis lugs for any cracking, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 1 or table 3 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(h) Replacement (Service Information Table 1)

For airplanes identified as Group 1, Configuration 1, in Boeing Alert Service

Bulletin 737–55A1033, Revision 2, dated August 7, 2015: At the applicable time specified in table 1 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD, replace the center section rear upper chord with a new part or replace the center section with a serviceable center section assembly, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(i) Repetitive Post-Replacement Inspections, Related Investigative and Corrective Actions (Service Information Table 2)

For airplanes identified as Group 1, Configuration 1, in Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, with a new or serviceable 0.932-inch-thick center section rear spar upper chord: At the applicable time specified in table 2 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD, do detailed, HFEC, and ultrasonic inspections of the center section rear spar upper chord clevis lugs for any cracking, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 2 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(j) Post-Replacement Inspections, Related Investigative and Corrective Actions (Service Information Table 4)

For airplanes on which the center section rear spar upper chord was last replaced with a new part or serviceable part: Within the applicable times specified in table 4 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD, do detailed, HFEC, and ultrasonic inspections of the center section rear spar upper chord clevis lugs for any cracking, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 4 of 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(k) Repetitive Inspections, Related Investigative and Corrective Actions of the Horizontal Stabilizer (Service Information Table 5)

Within the applicable time specified in table 5 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033,

Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD, do detailed, HFEC, and ultrasonic inspections of the rear spar upper lugs of the horizontal stabilizer for any cracking, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 5 of 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(l) Post Replacement Inspections, Related Investigative and Corrective Actions (Service Information Table 6)

For airplanes with a replaced horizontal stabilizer with a new or serviceable part, within the applicable times specified in table 6 of 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD: Do a detailed, HFEC, and ultrasonic inspection of the rear spar upper lugs of the horizontal stabilizer for any cracking, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 6 of 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(m) Scheduled Inspections, Related Investigative and Corrective Actions (Service Information Table 7)

Within the applicable times specified in table 7 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD: Do HFEC and fluorescent dye penetrant inspections for cracking in the front and rear spar upper clevis lugs of the center section and front and rear spar upper lugs of the horizontal stabilizer, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 7 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(n) Post Scheduled Inspections, Related Investigative and Corrective Actions (Service Information Table 8)

For airplanes on which the center section rear spar upper chord or horizontal stabilizer rear spar upper chord has been replaced: Within the applicable time specified in table

8 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, except as specified in paragraph (o) of this AD: Do HFEC and fluorescent dye penetrant inspections for cracking in the front and rear spar upper clevis lugs of the center section or front and rear spar upper lugs of the horizontal stabilizer, as applicable, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015; except as specified in paragraph (p) of this AD. Do all related investigative and corrective actions before further flight. Repeat the inspections thereafter at the applicable times specified in table 8 of paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015.

(o) Exceptions to the Service Information: Compliance Times

(1) Where Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, specifies a compliance time “after the Revision 2 date of this service bulletin,” this AD requires compliance within the specified compliance time after the effective date of this AD.

(2) Where Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, specifies a compliance time or repeat interval as “Horizontal Stabilizer Center Section flight cycles” or “Horizontal Stabilizer flight cycles,” this AD requires compliance for the corresponding time or repeat interval in airplane flight cycles.

(p) Exception to the Service Information: Repair Compliance Method

If any cracking of the lug is found during any inspection required by this AD, and Boeing Alert Service Bulletin 737–55A1033, Revision 2, dated August 7, 2015, specifies to contact Boeing for appropriate action: Before further flight, repair the lug using a method approved in accordance with the procedures specified in paragraph (r) of this AD.

(q) Terminating Actions

(1) For Model 737–100, –200, and –200C series airplanes: Accomplishment of the inspections specified in paragraph (g) of this AD terminates the requirements of paragraph A. of AD 84–23–05, Amendment 39–4949 (49 FR 45744, November 20, 1984).

(2) For Model 737–200 and –200C series airplanes: Accomplishment of the inspections specified in paragraph (m) and (n) of this AD terminates the requirements of paragraphs A. and B. of AD 86–12–05, Amendment 39–5321 (51 FR 18771, May 22, 1986).

(r) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the

attention of the person identified in paragraph (s)(1) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane and the approval must specifically refer to this AD.

(s) Related Information

(1) For more information about this AD, contact Payman Soltani, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles ACO, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5313; fax: 562-627-5210; email: Payman.Soltani@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone: 206-544-5000, extension 1; fax: 206-766-5680; Internet: <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 28, 2016.

John P. Piccola, Jr.,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-16322 Filed 7-11-16; 8:45 am]

BILLING CODE 4910-13-P

SOCIAL SECURITY ADMINISTRATION

20 CFR Parts 404, 405 and 416

[Docket No. SSA-2014-0052]

RIN 0960-AH71

Ensuring Program Uniformity at the Hearing and Appeals Council Levels of the Administrative Review Process

AGENCY: Social Security Administration.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to revise our rules so that more of our procedures at the administrative law judge (ALJ) and Appeals Council levels of our administrative review process are consistent nationwide. We anticipate that these nationally consistent procedures will enable us to administer our disability programs more efficiently and better serve the public.

DATES: To ensure that your comments are considered, we must receive them no later than August 11, 2016.

ADDRESSES: You may submit comments by any one of three methods—Internet, fax, or mail. Do not submit the same comments multiple times or by more than one method. Regardless of which method you choose, please state that your comments refer to Docket No. SSA-2014-0052 so that we may associate your comments with the correct rule.

Caution: You should be careful to include in your comments only information that you wish to make publicly available. We strongly urge you not to include in your comments any personal information, such as Social Security numbers or medical information.

1. **Internet:** We strongly recommend that you submit your comments via the Internet. Please visit the Federal eRulemaking portal at <http://www.regulations.gov>. Use the “Search” function to find docket number SSA-2014-0052. The system will issue a tracking number to confirm your submission. You will not be able to view your comment immediately because we must post each comment manually. It may take up to a week for your comment to be viewable.

2. **Fax:** Fax comments to (410) 966-2830.

3. **Mail:** Mail your comments to the Office of Regulations and Reports Clearance, Social Security Administration, 3100 West High Rise Building, 6401 Security Boulevard, Baltimore, Maryland 21235-6401.

Comments are available for public viewing on the Federal eRulemaking portal at <http://www.regulations.gov> or in person, during regular business hours, by arranging with the contact person identified below.

FOR FURTHER INFORMATION CONTACT:

Maren Weight, Office of Appellate Operations, Social Security Administration, 5107 Leesburg Pike, Falls Church, VA 22041, (703) 605-7100. For information on eligibility or filing for benefits, call our national toll-free number, 1-800-772-1213 or TTY 1-800-325-0778, or visit our Internet site, Social Security Online, at <http://www.socialsecurity.gov>.

SUPPLEMENTARY INFORMATION: We propose revisions to:

- (1) The time-frame for notifying claimants of a hearing date;
- (2) the information in our hearing notices;
- (3) the period when we require claimants to inform us about or submit written evidence, written statements,

objections to the issues, and subpoena requests;

(4) what constitutes the official record; and

(5) the manner in which the Appeals Council considers additional evidence.

Background

Over the last few years, we have revised many of our regulations to bolster program integrity and clarify our policy, procedures, and expectations. For example, on June 25, 2014, we made changes to when a claimant must object to appearing at a hearing by video teleconferencing.¹ As another example, we published a final rule on March 20, 2015, that clarified a claimant’s duty to inform us about or submit all evidence that relates to whether or not he or she is blind or disabled, subject to two exceptions for privileged communications.² We made these and other changes specifically to strengthen the integrity of our programs.

As we explained in the final rule on March 20, 2015, “we believe program integrity requires us to obtain complete medical evidence (favorable or unfavorable) in disability claims.”³ Although that statement refers to medical evidence, we reiterate in this proposed rule that a complete evidentiary record is necessary for us to make an informed and accurate disability determination or decision, and bolsters program integrity by improving consistency in the adjudication of claims at all levels of the administrative review process. As we look ahead, we continue to evaluate our regulatory and sub-regulatory policies to assess where we can make changes to improve accuracy and efficiency in our administrative review processes. To that end, we are now proposing the changes outlined below.

As we discuss in detail below, we have now had time to implement helpful systems changes and review a study performed by the Administrative Conference of the United States (ACUS), in which ACUS evaluated available data and considered various internal and external stakeholder opinions about the impact of our Part 405 rules.⁴ We are

¹ 79 FR 35926.

² See 80 FR 14828, 20 CFR 404.1512, 416.912.

³ 80 FR at 14833.

⁴ See Report from Office of the Chairman of the Administrative Conference of the United States, SSA Disability Benefits Adjudication Process: Assessing the Impact of the Region 1 Pilot Program (Dec. 23, 2013) (“ACUS Report”), available at http://acus.gov/sites/default/files/documents/Assessing%20Impact%20of%20Region%20I%20Pilot%20Program%20Report_12_23_13_final.pdf. For the specific data reviewed and opinions collected by ACUS, see Appendix to SSA