

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-2125; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) Reporting Requirements: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(k) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2016-0085, dated April 28, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9055.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the

FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 22, 2016.

**John P. Piccola, Jr.,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-21166 Filed 9-7-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-9058; Directorate Identifier 2016-NM-024-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Fokker Services B.V.**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD), for certain Fokker Services B.V. Model F28 Mark 0100 airplanes. This proposed AD was prompted by an analysis which determined that, for certain areas of the fuselage, the current threshold of an Airworthiness Limitations Section inspection is insufficient to detect early crack development. This proposed AD would require one time high and low frequency eddy current inspections of the affected fuselage skin for cracks and repair if necessary. We are proposing this AD to detect and correct cracks in the fuselage skin; such cracking could result in reduced structural integrity of the fuselage.

**DATES:** We must receive comments on this proposed AD by October 24, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Fokker Services

B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone: +31 (0)88-6280-350; fax: +31 (0)88-6280-111; email: [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9058; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9058; Directorate Identifier 2016-NM-024-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive Airworthiness Directive 2016-0029, dated February 23, 2016 (referred

to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Fokker Services B.V. Model F28 Mark 0100 airplanes. The MCAI states:

Recently, a complementary fatigue and damage tolerance analysis was accomplished by the design approval holder on the traffic collision avoidance system (TCAS) antenna installation on the top of the fuselage between station (STA) 6805 and STA7305. Based on the results, it was determined that for the affected area, the current threshold of the Airworthiness Limitations Section inspection task 533001–00–20 (special detailed inspection of longitudinal lap joints) is insufficient to timely detect possible crack development.

This condition, if not detected and corrected, could affect the structural integrity of the fuselage in this area.

To address this potential unsafe condition, Fokker Services published Service Bulletin (SB) SBF100–53–130 to provide inspection instructions. For the reasons described above, this [EASA] AD requires a one-time inspection [high and low frequency eddy

current inspections for cracks] of the fuselage skin around the largest TCAS antenna external doubler and of the longitudinal lap joint at stringer (STR) 37 between fuselage STA6805 and STA7305 [and repair if necessary. This [EASA] AD is considered to be an interim action and further [EASA] AD action may follow.

More information on this subject can be found in Fokker Services All Operators Message AOF100.199.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–9058.

**Related Service Information Under 1 CFR Part 51**

We reviewed Fokker Service Bulletin SBF100–53–130, dated December 01, 2015. This service information describes one-time high and low frequency eddy current inspections for cracks of the fuselage skin. This service information is reasonably available because the interested parties have access to it

through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

**Costs of Compliance**

We estimate that this proposed AD affects 8 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85	\$680

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This

proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- 1. Is not a “significant regulatory action” under Executive Order 12866;
- 2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
- 3. Will not affect intrastate aviation in Alaska; and
- 4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Fokker Services B.V.:** Docket No. FAA–2016–9058; Directorate Identifier 2016–NM–024–AD.

**(a) Comments Due Date**

We must receive comments by October 24, 2016.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Fokker Services B.V. Model F28 Mark 0100 airplanes, certificated in any category, serial numbers 11244 through 11407 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Reason**

This AD was prompted by an analysis which determined that, for certain areas of the fuselage, the current threshold of an

Airworthiness Limitations Section inspection is insufficient to detect early crack development. We are issuing this AD to detect and correct cracks in the fuselage skin; such cracking could result in reduced structural integrity of the fuselage.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection**

Within the compliance time specified in paragraphs (g)(1) and (g)(2) of this AD, as applicable, do high and low frequency eddy current inspections for cracks in the fuselage skin around the largest traffic collision avoidance system (TCAS) antenna external doubler and of the longitudinal lap joint at fuselage stringer STR37 between fuselage station (STA) STA6805 and STA7305, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-53-130, dated December 01, 2015.

(1) For airplanes having 45,000 or more flight cycles as of the effective date of this AD, since the date of issuance of the original airworthiness certificate or the date of issuance of the original export certificate of airworthiness: Do the high and low frequency eddy current inspections within 750 flight cycles after the effective date of this AD.

(2) For airplanes having 40,000 or more flight cycles, but less than 45,000 flight cycles as of the effective date of this AD, since the date of issuance of the original airworthiness certificate or the date of issuance of the original export certificate of airworthiness: Do the high and low frequency eddy current inspections within 1,500 flight cycles after the effective date of this AD.

**(h) Corrective Action**

If any crack is found during any inspection required by paragraph (g) of this AD: Before further flight, repair using a method approved by the Manager, International Branch, ANM 116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Fokker B.V. Service's EASA Design Organization Approval (DOA).

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal

inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Fokker Services B.V.'s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2016-0029, dated February 23, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9058.

(2) For service information identified in this AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone: +31 (0)88-6280-350; fax: +31 (0)88-6280-111; email: [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 24, 2016.

**John P. Piccola, Jr.,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-21151 Filed 9-7-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2016-9067; Directorate Identifier 2016-NM-043-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes. This proposed AD was prompted by a report of incidents involving fatigue cracking in transport category airplanes that are approaching

or have exceeded their design service objective and a structural reevaluation by the manufacturer that identified additional structural elements that qualify as structural significant items (SSIs). This proposed AD would require revising the maintenance or inspection program, as applicable, to include inspections that will give no less than the required damage tolerance rating (DTR) for certain SSIs, and repairing any cracked structure. This proposed AD would also require inspections to detect cracks of all SSI structure, and repair if necessary. We are proposing this AD to ensure the continued structural integrity of all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP series airplanes.

**DATES:** We must receive comments on this proposed AD by October 24, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9067; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office