

liabilities held in connection with its other business, and will not be considered a source for payment of unrelated claims of creditors and other claimants.

(c) *Timing of dividends.* The payment of dividends, if any, under paragraph (a) of this section, on proved or adjudicated claims will be made periodically, at the discretion of the OCC, as the receiver liquidates the assets of the uninsured bank.

(d) *Distribution to shareholders.* After all administrative expenses of the receiver and proved claims of creditors of the uninsured bank have been paid in full, to the extent there are receivership assets to make such payments, any remaining proceeds shall be paid to the shareholders, or their legal representatives, in proportion to their stock ownership.

§ 51.9 Termination of receivership.

If there are assets remaining after full payment of the expenses of the receiver and all claims of creditors for an uninsured bank and all fiduciary accounts of the bank have been closed or transferred to a successor fiduciary and fiduciary powers surrendered, the Comptroller shall call a meeting of the shareholders of the uninsured bank, as provided in 12 U.S.C. 197, for the shareholders to decide the manner in which the liquidation will continue. The liquidation may continue by:

(a) Continuing the receivership of the uninsured bank under the direction of the Comptroller; or

(b) Ending the receivership and oversight by the Comptroller and replacing the receiver with a liquidating agent to proceed to liquidate the remaining assets of the uninsured bank for the benefit of the shareholders, as set out in 12 U.S.C. 197.

Dated: September 2, 2016.

Thomas J. Curry,

Comptroller of the Currency.

[FR Doc. 2016-21846 Filed 9-12-16; 8:45 am]

BILLING CODE P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2016-9120; Directorate Identifier 2016-CE-024-AD]

RIN 2120-AA64

Airworthiness Directives; M7 Aerospace LLC

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all M7 Aerospace LLC Models SA226-AT, SA226-T, SA226-T(B), SA226-TC, SA227-AC (C-26A), SA227-AT, SA227-BC (C-26A), SA227-CC, SA227-DC (C-26B), and SA227-TT airplanes. This proposed AD was prompted by corrosion and stress corrosion cracking of the pitch trim actuator upper attach fittings of the horizontal stabilizer front spar. This proposed AD would require repetitive inspections of the pitch trim actuator upper attach fittings for corrosion and/or cracking in the bolt holes and the web/flange radius with replacement of fittings as necessary. We are proposing this AD to prevent jamming and/or loss of control of the horizontal stabilizer, which could result in partial or complete loss of airplane pitch control.

DATES: We must receive comments on this proposed AD by October 28, 2016.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact M7 Aerospace LLC, 10823 NE Entrance Road, San Antonio, Texas 78216; phone: (210) 824-9421; fax: (210) 804-7766; Internet: <http://www.elbitsystems-us.com>; email: MetroTech@M7Aerospace.com. You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call 816-329-4148.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9120; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the

regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Andrew McAnaul, Aerospace Engineer, FAA, ASW-143 (c/o San Antonio MIDO), 10100 Reunion Place, Suite 650, San Antonio, Texas 78216; phone: (210) 308-3365; fax: (210) 308-3370; email: andrew.mcanaul@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9120; Directorate Identifier 2016-CE-024-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We received reports of multiple SA226 and SA227 airplanes with corrosion and/or stress corrosion cracks in the pitch trim actuator upper attach fittings of the horizontal stabilizer front spar. This condition, if not corrected, could result in jamming and/or loss of control of the horizontal stabilizer with consequent partial or complete loss of airplane pitch control.

Related Service Information Under 14 CFR Part 51

We reviewed M7 Aerospace LLC Service Bulletin (SB) 226-27-081 R1, M7 Aerospace LLC SB 227-27-061 R1, and M7 Aerospace LLC SB CC7-27-033 R1, all Issued: April 13, 2016 and Revised: June 27, 2016. The service information describes procedures for detailed visual, liquid penetrant, ultrasound and high frequency eddy current inspections of the pitch trim actuator upper attach fittings for corrosion and cracking in the bolt holes and the web/flange radius, and replacement if necessary. This service information is reasonably available

because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

We are proposing this AD because we evaluated all the relevant information

and determined the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in

the service information described previously.

Costs of Compliance

We estimate that this proposed AD affects 300 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspect pitch trim actuator upper attach fittings.	16 work-hours × \$85 per hour = \$1,360	Not Applicable ..	\$1,360	\$408,000

We estimate the following costs to do any necessary replacements that would

be required based on the results of the proposed inspection. We have no way of

determining the number of aircraft that might need these replacements:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replace 2 fittings	8 work-hours × \$85 per hour = \$680	\$4,900	\$5,580

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

M7 Aerospace LLC: Docket No. FAA-2016-9120; Directorate Identifier 2016-CE-024-AD.

(a) Comments Due Date

We must receive comments by October 28, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to M7 Aerospace LLC Models SA226-AT, SA226-T, SA226-T(B), SA226-TC, SA227-AC (C-26A), SA227-AT, SA227-BC (C-26A), SA227-CC, SA227-DC (C-26B), and SA227-TT airplanes, all serial numbers, certificated in any category.

(d) Subject

Joint Aircraft System Component (JASC)/Air Transport Association (ATA) of America Code 5510, Horizontal Stabilizer Structure.

(e) Unsafe Condition

This AD was prompted by corrosion and stress corrosion cracking of the pitch trim actuator upper attach fittings of the horizontal stabilizer front spar. We are issuing this AD to prevent jamming and/or loss of control of the horizontal stabilizer, which could result in partial or complete loss of airplane pitch control.

(f) Compliance

Comply with paragraphs (g)(1) and (2) of this AD using the following service bulletins and within the compliance times specified, unless already done:

(1) *For Models SA226-AT, SA226-T, SA226-T(B), and SA226-TC:* M7 Aerospace LLC Service Bulletin (SB) 226-27-081 R1, Issued: April 13, 2016 and Revised: June 27, 2016; or

(2) *For Models SA227-AC (C-26A), SA227-AT, SA227-BC (C-26A), and SA227-TT:* M7 Aerospace LLC SB 227-27-061 R1, Issued: April 13, 2016 and Revised: June 27, 2016; or

(3) *For Models SA227-CC and SA227-DC (C-26B):* M7 Aerospace LLC SB CC7-27-033 R1, Issued: April 13, 2016 and Revised: June 27, 2016.

(g) Actions

(1) Within the next 600 hours time-in-service (TIS) after the effective date of this AD or within the next 12 months after the effective date of this AD, whichever occurs first, and repetitively thereafter at intervals not to exceed every 5,000 hours TIS or 5 years, whichever occurs first, perform the inspection of the pitch trim actuator upper attach fittings following section 2.A. and return to service following section 2.C. of the Accomplishment Instructions of the service bulletins identified in paragraphs (f)(1), (2), or (3) of this AD, as applicable.

(2) If any corrosion or cracks are found as a result of any inspection in paragraph (g)(1) of this AD, before further flight, replace the fitting following section 2.B. and return to service following section 2.C. of the Accomplishment Instructions of the service bulletins identified in paragraphs (f)(1), (2), or (3) of this AD, as applicable.

(h) Credit for Actions Accomplished in Accordance With Previous Service Information

This proposed AD allows credit for inspection or replacement of the pitch trim actuator upper attach fittings required in paragraph (g)(1) and (2) of the AD, if done before the effective date of this AD, following the procedures in the Accomplishment Instructions of the applicable service information listed in paragraphs (h)(1) through (3) of this AD:

(1) *For Models SA226-AT, SA226-T, SA226-T(B), and SA226-TC:* M7 Aerospace LLC Service Bulletin (SB) 226-27-081, Issued: April 13, 2016; or

(2) *For Models SA227-AC (C-26A), SA227-AT, SA227-BC (C-26A), and SA227-TT:* M7 Aerospace LLC SB 227-27-061, Issued: April 13, 2016; or

(3) *For Models SA227-CC and SA227-DC (C-26B):* M7 Aerospace LLC SB CC7-27-033, Issued: April 13, 2016.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Fort Worth Airplane Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (i) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

(1) For more information about this AD, contact Andrew McAnaul, Aerospace Engineer, FAA, ASW-143 (c/o San Antonio MIDO), 10100 Reunion Place, Suite 650, San Antonio, Texas 78216; phone: (210) 308-3365; fax: (210) 308-3370; email: andrew.mcanaul@faa.gov.

(2) For service information identified in this AD, contact M7 Aerospace LLC, 10823

NE Entrance Road, San Antonio, Texas 78216; phone: (210) 824-9421; fax: (210) 804-7766; Internet: <http://www.elbitsystems-us.com>; email: MetroTech@M7Aerospace.com. You may view this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call 816-329-4148.

Issued in Kansas City, Missouri, on September 1, 2016.

Pat Mullen,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-21704 Filed 9-12-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 73**

[Docket No. FAA-2016-8927; Airspace Docket No. 15-ANM-24]

RIN 2120-AA66

Proposed Establishment of Restricted Area R-2603; Fort Carson, CO

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This action proposes to establish restricted area R-2603 within the existing Fort Carson, CO, Pinon Canyon Maneuver Site (PCMS), near Trinidad, CO. The U.S. Army requires additional restricted airspace because the restricted area ranges at Fort Carson are not large enough to meet all training requirements. The proposed R-2603 would provide increased ground-to-air, air-to-ground, and air-to-air battle space to increase training capacity and relieve training congestion at Fort Carson.

DATES: Comments must be received on or before October 28, 2016.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Building Ground Floor, Room W12-140, Washington, DC 20590; telephone: 1 (800) 647-5527, or (202) 366-9826. You must identify FAA Docket No. FAA-2016-8927 and Airspace Docket No. 15-ANM-24, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. Comments on environmental and land use aspects should be directed to: Fort Carson NEPA Program Manager, Directorate of Public Works, Environmental Division, 1626 Evans Street, Building 12191, Fort

Carson, CO 80913-4362. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Docket Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office is on the ground floor of the building at the above address.

FOR FURTHER INFORMATION CONTACT: Paul Gallant, Airspace Policy Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

SUPPLEMENTARY INFORMATION:**Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would establish a restricted area at Fort Carson, CO, to enhance aviation safety and accommodate essential Army training requirements.

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-2016-8927 and Airspace Docket No. 15-ANM-24) and be submitted in triplicate to the Docket Office at the address listed above. You may also submit comments through the Internet at www.regulations.gov.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to FAA