

Attention Service Bulletin 777-54-0021, dated June 23, 2005, except where Boeing Special Attention Service Bulletin 777-54-0021, dated June 23, 2005, does not provide an international annealed copper standard (IACS) value for determining the results of the inspection for heat damage, the maximum acceptable IACS value is 42 percent.

(j) New Requirements: Detailed and Conductivity Inspections and Related Investigative and Corrective Actions (Repetitive Inspections for Certain Airplanes)

(1) For Group 1, Configurations 1, 2, 3, and 4, airplanes; and Group 2, Configurations 1 and 2, airplanes; identified in Boeing Special Attention Service Bulletin 777-54-0038, dated March 6, 2015: Within 24 months after the effective date of this AD, do a detailed inspection of the aft fairing lower structure for any cracking and deformation, and do a conductivity inspection of the aft fairing lower structure for the IACS value (thermal degradation indication), as applicable, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777-54-0038, dated March 6, 2015. Do all applicable related investigative and corrective actions before further flight.

(2) For Group 1, Configurations 1 and 3, airplanes, and Group 2, Configuration 1, airplanes, identified in Boeing Special Attention Service Bulletin 777-54-0038, dated March 6, 2015: Repeat the inspections specified in paragraph (j)(1) of this AD thereafter at intervals not to exceed 24 months until the terminating action specified in paragraph (k) of this AD is done.

(k) Optional Terminating Action

Accomplishing a detailed inspection of the gap cover strips and heat shield pan castings for damage and applicable corrective actions, and installation of new gap cover strip fillers, new Velcro strips, and improved aft fairing insulation blankets with new batting material, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 777-54-0026, Revision 2, dated January 5, 2012, prior to or concurrently with accomplishing detailed and conductivity inspections and all applicable related investigative and corrective actions required by paragraph (j)(1) of this AD, terminates the repetitive inspections specified in paragraph (j)(2) of this AD; except, where Boeing Service Bulletin 777-54-0026, Revision 2, dated January 5, 2012, specifies to contact the manufacturer, repair using a method approved in accordance with the procedures specified in paragraph (m) of this AD.

(l) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (k) of this AD that are identified in Boeing Service Bulletin 777-54-0026, Revision 2, dated January 5, 2012, if those actions were performed before the effective date of this AD using Boeing Service Bulletin 777-54-0026, dated March 29, 2011; or Boeing Service Bulletin 777-54-0026, Revision 1, dated August 23, 2011.

(m) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (n)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved for AD 2006-19-12 are approved as AMOCs for the corresponding provisions of paragraphs (g), (h), and (i) of this AD.

(5) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (m)(5)(i) and (m)(5)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(n) Related Information

(1) For more information about this AD, contact Sue Lucier, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-917-6438; fax: 425-917-6590; email: suzanne.lucier@faa.gov.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (o)(5) and (o)(6) of this AD.

(o) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on December 30, 2016.

(i) Boeing Service Bulletin 777-54-0026, Revision 2, dated January 5, 2012.

(ii) Boeing Special Attention Service Bulletin 777-54-0038, dated March 6, 2015.

(4) The following service information was approved for IBR on October 30, 2006, Amendment 39-14769 (71 FR 55727, September 25, 2006).

(i) Boeing Special Attention Service Bulletin 777-54-0021, Revision 1, dated March 16, 2006.

(ii) Reserved.

(5) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(6) You may view this service information at FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(7) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on October 28, 2016.

Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-26809 Filed 11-23-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2016-6413; Airspace Docket No. 16-AWP-11]

Establishment of Class E Airspace, Silver Springs, NV

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action establishes Class E airspace extending upward from 700 feet above the surface at Silver Springs Airport, Silver Springs, NV. The FAA found establishment of airspace necessary for the safety and management of Instrument Flight Rules (IFR) operations under new Area Navigation (RNAV) Standard Instrument Approach Procedures at the airport.

DATES: Effective 0901 UTC, March 2, 2017. The Director of the Federal

Register approves this incorporation by reference action under Title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.11 and publication of conforming amendments.

ADDRESSES: FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed on line at http://www.faa.gov/air_traffic/publications/. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to <http://www.archives.gov/federal-register/code-of-federal-regulations/ibr-locations.html>.

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

FOR FURTHER INFORMATION CONTACT: Tom Clark, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203-4511.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it establishes controlled airspace at Silver Springs Airport, Silver Springs, NV.

History

On August 25, 2016, the FAA published in the **Federal Register** a notice of proposed rulemaking (NPRM) to establish Class E airspace extending upward from 700 feet above the surface at Silver Springs Municipal Airport, Silver Springs, NV (81 FR 58416) Docket No. FAA-2016-6413. Interested parties were invited to participate in this rulemaking effort by submitting written

comments on the proposal to the FAA. No comments were received.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.11A, dated August 3, 2016, and effective September 15, 2016, which is incorporated by reference in 14 CFR part 71.1. The Class E airspace designation listed in this document will be published subsequently in the Order.

Availability and Summary of Documents for Incorporation by Reference

This document amends FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016. FAA Order 7400.11A is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11A lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

The Rule

This amendment to Title 14, Code of Federal Regulations (14 CFR) part 71 establishes Class E airspace extending upward from 700 feet above the surface within a 2-mile radius of Silver Springs Airport, Silver Springs, NV, with segments extending from the 2-mile radius to 9 miles northeast, and 7.5 miles northeast of the airport. This airspace is established to accommodate new RNAV (GPS) standard instrument approach procedures developed for the airport.

Regulatory Notices and Analyses

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current, is non-controversial and unlikely to result in adverse or negative comments. It, therefore: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a Regulatory Evaluation as the anticipated impact is so minimal. Since this is a routine matter that only affects air traffic procedures and air navigation, it is certified that this rule, when promulgated, does not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Environmental Review

The FAA has determined that this action qualifies for categorical exclusion under the National Environmental

Policy Act in accordance with FAA Order 1050.1F, "Environmental Impacts: Policies and Procedures," paragraph 5-6.5a. This airspace action is not expected to cause any potentially significant environmental impacts, and no extraordinary circumstances exist that warrant preparation of an environmental assessment.

Lists of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (air).

Adoption of the Amendment

In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR part 71 as follows:

PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

■ 1. The authority citation for part 71 continues to read as follows:

Authority: 49 U.S.C. 106(f), 106(g); 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

§ 71.1 [Amended]

■ 2. The incorporation by reference in 14 CFR 71.1 of FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016, is amended as follows:

Paragraph 6005 Class E Airspace Areas Extending Upward From 700 Feet or More Above the Surface of the Earth

* * * * *

AWP NV E5 Silver Springs, NV [New]

Silver Springs Airport, NV (Lat. 39°24'11" N., long. 119°15'04" W.)

That airspace extending upward from 700 feet above the surface within a 2-mile radius of Silver Springs Airport, and that airspace 2 miles either side of the 69° bearing from the 2-mile radius to 9 miles northeast of the airport, and that airspace 1.5 miles either side of the 60° bearing from the 2-mile radius to 7.5 miles northeast of the airport.

Issued in Seattle, Washington, on November 16, 2016.

Tracey Johnson,

Manager, Operations Support Group, Western Service Center.

[FR Doc. 2016-28277 Filed 11-23-16; 8:45 am]

BILLING CODE 4910-13-P