

Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7329; fax 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; fax 514-855-7401; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 12, 2017.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-12798 Filed 6-20-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2017-0621; Directorate Identifier 2017-NM-049-AD]

**RIN 2120-AA64**

#### Airworthiness Directives; Bombardier, Inc., Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model DHC-8-400 series airplanes. This proposed AD was prompted by reports that operation of fuselage doors was interrupted due to corrosion in certain door roller bearings. This proposed AD would require a one-time detailed inspection of the bearings for corrosion, and replacement if necessary. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by August 7, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room

W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0621; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Aziz Ahmed, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7329; fax 516-794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0621; Directorate Identifier 2017-NM-049-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

#### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2016-18, dated June 20, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc., Model DHC-8-400 series airplanes. The MCAI states:

A number of translating fuselage door operation interruptions has been reported. In one case, the Aft Service door could not be opened. It was found that the door lift latch bearings had corroded, which prevented the door from opening.

The translating doors are classified as emergency exits. The inability to open an emergency exit could inhibit evacuation in the event of an emergency. This [Canadian] AD is issued to mandate a one-time inspection of the translating door bearings to check for corrosion, replace bearings if required, and apply Corrosion Inhibiting Compound (CIC).

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0621.

#### Related Service Information Under 14 CFR Part 51

Bombardier has issued Service Bulletin 84-52-88, dated April 14, 2016. This service information describes procedures for identification of corrosion in fuselage door bearings, replacement if necessary, and CIC application. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type designs.

**Costs of Compliance**

We estimate that this proposed AD affects 143 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection and CIC application .....	8 work-hours × \$85 per hour = \$680 for 3 doors.	\$0	\$680	\$97,240

We estimate the following costs to do any necessary replacements that would

be required based on the results of the proposed inspection. We have no way of

determining the number of aircraft that might need this replacement:

**ON-CONDITION COSTS**

Action	Labor cost	Parts cost	Cost per product
Replacement .....	4 work-hours × \$85 per hour = \$340 per door .....	\$432	\$772 per door.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA-2017-0621; Directorate Identifier 2017-NM-049-AD.

**(a) Comments Due Date**

We must receive comments by August 7, 2017.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Bombardier, Inc., Model DHC-8-400, -401, and -402 airplanes, certificated in any category, serial numbers 4001 and 4003 through 4488 inclusive, except those incorporating Bombardier ModSum IS4Q5200050.

**(d) Subject**

Air Transport Association (ATA) of America Code 52, Doors.

**(e) Reason**

This AD was prompted by reports of interrupted operation of translating fuselage doors caused by corrosion in the door lift and latch shaft roller bearings. We are issuing this AD to detect and correct bearing corrosion and prevent door operation interruptions that could inhibit safe evacuation of the airplane in an emergency.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection and Replacement of Bearings**

Within 6,000 flight hours or 36 months after the effective date of this AD, whichever occurs earlier, do a detailed visual inspection of all translating fuselage door lift and latch shaft roller bearings for signs of corrosion, damaged seals, and loss of lubricant; replace any corroded bearings; and apply corrosion-inhibiting compound (CIC); in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-52-88, dated April 14, 2016.

**(h) Credit for Previous Actions**

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 84-52-85, dated September 23, 2015; or Bombardier Service Bulletin 84-52-85, Revision A, dated January 22, 2016.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal

inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2016-18, dated June 20, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0621.

(2) For more information about this AD, contact Aziz Ahmed, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7329; fax 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 12, 2017.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-12803 Filed 6-20-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2017-0563; Directorate Identifier 2017-NM-021-AD]

RIN 2120-AA64

#### **Airworthiness Directives; Saab AB, Saab Aeronautics (Formerly Known as Saab AB, Saab Aerosystems) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Saab AB, Saab Aeronautics Model 340A (SAAB/SF340A) and SAAB 340B airplanes. This proposed AD was prompted by the determination that new inspection tasks for the drag brace support fitting of the main landing gear (MLG) and corrosion prevention and control program (CPCP) related tasks are necessary. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate airworthiness limitations, including new inspection tasks for the drag brace support fitting of the MLG and to implement CPCP related tasks. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by August 7, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Saab AB, Saab Aeronautics, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email [saab340techsupport@saabgroup.com](mailto:saab340techsupport@saabgroup.com); Internet <http://www.saabgroup.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on

the availability of this material at the FAA, call 425-227-1221.

#### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0563; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-227-1112; fax: 425-227-1149.

#### **SUPPLEMENTARY INFORMATION:**

##### **Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0563; Directorate Identifier 2017-NM-021-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### **Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2017-0033, dated February 17, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Saab AB, Saab Aeronautics Model 340A (SAAB/SF340A) and SAAB 340B airplanes. The MCAI states:

The airworthiness limitations and/or certification maintenance instructions for SAAB SF340A and 340B, which are