

**(e) Unsafe Condition**

This AD was prompted by a report of a crack in the body station (BS) 616 frame inboard chord during supplemental structural inspection document (SSID) inspections; the crack was located at the lowest fastener hole of the inboard chord inboard strap below stringer S-11R. We are issuing this AD to detect and correct any crack in the inboard chord of the BS 578 (737-400 series airplanes) and BS 616 (737-300 and -500 series airplanes) frame below stringers S-11L or S-11R, which could result in structural failure of the frame and possible rapid decompression.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Repetitive Detailed and High Frequency Eddy Current (HFEC) Inspections**

Except as required by paragraph (i) of this AD, at the applicable times specified in table 1 of paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016: Do detailed and HFEC inspections for any crack at the frame inboard chords, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016. Repeat the inspections thereafter at the time specified in table 1 of paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016.

**(h) Repair**

If any crack is found during any inspection required by paragraph (g) of this AD, repair before further flight using a method approved in accordance with the procedures specified in paragraph (j) of this AD. Although Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016, specifies to contact Boeing for repair instructions, and specifies that action as "RC" (Required for Compliance), this AD requires repair as specified in this paragraph.

**(i) Service Information Exceptions**

Where Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016, specifies a compliance time "after the original issue date of this service bulletin," this AD requires compliance within the specified compliance time after the effective date of this AD.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to [9-ANM-LAACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (j)(4)(i) and (j)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or sub-step is labeled "RC Exempt," then the RC requirement is removed from that step or sub-step. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(k) Related Information**

For more information about this AD, contact Galib Abumeri, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles ACO, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5324; fax: 562-627-5210; email: [galib.abumeri@faa.gov](mailto:galib.abumeri@faa.gov).

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 737-53A1366, dated May 17, 2016.

(ii) Reserved.

(3) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740; telephone: 562-797-1717; Internet: <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on June 9, 2017.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-12631 Filed 6-21-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-9504; Directorate Identifier 2016-NM-107-AD; Amendment 39-18932; AD 2017-13-02]**

**RIN 2120-AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 7X airplanes. This AD was prompted by reports that during the assembly of structural elements on some airplanes, lack of established procedures and tools caused boring and torquing defects to be present at some locations. This AD requires a detailed visual inspection of bore holes for defects, replacement of bolts, and repair if necessary. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective July 27, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of July 27, 2017.

**ADDRESSES:** For service information identified in this final rule, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9504.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://>

[www.regulations.gov](http://www.regulations.gov) by searching for and locating Docket No. FAA–2016–9504; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800–647–5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1137; fax 425–227–1149.

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Dassault Aviation Model FALCON 7X airplanes. The NPRM published in the **Federal Register** on December 21, 2016 (81 FR 93645) (“the NPRM”).

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness

Directive 2016–0116, dated June 16, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Dassault Aviation Model FALCON 7X airplanes. The MCAI states:

During the assembly of structural elements on some aeroplanes, lack of established procedures and tools caused boring and torquing defects to be present at some locations on the foot of frame (FR) 36 and FR39. Dassault Aviation (DA) identified the individual aeroplanes that are potentially affected by this production deficiency. Quality control actions have been implemented to ensure that new aeroplanes, from s/n 183, cannot be affected by this defect.

This condition, if not detected and corrected, would adversely affect the structural integrity of the aeroplane.

For the reasons described above, this [EASA] AD requires [a detailed visual] inspection of bore holes [for defects] and replacement of bolts at FR36 and FR39 and, depending on findings, accomplishment of a repair.

To address this potential unsafe condition, DA published Service Bulletin (SB) F7X–379 to provide corrective action instructions.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–9504.

**Comments**

We gave the public the opportunity to participate in developing this AD. We

received no comments on the NPRM or on the determination of the cost to the public.

**Conclusion**

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

**Related Service Information Under 14 CFR Part 51**

We reviewed Dassault Service Bulletin 7X–379, dated February 29, 2016. This service information describes procedures for a detailed visual inspection of bore holes at FR36 and FR39 for defects, replacement of bolts at FR36 and FR39, and repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**Costs of Compliance**

We estimate that this AD affects 41 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection and replacement .....	6 work-hours × \$85 per hour = \$510 .....	\$26	\$536	\$21,976

We have received no definitive data that would enable us to provide cost estimates for the on-condition repair specified in this AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures

the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;

2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2017-13-02 Dassault Aviation:**

Amendment 39-18932; Docket No. FAA-2016-9504; Directorate Identifier 2016-NM-107-AD.

**(a) Effective Date**

This AD is effective July 27, 2017.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Dassault Aviation Model FALCON 7X airplanes, certificated in any category, serial numbers (S/Ns) 2, 5, and 8 through 182 inclusive; except S/Ns 141, 148, 149, 157, 159, 166, 170, 171, 174, 175, and 177 through 180 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Reason**

This AD was prompted by reports that during the assembly of structural elements on some airplanes, lack of established procedures and tools caused boring and torquing defects to be present at some locations on the foot of frame (FR) 36 and FR39. We are issuing this AD to detect and correct defects in the bore holes at FR36 and FR39 that could adversely affect the structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection of Bore Holes**

At the applicable time identified in paragraphs (g)(1) or (g)(2) of this AD, remove the sheer bolts at FR36 and FR39, left hand and right hand, as identified in Dassault Service Bulletin 7X-379, dated February 29, 2016, and do a detailed visual inspection of the bore holes for defects, in accordance with Dassault Service Bulletin 7X-379, dated February 29, 2016.

(1) For airplanes with S/Ns 2 and 5: Before exceeding 4,100 flight cycles after the date of release to service after the first C-Check or within 3 months from the effective date of this AD, whichever occurs later.

(2) For airplanes other than those identified in paragraph (g)(1) of this AD: Before exceeding 4,100 flight cycles since the date of issuance of the original certificate of airworthiness or the original export certificate of airworthiness or within 3 months from the effective date of this AD, whichever occurs later.

**(h) Repair of Bore Holes and Bolt Replacement**

(1) If, during any inspection required by paragraph (g) of this AD, any defect is found, before further flight, repair the affected areas, and replace the bolts at FR36 and FR39, in accordance with Dassault Service Bulletin 7X-379, dated February 29, 2016; except where Dassault Service Bulletin 7X-379, dated February 29, 2016, specifies to contact Dassault Aviation for instructions, before further flight, repair using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA).

(2) If, during any inspection required by paragraph (g) of this AD, no defect is found, before further flight, replace the bolts at FR36 and FR39, in accordance with Dassault Service Bulletin 7X-379, dated February 29, 2016.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Dassault Aviation's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2016-0116, dated June 16, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9504.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Dassault Service Bulletin 7X-379, dated February 29, 2016.

(ii) Reserved.

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on June 12, 2017.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-12808 Filed 6-21-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2017-0078; Directorate Identifier 2015-SW-026-AD; Amendment 39-18933; AD 2017-13-03]**

**RIN 2120-AA64**

**Airworthiness Directives; Bell Helicopter Textron Canada Limited Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for Bell Helicopter Textron Canada Limited (Bell) Model 429 helicopters. This AD requires adding an identification number to life-limited rod ends that do not have a serial number (S/N). The actions of this AD are intended to address an unsafe condition on these products.

**DATES:** This AD is effective July 27, 2017.