

Bulletin A300–28–0089, Revision 02, dated April 25, 2014.

(ii) Airbus Service Bulletin A300–28–6106, dated January 13, 2011; or Airbus Service Bulletin A300–28–6106, Revision 02, dated April 25, 2014.

(iii) Airbus Service Bulletin A310–28–2173, dated January 13, 2011; or Airbus Mandatory Service Bulletin A310–28–2173, Revision 02, dated April 25, 2014.

(2) This paragraph provides credit for the actions required by paragraph (h) of this AD, if those actions were performed before the effective date of this AD using the service information specified in paragraph (k)(2)(i), (k)(2)(ii), or (k)(2)(iii) of this AD.

(i) Airbus Service Bulletin A300–28–0089, dated January 13, 2011; Airbus Service Bulletin A300–28–0089, Revision 01, dated April 15, 2011; or Airbus Service Bulletin A300–28–0089, Revision 02, dated April 25, 2014.

(ii) Airbus Service Bulletin A300–28–6106, dated January 13, 2011; Airbus Service Bulletin A300–28–6106, Revision 01, dated April 15, 2011; or Airbus Service Bulletin A300–28–6106, Revision 02, dated April 25, 2014.

(iii) Airbus Service Bulletin A310–28–2173, dated January 13, 2011; Airbus Service Bulletin A310–28–2173, Revision 01, dated April 15, 2011; or Airbus Service Bulletin A310–28–2173, Revision 02, dated April 25, 2014.

(3) This paragraph provides credit for the actions specified in paragraph (j) of this AD, if those actions were performed before the effective date of this AD using Airbus Service Bulletin A300–28–6110, Revision 00, dated November 28, 2013.

#### (l) Other FAA AD Provisions

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to the attention of the person identified in paragraph (m)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov).

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(ii) AMOCs approved previously for AD 2012–21–04, Amendment 39–17220 (77 FR 64701, October 23, 2012), are not approved as AMOCs with this AD.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by

the DOA, the approval must include the DOA-authorized signature.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2017–0051, dated March 23, 2017, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0714.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone: 425–227–2125; fax: 425–227–1149.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email: [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet: <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on July 19, 2017.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017–16052 Filed 8–1–17; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2017–0020; Directorate Identifier 2016–NE–33–AD]

RIN 2120–AA64

#### Airworthiness Directives; Honeywell International Inc. Turbofan Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Honeywell International Inc. AS907 series turbofan engines. This proposed AD was prompted by two loss-of-thrust-control events, and two in-flight shutdowns (IFSDs) of new production, low-time engines attributed to water intrusion of the engine electronic control unit (ECU). This proposed AD would require applying sealant to identified areas of the ECU and requires inserting a copy of certain airplane operating procedures into the applicable flight manuals. We are proposing this

AD to correct the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by September 18, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax*: 202–493–2251.
- *Mail*: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Honeywell International Inc., 111 S. 34th Street, Phoenix, AZ 85034–2802; phone: 800–601–3099; Internet: <https://myaerospace.honeywell.com/wps/portal/!ut/>. You may view this service information at the FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (781) 238–7125.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0020; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Joseph Costa, Aerospace Engineer, Los Angeles Aircraft Certification Office, FAA, Transport Airplane Directorate, 3960 Paramount Blvd., Lakewood, CA 90712–4137; phone: 562–627–5246; fax: 562–627–5210; email: [joseph.costa@faa.gov](mailto:joseph.costa@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this NPRM. Send your comments to an address listed under the **ADDRESSES**

section. Include “Docket No. FAA–2017–0020; Directorate Identifier 2016–NE–33 AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

**Discussion**

We received reports of two loss-of-thrust-control events and two IFSDs of new production, low-time AS907–2–1A engines, attributed to water intrusion into the ECU at the ECU cover-to-body splitline, cover screws and cavities, leading to internal board electrical faults. Similar events have occurred on AS907–1–1A engines when rainwater dripped through the ECU and T2 engine access panels at 10 and 2 o’clock locations onto the ECU and harnesses while the airplane was on the ground. This proposed AD would require application of sealant to identified areas of the ECU and requires inserting a copy of certain airplane operating procedures into the applicable flight manuals.

These procedures describe interim actions for not dispatching the airplane under certain engine electronic fault conditions. This condition, if not corrected, could result in dual engine power loss, loss of thrust control, and damage to the engine and airplane.

**Related Service Information Under 1 CFR Part 51**

We reviewed Honeywell Service Bulletin (SB); SB AS907–76–9021, Revision 1, dated April 20, 2017; Operating Information Letter (OIL) OIAS907–0001R00, dated March 14, 2017; Component Maintenance Manual (CMM) 2119576, Temporary Revision (TR) No. 76–1, Section 76–10–15, dated September 6, 2016; and CMM 2119576, TR No. 76–1, Section 76–10–29, dated August 2, 2016.

In combination, the SB and TRs describe procedures for applying sealant to identified areas of the ECU to prevent water from entering the ECU on AS907 series engines. The OIL provides instructions for interrogating the onboard Maintenance Data Computer to clear engine electronic fault conditions. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination**

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require applying sealant to identified areas of the ECU.

**Differences Between This Proposed AD and the Service Information**

Honeywell SB AS907–76–9021, Revision 1, dated April 20, 2017 recommends complying after 400 engine operating hours, not to exceed 18 months from the date of issuance of the SB. This NPRM proposes complying within 200 engine operating hours or 9 months after the effective date of the AD, whichever occurs first.

**Interim Action**

We consider this proposed AD interim action. Honeywell is developing design changes that will eliminate the need to apply sealant to the ECU.

**Costs of Compliance**

We estimate that this ECU sealing affects 477 engines installed on airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inserting Figure into AFM .....	2 work-hours × \$85 per hour = \$170.00 .....	\$0	\$170.00	\$81,090.00
Application of sealant, on-wing .....	5.5 work-hours × \$85 per hour = \$467.50 .....	50.00	517.50	246,847.50

We estimate the following costs to do any necessary fault checks of the

Maintenance Data Computer (MDC)/ Onboard Messaging System (OMS). We

estimate that 20 engines will need this fault check.

**ON-CONDITION COSTS**

Action	Labor cost	Parts cost	Cost per product
Fault Check of Maintenance Data Computer .....	5 work-hours × \$85 per hour = \$425.00 .....	\$0	\$425.00

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII,

Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Honeywell International Inc.:** Docket No. FAA–2017–0020; Directorate Identifier 2016–NE–33–AD.

#### (a) Comments Due Date

We must receive comments by September 18, 2017.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all Honeywell International Inc. AS907–1–1A, –2–1A, –2–1G, and –3–1E model turbofan engines, with engine serial numbers (S/Ns) listed in Table 3 of Honeywell Service Bulletin (SB) AS907–76–9021 Revision 1, dated April 20, 2017; or with engine electronic control unit (ECU), part numbers (P/Ns) 2119576–1001 through –1011, with no Mod Record or with a Mod Record 1 through 5 (for the AS907–1–1A engine); or with ECU, P/N 2119576–1102, with no Mod Record (for the AS907–2–1A engine); or with ECU, P/Ns 2119576–3002 and –3102, with no Mod Record (for the AS907–2–1G engine); or with ECU, P/Ns 2119576–4102 and –4103, with no Mod Record (for the AS907–3–1E), installed.

#### (d) Subject

Joint Aircraft System Component (JASC) Code 7600, Engine Controls Section.

#### (e) Unsafe Condition

This AD was prompted by two low-time loss-of-thrust-control events and two in-flight shut downs (IFSDs) attributed to water intrusion of the engine ECU. We are issuing this AD to prevent a dual engine power loss, and loss of thrust control and damage to the engine and airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

(1) For applicable engines, apply sealant to both ECUs within 200 engine operating hours, or 9 months after the effective date of this AD whichever occurs first, using Accomplishment Instructions, paragraph 3.C. of Honeywell SB AS907–76–9021, Revision 1, dated April 20, 2017.

(2) If the ECU sealant is removed or becomes defective, re-apply sealant using Accomplishment Instructions, paragraph 3.C. of Honeywell SB AS907–76–9021, Revision 1, dated April 20, 2017; or Component Maintenance Manual (CMM) 2119576, Temporary Revision (TR) No. 76–1, Section 76–10–15, dated September 6, 2016; or CMM 2119576, TR No. 76–1, Section 76–10–29, dated August 2, 2016.

(3) Within 60 days after the effective date of this AD, for all airplanes that have an affected engine installed with an ECU not in compliance with paragraph (g)(1) or (g)(2) of this AD, insert a copy of Figure 1, 2, or 3 to paragraph (g) of this AD, as applicable to your airplane, into the Emergency Procedures Section of the Airplane Flight Manual (AFM).

**BILLING CODE 4910–13–P**

## Figure 1 to Paragraph (g) – Airplane Operating Procedures for Bombardier Airplanes

<p><b>NOTE</b></p> <p>Procedures in dotted line boxes are actions to be performed by the pilot / flight crew.</p>
<div style="border: 1px dashed black; padding: 10px; margin: 10px auto; width: 80%;"> <p style="text-align: center;"><b><u>WARNING</u></b></p> <p style="text-align: center;"><b>IF A CYAN “L ENGINE MINOR FAULT” OR “R ENGINE MINOR FAULT” IS ANNOUNCED AT ANY TIME BEFORE TAKEOFF, DO NOT FLY THE AIRPLANE. CONTACT MAINTENANCE PERSONNEL.</b></p> </div>

### Figure 2 to Paragraph (g) - Airplane Operating Procedures for Gulfstream Airplanes

NOTE

Procedures in dotted line boxes are actions to be performed by the pilot / flight crew.

WARNING

IF A CYAN “L ENGINE MINOR FAULT” OR “R ENGINE MINOR FAULT” IS ANNOUNCED AT ANY TIME BEFORE TAKEOFF, DO NOT FLY THE AIRPLANE. CONTACT MAINTENANCE PERSONNEL.

### Figure 3 to Paragraph (g) – Airplane Operating Procedures for Embraer Airplanes

NOTE

Procedures in dotted line boxes are actions to be performed by the pilot / flight crew.

WARNING

IF A CYAN “ENGINE SHORT DISPATCH” IS ANNOUNCED AT ANY TIME BEFORE TAKEOFF, DO NOT FLY THE AIRPLANE. CONTACT MAINTENANCE PERSONNEL.

#### BILLING CODE 4910-13-C

(4) If a cyan warning is announced, before next flight, check the current fault messages in the Maintenance Data Computer (MDC)/ Onboard Messaging System (OMS) for any of the following:

- (i) FADEC ECU A
- (ii) FADEC ECU B
- (iii) THROTTLE LEVER 1A
- (iv) THROTTLE LEVER 1B
- (v) THROTTLE RIGGING 1A
- (vi) THROTTLE RIGGING 1B

(5) Replace the ECU if any of the fault messages listed in paragraph (g)(4) of this AD are in the MDC OMS. Refer to Operating Information Letter (OIL) OIAS907-0001R00, dated March 14, 2017 for information on returning and replacing the ECU.

(6) Continued flight is permitted if none of the fault messages listed in paragraph (g)(4) of this AD are in the MDC OMS, or if paragraph (g)(5) of this AD was accomplished.

#### (h) Installation Prohibition

(i) Do not install an ECU if any of the fault messages listed in paragraph (g)(4) of this AD are in the MDC OMS.

(ii) Do not install an ECU that has a P/N and Mod Record listed in paragraph (c) of this AD unless it was either sealed as specified in paragraph (g)(1) of this AD or if the ECU is not affected by this AD.

#### (i) Terminating Action

Remove from the AFM, Figure 1, 2, or 3 to paragraph (g) of this AD, after paragraph (g)(1) or (g)(2) of this AD is accomplished.

#### (j) Credit for Previous Actions

You may take credit for the actions required by paragraphs (g)(1) or (g)(2) of this AD, if you performed those actions before the effective date of this AD using Honeywell SB AS907-76-9021, Revision 0, dated May 13, 2016.

#### (k) Alternative Methods of Compliance (AMOCs)

The Manager, Los Angeles Aircraft Certification Office, FAA, may approve

AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request.

#### (l) Related Information

(1) For more information about this AD, contact Joseph Costa, Aerospace Engineer, Los Angeles Aircraft Certification Office, FAA, Transport Airplane Directorate, 3960 Paramount Blvd., Lakewood, CA 90712-4137; phone: 562-627-5246; fax: 562-627-5210; email: [joseph.costa@faa.gov](mailto:joseph.costa@faa.gov).

(2) Honeywell SB AS907-76-9021, Revision 1, dated April 20, 2017; OIL OIAS907-0001R00, dated March 14, 2017; CMM 2119576, TR No. 76-1, Section 76-10-15, dated September 6, 2016; and CMM 2119576, TR No. 76-1, Section 76-10-29, dated August 2, 2016, can be obtained from Honeywell International using the contact information in paragraph (l)(3) of this AD.

(3) For service information identified in this AD, contact Honeywell International Inc., 111 S. 34th Street, Phoenix, AZ 85034-2802; phone: 800-601-3099; Internet: <https://myaerospace.honeywell.com/wps/portal/lut/>.

(4) You may view this service information at the FAA, Engine & Propeller Directorate,

1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on June 21, 2017.

**Thomas A. Boudreau,**

*Acting Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2017-16148 Filed 8-1-17; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2016-9555; Airspace Docket No. 16-AGL-2]

#### Proposed Modification and Revocation of Multiple Air Traffic Service (ATS) Routes; Northcentral United States

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Supplemental notice of proposed rulemaking (SNPRM).

**SUMMARY:** This action proposes to amend and remove multiple VHF Omnidirectional Range (VOR) Federal airways in northcentral United States to reflect additional amendments to several Federal airways impacted by the decommissioning of the Tiverton, OH, VOR/Distance Measuring Equipment (VOR/DME) navigation aid. The route changes would be made as part of the FAA's Next Generation Air Transportation System (NextGen) efforts to safely improve the overall efficiency of the National Airspace System (NAS).

**DATES:** Comments must be received on or before September 18, 2017.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Building Ground Floor, Room W12-140, Washington, DC 20590; telephone: 1 (800) 647-5527, or (202) 366-9826. You must identify FAA Docket No. FAA-2016-9555 and Airspace Docket No. 16-AGL-2 at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1 (800) 647-5527), is on the ground floor of the building at the above address.

FAA Order 7400.11A, Airspace Designations and Reporting Points, and

subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal-regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal-regulations/ibr_locations.html).

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:** Colby Abbott, Airspace Policy Group, Office of Airspace Services, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783.

#### SUPPLEMENTARY INFORMATION:

##### Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it modifies the NAS route structure as necessary to preserve the safe and efficient flow of air traffic within the NAS.

##### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-

2016-9555 and Airspace Docket No. 16-AGL-2) and be submitted in triplicate to the Docket Management Facility (see **ADDRESSES** section for address and phone number). You may also submit comments through the internet at <http://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to FAA Docket No. FAA-2016-9555 and Airspace Docket No. 16-AGL-2." The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified comment closing date will be considered before taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. All comments submitted will be available for examination in the public docket both before and after the comment closing date. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

##### Availability of NPRMs

An electronic copy of this document may be downloaded through the internet at <http://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's Web page at [http://www.faa.gov/air\\_traffic/publications/airspace\\_amendments/](http://www.faa.gov/air_traffic/publications/airspace_amendments/).

You may review the public docket containing the proposal, any comments received and any final disposition in person in the Dockets Office (see **ADDRESSES** section for address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. An informal docket may also be examined during normal business hours at the office of the Operations Support Group, Central Service Center, Federal Aviation Administration, 10101 Hillwood Blvd., Fort Worth, TX 76177.

##### Availability and Summary of Documents for Incorporation by Reference

This document proposes to amend FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016. FAA Order 7400.11A is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11A lists Class A, B, C, D, and E airspace areas,