

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Dassault Service Bulletin 7X-176, dated February 3, 2016.

(ii) Reserved.

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 21, 2017.

Dionne Palermo,

*Acting Director, System Oversight Division,
Aircraft Certification Service.*

[FR Doc. 2017-18390 Filed 8-30-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0559; Product Identifier 2017-NM-013-AD; Amendment 39-19014; AD 2017-18-05]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP

airplanes. This AD was prompted by a report of damage found at the lower trailing edge panels of the left wing and a broken fuse pin of the landing gear beam end fitting. This AD requires repetitive replacement or inspection of certain fuse pins, and applicable on-condition actions. We are issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective October 5, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 5, 2017.

ADDRESSES: For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0559.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0559; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Bill Ashforth, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6432; fax: 425-917-6590; email: bill.ashforth@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would

apply to all The Boeing Company Model 747-100, 747-100B, 747-100B SUD, 747-200B, 747-200C, 747-200F, 747-300, 747-400, 747-400D, 747-400F, 747SR, and 747SP airplanes. The NPRM published in the **Federal Register** on June 20, 2017 (82 FR 28023). The NPRM was prompted by a report of damage found at the lower trailing edge panels of the left wing and a broken fuse pin of the landing gear beam end fitting. The NPRM proposed to require repetitive replacement or inspection of certain fuse pins, and applicable on-condition actions. We are issuing this AD to detect and correct cracking in the fuse pin of the wing landing gear beam end fitting. A broken fuse pin will not support the wing landing gear beam, causing damage to the surrounding structure, including flight control cables and hydraulic systems, which could result in loss of controllability of the airplane.

Comment

We gave the public the opportunity to participate in developing this final rule. We have considered the comment received. Boeing supported the NPRM.

Conclusion

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 747-57A2360, dated January 20, 2017. The service information describes procedures for repetitive replacement or inspection of certain fuse pins, and applicable on-condition actions. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

We estimate that this AD affects 158 airplanes of U.S. registry. We estimate the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Fuse pin replacement ¹	Up to 46 work-hours × \$85 per hour = \$3,910 per replacement cycle.	Up to \$15,150	Up to \$19,060 per replacement cycle.	Up to \$3,011,480 per replacement cycle.
Magnetic particle inspection ¹ .	Up to 48 work-hours × \$85 per hour = \$4,080 per inspection cycle.	\$0	Up to \$4,080 per inspection cycle.	Up to \$644,640 per inspection cycle.
Surface inspection ¹	Up to 10 work-hours × \$85 per hour = \$850 per inspection cycle.	\$0	Up to \$850 per inspection cycle.	Up to \$134,300 per inspection cycle.

¹ Operators may choose which action they want to use.

We estimate the following costs to do any necessary replacements that will be required based on the results of the inspection. We have no way of determining the number of aircraft that might need these replacements:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Fuse pin replacement	46 work-hours × \$85 per hour = \$3,910	Up to \$15,150	Up to \$19,060.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2017–18–05 The Boeing Company:
Amendment 39–19014; Docket No. FAA–2017–0559; Product Identifier 2017–NM–013–AD.

(a) Effective Date

This AD is effective October 5, 2017.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, 747–400F, 747SR, and 747SP airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report of damage found at the lower trailing edge panels of the left wing and a broken fuse pin of the landing gear beam end fitting. We are issuing this AD to detect and correct cracking in the fuse pin of the wing landing gear beam end fitting. A broken fuse pin will not support the wing landing gear beam, causing damage to the surrounding structure, including flight control cables and hydraulic systems, which could result in loss of controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Actions Required for Compliance

Except as required by paragraph (h) of this AD: At the applicable times specified in paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 747–57A2360, dated January 20, 2017, do all applicable actions identified as required for compliance (“RC”) in, and in accordance with, the Accomplishment Instructions of Boeing Alert Service Bulletin 747–57A2360, dated January 20, 2017.

(h) Exception to the Service Information

Where Boeing Alert Service Bulletin 747–57A2360, dated January 20, 2017, specifies a compliance time “after the original issue date of this service bulletin,” this AD requires

compliance within the specified compliance time after the effective date of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: *9-ANM-Seattle-ACO-AMOC-Requests@faa.gov*.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(j) Related Information

For more information about this AD, contact Bill Ashforth, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6432; fax: 425-917-6590; email: *bill.ashforth@faa.gov*.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 747-57A2360, dated January 20, 2017.

(ii) Reserved.

(3) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet *https://www.myboeingfleet.com*.

(4) You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: *http://www.archives.gov/federal-register/cfr/ibr-locations.html*.

Issued in Renton, Washington, on August 21, 2017.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2017-18392 Filed 8-30-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF HOMELAND SECURITY

Coast Guard

33 CFR Part 165

[Docket Number USCG-2017-0809]

RIN 1625-AA00

Safety Zone; Pacific Ocean, North Shore, Oahu, HI—Recovery Operations

AGENCY: Coast Guard, DHS.

ACTION: Temporary final rule.

SUMMARY: The Coast Guard is establishing a temporary safety zone for the navigable waters of the North Shore of Oahu, Hawaii, near Ka'Ena Point. The temporary safety zone encompasses all waters extending 3 nautical miles in all directions from position 21°34.88' N.; 158°17.90' W. The safety zone is needed to protect personnel, vessels and the marine environment from potential hazards associated with ongoing operations to salvage a downed helicopter in this area. Entry of vessels or persons into this zone is prohibited unless specifically authorized by the Captain of the Port (COTP) Honolulu.

DATES: This rule is effective without actual notice from August 31, 2017 until 8:00 a.m. on September 15, 2017. For the purposes of enforcement, actual notice will be used from August 22, 2017, until August 31, 2017.

ADDRESSES: To view documents mentioned in this preamble as being

available in the docket, go to *http://www.regulations.gov*, type USCG-2017-0809 in the "SEARCH" box and click "SEARCH." Click on Open Docket Folder on the line associated with this rule.

FOR FURTHER INFORMATION CONTACT: If you have questions on this rule, call or email Lieutenant Commander John Bannon, Waterways Management Division, U.S. Coast Guard Sector Honolulu at (808) 541-4359 or *john.e.bannon@uscg.mil*.

SUPPLEMENTARY INFORMATION:

I. Table of Abbreviations

CFR Code of Federal Regulations
COTP Captain of the Port
DHS Department of Homeland Security
FR Federal Register
NPRM Notice of proposed rulemaking
§ Section
U.S.C. United States Code

II. Background Information and Regulatory History

The Coast Guard is issuing this temporary rule without prior notice and opportunity to comment pursuant to authority under section 4(a) of the Administrative Procedure Act (APA) (5 U.S.C. 553(b)). This provision authorizes an agency to issue a rule without prior notice and opportunity to comment when the agency for good cause finds that those procedures are "impracticable, unnecessary, or contrary to the public interest." Under 5 U.S.C. 553(b)(B), the Coast Guard finds that good cause exists for not publishing a notice of proposed rulemaking (NPRM) with respect to this rule because immediate action is needed to respond to the potential safety hazards associated with this salvage effort, and therefore publishing an NPRM is impracticable and contrary to public interest.

On August 16, 2017, the Coast Guard published a temporary final rule entitled, "Safety Zone; Pacific Ocean, North Shore Oahu, HI docket number USCG-2016-0507, establishing a safety zone in the navigable waters of the Pacific Ocean, North Shore, Oahu, HI. The purpose of the safety zone was to provide for the safety of search and rescue efforts for an August 15, 2017 downed helicopter off the North Shore, Oahu, HI, near Ka'Ena Point. Additionally, the safety zone was necessary to map the debris field and crash location. The new TFR adjusts the safety zone to complete all salvage and recovery operations after the completion of the search and rescue operations.