

## PART 690—PROTECTION OF HUMAN SUBJECTS

■ 1. The authority citation for 690 continues to read as follows:

**Authority:** 5 U.S.C. 301; 42 U.S.C. 300v–1(b).

■ 2. Amend § 690.101 by revising paragraphs (l)(3) and (4) to read as follows:

### § 690.101 To what does this policy apply?

\* \* \* \* \*

(l) \* \* \*

(3) Research initially approved by an IRB, for which such review was waived pursuant to § 690.101(i), or for which a determination was made that the research was exempt before July 19, 2018, shall comply with the pre-2018 Requirements, except that an institution engaged in such research on or after July 19, 2018 may instead comply with the 2018 Requirements if the institution determines that such ongoing research will comply with the 2018 Requirements and an IRB documents such determination.

(4) Research initially approved by an IRB, for which such review was waived pursuant to § 690.101(i), or for which a determination was made that the research was exempt on or after July 19, 2018, shall comply with the 2018 Requirements.

\* \* \* \* \*

**Lawrence Rudolph,**  
*General Counsel.*

## DEPARTMENT OF TRANSPORTATION

### 49 CFR Part 11

#### List of Subjects in 49 CFR Part 11

Human research subjects, Reporting and record-keeping requirements, Research.

For the reasons stated in the preamble, the Department of Transportation further amends 49 CFR part 11 as published in the **Federal Register** on January 19, 2017 (82 FR 7149) as follows:

## PART 11—PROTECTION OF HUMAN SUBJECTS

■ 1. The authority citation for 11 continues to read as follows:

**Authority:** 5 U.S.C. 301; 42 U.S.C. 300v–1(b).

■ 2. Amend § 11.101 by revising paragraphs (l)(3) and (4) to read as follows:

### § 11.101 To what does this policy apply?

\* \* \* \* \*

(l) \* \* \*

(3) Research initially approved by an IRB, for which such review was waived

pursuant to § 11.101(i), or for which a determination was made that the research was exempt before July 19, 2018, shall comply with the pre-2018 Requirements, except that an institution engaged in such research on or after July 19, 2018 may instead comply with the 2018 Requirements if the institution determines that such ongoing research will comply with the 2018 Requirements and an IRB documents such determination.

(4) Research initially approved by an IRB, for which such review was waived pursuant to § 11.101(i), or for which a determination was made that the research was exempt on or after July 19, 2018, shall comply with the 2018 Requirements.

\* \* \* \* \*

**Elaine L. Chao,**  
*Secretary of Transportation.*

[FR Doc. 2018–00997 Filed 1–17–18; 4:15 pm]

**BILLING CODE 4150–36–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2018–0023; Product Identifier 2017–NM–084–AD; Amendment 39–19164; AD 2018–02–11]

RIN 2120–AA64

### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Airbus Model A330–301, –321, –322 and –342 airplanes. This AD requires contacting the FAA to obtain instructions for addressing the unsafe condition on these products, and doing the actions specified in those instructions. This AD was prompted by a report of cracking in the top skin of the horizontal stabilizer (HS) center box (CB) of an airplane in pre-modification 41330 configuration. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD becomes effective February 6, 2018.

We must receive comments on this AD by March 8, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202–493–2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0023; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 1601 Lind Avenue SW, Renton, WA 98057–3356; telephone: 425–227–1138; fax: 425–227–1149.

### SUPPLEMENTARY INFORMATION:

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2017–0078, dated May 3, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus Model A330–301, –321, –322 and –342 airplanes. The MCAI states:

Cracks were found in the horizontal stabilizer (HS) centre box (CB) top skin of an aeroplane in pre-modification 41330 configuration. The cracks were initiated at the upper flange corner at Rib 3 rear spar area on left hand side of the CB.

This condition, if not detected and corrected, could lead to reduced structural integrity of the HS CB of the aeroplane.

To address this unsafe condition, Airbus published Service Bulletin (SB) A330–55–3046 to provide inspection instructions for the affected area.

For the reason described above, this [EASA] AD requires a one-time special detailed inspection (SDI) of the HS CB top

skin integral flange area and, depending on findings, accomplishment of applicable corrective action(s). This [EASA] AD also requires reporting of the inspection results, including no findings, to Airbus.

You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0023.

**FAA’s Determination and Requirements of This AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

**FAA’s Determination of the Effective Date**

Since there are currently no domestic operators of this product, we find good cause that notice and opportunity for prior public comment are unnecessary. In addition, for the reasons stated above, we find that good cause exists for making this amendment effective in less than 30 days.

**Comments Invited**

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2018-0023; Product Identifier 2017-NM-084-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic,

environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

**Costs of Compliance**

Currently, there are no affected U.S.-registered airplanes. This AD requires contacting the FAA to obtain instructions for addressing the unsafe condition, and doing the actions specified in those instructions. Based on the actions specified in the MCAI AD, we are providing the following cost estimates for an affected airplane that is placed on the U.S. Register in the future:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product
High frequency eddy current inspection .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85
Reporting .....	1 work-hour × \$85 per hour = \$85 .....	0	85

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120-0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW, Washington, DC 20591, ATTN: Information Collection Clearance Officer, AES-200.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has

delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

**Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2018–02–11 Airbus:** Amendment 39–19164; Docket No. FAA–2018–0023; Product Identifier 2017–NM–084–AD.

#### (a) Effective Date

This AD becomes effective February 6, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus Model A330–301, –321, –322 and A330–342 airplanes, certificated in any category, manufacturer serial numbers 0012, 0017, 0030, 0037, 0045, 0050, 0060, 0062, 0064, 0065, 0071, 0082, 0083, 0098, 0099, 0102, 0106, 0109, 0112, 0132 and 0177.

#### (d) Subject

Air Transport Association (ATA) of America Code 55, Stabilizers.

#### (e) Reason

This AD was prompted by a report of cracking in the top skin of the horizontal stabilizer (HS) center box (CB) of an airplane in pre-modification 41330 configuration. We are issuing this AD to detect and correct cracking in the HS CB, which could lead to reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Action(s)

Within 30 days after the effective date of this AD, request instructions from the Manager, International Section, Transport Standards Branch, FAA, to address the unsafe condition specified in paragraph (e) of this AD; and accomplish the actions at the times specified in, and in accordance with, those instructions. Guidance can be found in Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) AD 2017–0078, dated May 3, 2017.

#### (h) Alternative Methods of Compliance (AMOCs)

The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if

requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (i) Paperwork Reduction Act Burden Statement

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120–0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW, Washington, DC 20591, Attn: Information Collection Clearance Officer, AES–200.

#### (j) Related Information

(1) Refer to MCAI EASA AD 2017–0078, dated May 3, 2017, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0023.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 1601 Lind Avenue SW, Renton, WA 98057–3356; telephone: 425–227–1138; fax: 425–227–1149.

#### (k) Material Incorporated by Reference

None.

Issued in Renton, Washington, on January 10, 2018.

**John P. Piccola, Jr.,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–00949 Filed 1–19–18; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2017–0719; Product Identifier 2017–NE–22–AD; Amendment 39–19163; AD 2018–02–10]

RIN 2120–AA64

#### Airworthiness Directives; Pratt & Whitney Division Turbofan Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Pratt & Whitney Division (PW) PW4074, PW4074D, PW4077, PW4077D, PW4084D, PW4090, and PW4090–3 turbofan engines. This AD was prompted by the discovery of multiple cracked outer diffuser cases. This AD requires initial and repetitive inspections to detect cracks in the outer diffuser case and removal from service of cases that fail inspection. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective February 26, 2018.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of February 26, 2018.

**ADDRESSES:** For service information identified in this final rule, contact Pratt & Whitney Division, 400 Main St., East Hartford, CT 06118; phone: 800–565–0140; fax: 860–565–5442. You may view this service information at the FAA, Engine and Propeller Standards Branch, 1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781–238–7759. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0719.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0719; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations (phone: 800–647–5527) is Document Operations, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor,