

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2018–0301; Product Identifier 2017–NM–112–AD.

#### (a) Comments Due Date

We must receive comments by June 11, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the Airbus airplanes identified in paragraphs (c)(1) through (c)(6) of this AD, certificated in any category, all manufacturer serial numbers.

(1) Model A300 B2–1A, B2–1C, B2K–3C, B2–203, B4–2C, B4–103, and B4–203 airplanes.

(2) Model A300 B4–601, B4–603, B4–620, and B4–622 airplanes.

(3) Model A300 B4–605R and B4–622R airplanes.

(4) Model A300 F4–605R and F4–622R airplanes.

(5) Model A300 C4–605R Variant F airplanes.

(6) Model A310–203, –204, –221, –222, –304, –322, –324, and –325 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

#### (e) Reason

This AD was prompted by a report of yellow hydraulic system failure, including both braking accumulators, due to failure of the parking brake operated valve (PBOV). We are issuing this AD to prevent failure of the PBOV, which could result in no braking capability during ground operations, possibly leading to damage to the airplane and injury to people on the ground.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) PBOV Replacement

Within 60 months after the effective date of this AD, replace the PBOV having part number (P/N) A25315–1 with a PBOV having P/N A25315020–2, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A300–32–0467, dated July 4, 2017; Airbus Service Bulletin A300–32–6117, dated July 4, 2017; or Airbus Service Bulletin A310–32–2151, dated July 4, 2017; as applicable.

#### (h) Parts Prohibition

(1) After modification of an airplane as required by paragraph (g) of this AD, do not

install any PBOV having P/N A25315–1 on that airplane.

(2) For an airplane that, as of the effective date of this AD, has a PBOV having P/N A25315020–2 installed: As of the effective date of this AD do not install any PBOV having P/N A25315–1 on that airplane.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2017–0153, dated August 17, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0301.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3225.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice

Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on April 11, 2018.

**Dionne Palermo,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–08653 Filed 4–26–18; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2018–0300; Product Identifier 2017–NM–134–AD]

RIN 2120–AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A318, A319, and A320 series airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, –253N, and –271N airplanes. This proposed AD was prompted by a revision of an airworthiness limitations document that specifies more restrictive maintenance requirements and airworthiness limitations. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate revised fuel airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 11, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus, Airworthiness Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0300; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

### FOR FURTHER INFORMATION CONTACT:

Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206-231-3223.

### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2018-0300; Product Identifier 2017-NM-134-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent

for the Member States of the European Union, has issued EASA Airworthiness Directive 2017-0169, dated September 7, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Airbus Model A318, A319, and A320 series airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -253N, and -271N airplanes. The MCAI states:

The Fuel Airworthiness Limitations (FAL) for Airbus A320 family aeroplanes, which are approved by EASA, are currently defined and published in the Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 5 document. These instructions have been identified as mandatory for continued airworthiness.

Failure to accomplish these instructions could result in a fuel tank explosion and consequent loss of the aeroplane.

\* \* \* the Federal Aviation Administration (FAA) published Special Federal Aviation Regulation (SFAR) 88, and the Joint Aviation Authorities (JAA) published interim Policy INT/POL/25/12. In response to these regulations, Airbus conducted a design review to develop FAL for Airbus A320 family aeroplanes.

The FAL were specified in Airbus A318/A319/A320/A321 FAL document ref. 95A.1931/05 at issue 04 for A318/A319/A320/A321 aeroplanes. This document was approved by EASA and is now referenced in Airbus A318/A319/A320/A321 ALS Part 5 to comply with EASA policy statement (EASA D2005/CPRO).

Previously, EASA issued AD 2014-0260 [which corresponds to FAA AD 2016-20-12, Amendment 39-18678 (81 FR 72507, October 20, 2016) (“AD 2016-20-12”)] to require accomplishment of all FAL-related actions as described in ALS Part 5 at Revision 01. ALS Part 5 Revision 02 and 03 were not mandated because no significant changes were introduced with these Revisions. The new ALS Part 5 Revision 04 (hereafter referred to as ‘the ALS’ in this [EASA] AD) includes new and/or more restrictive requirements and extends the applicability to model A320-251N, A320-271N, A321-251N, A321-253N and A321-271N aeroplanes.

For the reasons described above, this [EASA] AD retains the requirements of EASA AD 2014-0260, which is superseded, and requires implementation of the actions specified in the ALS.

You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0300.

### Relationship of This Proposed AD to AD 2016-20-12

This NPRM would not supersede AD 2016-20-12. Rather, we have determined that a stand-alone AD would be more appropriate to address the changes in the MCAI. This NPRM would require revising the maintenance

or inspection program to incorporate the new maintenance requirements and airworthiness limitations.

Accomplishment of the proposed actions would then terminate all requirements of AD 2016-20-12.

### Related Service Information Under 1 CFR Part 51

Airbus has issued Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 5 Fuel Airworthiness Limitations (FAL), Revision 04, dated April 6, 2017. This service information describes fuel system airworthiness limitations. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type designs.

This AD requires revisions to certain operator maintenance documents to include new actions (e.g., inspections) and Critical Design Configuration Control Limitations (CDCCLs). Compliance with these actions and CDCCLs is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by this proposed AD, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (j)(1) of this proposed AD. The request should include a description of changes to the required inspections that will ensure the continued operational safety of the airplane.

### Differences Between This Proposed AD and the MCAI or Service Information

The MCAI specifies that if there are findings from the ALS inspection tasks, corrective actions must be accomplished in accordance with Airbus maintenance documentation. However, this proposed AD does not include that requirement.

Operators of U.S.-registered airplanes are required by general airworthiness and operational regulations to perform maintenance using methods that are acceptable to the FAA. We consider those methods to be adequate to address any corrective actions necessitated by the findings of ALS inspections required by this proposed AD.

#### **Airworthiness Limitations Based on Type Design**

The FAA recently became aware of an issue related to the applicability of ADs that require incorporation of an ALS revision into an operator's maintenance or inspection program.

Typically, when these types of ADs are issued by civil aviation authorities of other countries, they apply to all airplanes covered under an identified type certificate (TC). The corresponding FAA AD typically retains applicability to all of those airplanes.

In addition, U.S. operators must operate their airplanes in an airworthy condition, in accordance with 14 CFR 91.7(a). Included in this obligation is the requirement to perform any maintenance or inspections specified in the ALS, and in accordance with the ALS as specified in 14 CFR 43.16 and 91.403(c), unless an alternative has been approved by the FAA.

When a type certificate is issued for a type design, the specific ALS, including revisions, is a part of that type design, as specified in 14 CFR 21.31(c).

The sum effect of these operational and maintenance requirements is an obligation to comply with the ALS defined in the type design referenced in the manufacturer's conformity statement. This obligation may introduce a conflict with an AD that requires a specific ALS revision if new airplanes are delivered with a later revision as part of their type design. To address this conflict, the FAA has approved alternative methods of compliance (AMOCs) that allow operators to incorporate the most recent ALS revision into their maintenance/inspection programs, in lieu of the ALS revision required by the AD. This eliminates the conflict and enables the operator to comply with both the AD and the type design.

However, compliance with AMOCs is normally optional, and we recently became aware that some operators choose to retain the AD-mandated ALS revision in their fleet-wide maintenance/inspection programs, including those for new airplanes delivered with later ALS revisions, to help standardize the maintenance of the fleet. To ensure that operators comply with the applicable ALS revision for

newly delivered airplanes containing a later revision than that specified in an AD, we plan to limit the applicability of ADs that mandate ALS revisions to those airplanes that are subject to an earlier revision of the ALS, either as part of the type design or as mandated by an earlier AD.

This proposed AD therefore would apply to Airbus Model A318, A319, and A320 series airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -253N, and -271N airplanes with an original certificate of airworthiness or original export certificate of airworthiness that was issued on or before the date of approval of the ALS revision identified in this proposed AD. Operators of airplanes with an original certificate of airworthiness or original export certificate of airworthiness issued after that date must comply with the airworthiness limitations specified as part of the approved type design and referenced on the type certificate data sheet.

#### **Costs of Compliance**

We estimate that this proposed AD affects 1,250 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

We have determined that revising the maintenance or inspection program takes an average of 90 work-hours per operator, although we recognize that this number may vary from operator to operator. In the past, we have estimated that this action takes 1 work-hour per airplane. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), we have determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, we estimate the total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour).

#### **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation

is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

#### **Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### **The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### **PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### **§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA-2018-0300; Product Identifier 2017-NM-134-AD.

**(a) Comments Due Date**

We must receive comments by June 11, 2018.

**(b) Affected ADs**

This AD affects AD 2016–20–12, Amendment 39–18678 (81 FR 72507, October 20, 2016) (“AD 2016–20–12”).

**(c) Applicability**

This AD applies to the Airbus airplanes identified in paragraphs (c)(1) through (c)(4) of this AD, certificated in any category, with an original certificate of airworthiness or original export certificate of airworthiness issued on or before April 6, 2017.

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, –233, –251N, and –271N airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, –253N, and –271N airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

**(e) Reason**

This AD was prompted by a revision of an airworthiness limitations document that specifies more restrictive maintenance requirements and airworthiness limitations. We are issuing this AD to prevent the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Revision of Maintenance or Inspection Program**

Within 90 days after the effective date of this AD, revise the maintenance or inspection program, as applicable, to incorporate Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 5 Fuel Airworthiness Limitations (FAL), Revision 04, dated April 6, 2017. The initial compliance times for new or revised tasks are the minimum intervals or times specified in Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 5 Fuel Airworthiness Limitations (FAL), Revision 04, dated April 6, 2017, or within 30 days after the effective date of this AD, whichever occurs later.

**(h) No Alternative Actions, Intervals, or Critical Design Configuration Control Limitations (CDCCLs)**

After the maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections), intervals, or CDCCLs may be used unless the actions, intervals, and CDCCLs are approved as an alternative method of compliance (AMOC) in

accordance with the procedures specified in paragraph (j)(1) of this AD.

**(i) Terminating Action for AD 2016–20–12**

Accomplishing the actions required by this AD terminates all requirements of AD 2016–20–12.

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

**(k) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2017–0169, dated September 7, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0300.

(2) For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206–231–3223.

(3) For service information identified in this AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on April 11, 2018.

**Dionne Palermo,**

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2018–08649 Filed 4–26–18; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2018–0303; Product Identifier 2018–NM–006–AD]

**RIN 2120–AA64****Airworthiness Directives; Fokker Services B.V. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Fokker Services B.V. Model F28 Mark 0070 and 0100 airplanes. This proposed AD was prompted by a report that the retraction actuator eye-end of a Goodrich main landing gear (MLG) failed. This proposed AD would require a one-time general visual inspection of the left-hand (LH) and right-hand (RH) MLG retraction actuators and replacement if necessary. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 11, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88–6280–350; fax +31 (0)88–6280–111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); internet <http://www.myfokkerfleet.com>.

You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://>