

the manufacturer, this AD does not include that requirement.

#### (m) Other FAA AD Provisions

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (n)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (i) and paragraph (l) of this AD: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (n) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2015-0152R1, dated May 23, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0417.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3225.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200

South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on May 11, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-11134 Filed 5-24-18; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2018-0449; Product Identifier 2018-NM-042-AD]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc., Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model DHC-8-400 series airplanes. This proposed AD was prompted by a report of uncommanded deployment of the ground spoilers when the power levers were advanced for takeoff, which was caused by faulty switches in the power lever module. This proposed AD would require revising the maintenance or inspection program, as applicable. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by July 9, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax*: 202-493-2251.
- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email

[thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0449; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** John P. DeLuca, Aerospace Engineer, Avionics and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7369; fax 516-794-5531; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0449; Product Identifier 2018-NM-042-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

#### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2017-35, dated November 29, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc., Model

DHC-8-400 series airplanes. The MCAI states:

There has been an incident of uncommanded deployment of the ground spoilers when the power levers were advanced for take-off. The warning horn sounded and the pilot rejected the take-off. The subsequent investigation determined the root cause of the spoiler deployment was faulty switches in the power lever module. An uncommanded deployment of the ground spoilers may lead to a runway excursion.

This [Canadian] AD mandates the incorporation of a new Certification Maintenance Requirement (CMR) task to check the ground spoiler switches in the power lever module.

Required actions include revising the maintenance or inspection program, as applicable. You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0449.

#### Related Service Information Under 14 CFR Part 51

Bombardier has issued Q400 Dash 8 (Bombardier) Temporary Revision ALI-0173, dated March 14, 2017, to Section 1-27, Certification Maintenance Requirements of the Maintenance Requirements Manual (MRM) Part 2, of Product Support Manual (PSM) 1-84-7. This service information describes CMR Task 276000-110, "Operational Check of the Ground Spoiler Switches in the Power Lever Module." This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

We estimate that this proposed AD affects 86 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

We have determined that revising the maintenance or inspection program takes an average of 90 work-hours per operator, although we recognize that

this number may vary from operator to operator. In the past, we have estimated that this action takes 1 work-hour per airplane. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), we have determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, we estimate the total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour).

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA-2018-0449; Product Identifier 2018-NM-042-AD.

#### (a) Comments Due Date

We must receive comments by July 9, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc., Model DHC-8-400, -401, and -402 airplanes, certificated in any category, serial numbers 4001 and subsequent.

#### (d) Subject

Air Transport Association (ATA) of America Code 27, Flight controls.

#### (e) Reason

This AD was prompted by a report of uncommanded deployment of the ground spoilers when the power levers were advanced for takeoff, which was caused by faulty switches in the power lever module. We are issuing this AD to address faulty switches in the power lever module, which could result in uncommanded deployment of the ground spoilers and a possible runway excursion.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Revision of Maintenance or Inspection Program

Within 30 days after the effective date of this AD: Revise the maintenance or inspection program, as applicable, to incorporate the information specified in Certification Maintenance Requirements

(CMR) Task 276000–110 of Q400 Dash 8 (Bombardier) Temporary Revision ALI–0173, dated March 14, 2017, to Section 1–27, Certification Maintenance Requirements of the Maintenance Requirements Manual (MRM) Part 2, of Product Support Manual (PSM) 1–84–7.

#### (h) Initial Compliance Time

The initial compliance time for doing the CMR Task 276000–110 specified in paragraph (g) of this AD is within 8,000 flight hours after the effective date of this AD.

#### (i) No Alternative Actions or Intervals

After the maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections) or intervals may be used unless the actions or intervals are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j)(1) of this AD.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2017–35, dated November 29, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0449.

(2) For more information about this AD, contact John P. DeLuca, Aerospace Engineer, Avionics and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7369; fax 516–794–5531; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series

Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416–375–4000; fax 416–375–4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St, Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on May 15, 2018.

**Dionne Palermo,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–11141 Filed 5–24–18; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF EDUCATION

### 34 CFR Parts 600 and 668

[Docket ID ED–2018–OPE–0041]

RIN 1840–AD39

#### Program Integrity and Improvement

**AGENCY:** Office of Postsecondary Education, Department of Education.

**ACTION:** Notice of proposed rulemaking.

**SUMMARY:** The Secretary proposes to delay, until July 1, 2020, the effective date of the final regulations entitled Program Integrity and Improvement published in the **Federal Register** on December 19, 2016 (the final regulations). The current effective date of the final regulations is July 1, 2018. The Secretary proposes the delay based on concerns recently raised by regulated parties and to ensure that there is adequate time to conduct negotiated rulemaking to reconsider the final regulations, and as necessary, develop revised regulations. The provisions for which the effective date is being delayed are listed in the **SUPPLEMENTARY INFORMATION** section of this document.

**DATES:** We must receive your comments on or before June 11, 2018. As previously indicated, we are establishing a 15-day public comment period for the proposed delay in effective date. We are doing so because the 2016 rule is scheduled to take effect on July 1, 2018, and a final rule delaying the effective date must be published prior to that date. A longer comment period would not allow sufficient time for the Department to review and respond to comments, and publish a final rule.

**ADDRESSES:** Submit your comments through the Federal eRulemaking Portal or via postal mail, commercial delivery, or hand delivery. We will not accept comments submitted by fax or by email

or those submitted after the comment period. To ensure that we do not receive duplicate copies, please submit your comments only once. In addition, please include the Docket ID at the top of your comments.

• *Federal eRulemaking Portal:* Go to [www.regulations.gov](http://www.regulations.gov) to submit your comments electronically. Information on using *Regulations.gov*, including instructions for accessing agency documents, submitting comments, and viewing the docket, is available on the site under “Help.”

• *Postal Mail, Commercial Delivery, or Hand Delivery:* The Department strongly encourages commenters to submit their comments electronically. However, if you mail or deliver your comments about the notice of proposed rulemaking, address them to Jean-Didier Gaina, U.S. Department of Education, 400 Maryland Ave. SW, Mail Stop 294–20, Washington, DC 20202.

*Privacy Note:* The Department’s policy is to make all comments received from members of the public available for public viewing on the Federal eRulemaking Portal at [www.regulations.gov](http://www.regulations.gov). Therefore, commenters should be careful to include in their comments only information that they wish to make publicly available.

**FOR FURTHER INFORMATION CONTACT:** Sophia McArdle, Ph.D., U.S. Department of Education, 400 Maryland Ave. SW, Mail Stop 290–44, Washington, DC 20202. Telephone: (202) 453–6318. Email: [sophia.mcardle@ed.gov](mailto:sophia.mcardle@ed.gov).

If you use a telecommunications device for the deaf (TDD) or a text telephone (TTY), call the Federal Relay Service (FRS), toll free, at 1–800–877–8339.

#### **SUPPLEMENTARY INFORMATION:**

*Invitation to Comment:* We invite you to submit comments regarding this notice of proposed rulemaking. See **ADDRESSES** for instructions on how to submit comments.

During and after the comment period, you may inspect all public comments about this notice of proposed rulemaking by accessing *Regulations.gov*. You may also inspect the comments in person at 400 Maryland Avenue SW, Washington, DC, between 8:30 a.m. and 4:00 p.m. Washington, DC time, Monday through Friday of each week, except Federal holidays. If you want to schedule time to inspect comments, please contact the person listed under **FOR FURTHER INFORMATION CONTACT**.

*Assistance to Individuals with Disabilities in Reviewing the*