

- a. Removing the words “Deputy Secretary of the Department of Energy” and adding in their place the words “Secretary or his or her designee”.
- b. Removing the words “Deputy Secretary” and adding in their place the words “Secretary or his or her designee”.
- 3. Section 903.2 is amended by:
 - a. Removing paragraph (c).
 - b. Redesignating paragraphs (d) through (n) as paragraphs (c) through (m);
 - c. In newly redesignated paragraph (j), removing the words “Deputy Secretary” and adding in their place the words “Secretary or his or her designee”; and
 - d. Adding a new paragraph (n).

The addition reads as follows:

§ 903.2 Definitions.

* * * * *

(n) *Secretary* means the Secretary of the United States Department of Energy.

* * * * *

§ 903.21 [Amended]

- 4. Section 903.21 is amended by:
 - a. In paragraphs (a) and (b), removing the words “Deputy Secretary’s” and adding in their place the words “Secretary’s or his or her designee’s”.
 - b. In paragraphs (b), (c), and (d), removing the words “Deputy Secretary” and adding in their place the words “Secretary or his or her designee”.

§ 903.22 [Amended]

- 5. Section 903.22(b), (d), and (h) is amended by removing the words “Deputy Secretary” and adding in their place the words “Secretary or his or her designee”.

§ 903.23 [Amended]

- 6. Section 903.23(a)(3) and (b) is amended by removing the words “Deputy Secretary” and adding in their place the words “Secretary or his or her designee”.

[FR Doc. 2019-02805 Filed 2-20-19; 8:45 am]

BILLING CODE 6450-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2018-0385; Product Identifier 2018-CE-019-AD; Amendment 39-19554; AD 2019-03-02]

RIN 2120-AA64

Airworthiness Directives; Pacific Aerospace Limited Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for Pacific Aerospace Limited Model 750XL airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as an incorrect size bolt may have been used to assemble the elevator bellcrank pivot joint. We are issuing this AD to require actions to address the unsafe condition on these products.

DATES: This AD is effective March 28, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of March 28, 2019.

ADDRESSES: You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385; or in person at Docket Operations, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

For service information identified in this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: pacific@aerospace.co.nz; internet: www.aerospace.co.nz.

You may view this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the internet at <http://www.regulations.gov> by searching for Docket No. FAA-2018-0385.

FOR FURTHER INFORMATION CONTACT: Mike Kiesov, Aerospace Engineer, FAA,

Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: mike.kiesov@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to Pacific Aerospace Limited Model 750XL airplanes. The NPRM was published in the **Federal Register** on May 11, 2018 (83 FR 21951). The NPRM proposed to correct an unsafe condition for the specified products and was based on mandatory continuing airworthiness information (MCAI) originated by the Civil Aviation Authority (CAA), which is the aviation authority of New Zealand. The MCAI states:

It is possible that the elevator bellcrank pivot joint could be assembled with a bolt P/N AN4-20 that is a little too short, leaving threads inside the working area of the section of the joint.

The MCAI requires inspecting the elevator bellcrank pivot joint to determine the length of the bolt installed to determine if it is the proper size and taking all necessary corrective actions. The MCAI can be found in the AD docket on the internet at: <https://www.regulations.gov/document?D=FAA-2018-03850-002>.

Incorrectly sized bolts that are too short can cause damage from the threads of the bolt on the internal bore of the cross tube hinge plate, which could result in reduced control.

Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes and changes to clarify the incorporation by reference of the service information. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

We reviewed Pacific Aerospace Limited Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018. The service information describes procedures for inspecting the elevator bellcrank pivot joint to determine if the correct bolt size is installed. If an incorrect size bolt is found, the service bulletin describes procedures for inspecting the cross tube to confirm structural integrity, taking necessary corrective actions, and replacing the incorrect size bolt with a correct sized bolt. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

We estimate that this AD will affect 22 products of U.S. registry. We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this AD on U.S. operators to be \$3,740, or \$170 per product.

In addition, we estimate that any necessary follow-on actions would take about 8 work-hours and require parts costing \$125, for a cost of \$805 per product. We have no way of determining the number of products that may need these actions.

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority

because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes, gliders, balloons, airships, domestic business jet transport airplanes, and associated appliances to the Director of the Policy and Innovation Division.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2019-03-02 Pacific Aerospace Limited:

Amendment 39-19554; Docket No. FAA-2018-0385; Product Identifier 2018-CE-019-AD.

(a) Effective Date

This AD becomes effective March 28, 2019.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Pacific Aerospace Limited Model 750XL airplanes, all serial numbers through 215, certificated in any category.

(d) Subject

Air Transport Association of America (ATA) Code 27: Flight Controls.

(e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. We are issuing this AD to prevent damage from the threads of the bolt on the internal bore of the cross tube hinge plate, which could result in reduced control.

(f) Actions and Compliance

Unless already done, do the following actions in paragraphs (f)(1) and (2) of this AD:

(1) Within the next 150 hours time-in-service after March 28, 2019 (the effective date of this AD) or within the next 12 months after March 28, 2019 (the effective date of this AD), whichever occurs later, inspect the elevator bellcrank pivot joint to determine the length and the part number (P/N) of the bolt installed. Do the inspection using the Inspection Instructions, steps 1 through 3, in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

(2) If you determine bolt, P/N AN4-20, is installed during the inspection required in paragraph (f)(1) of this AD, before further flight, take all necessary corrective actions using the Accomplishment Instructions in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

(g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: mike.kiesov@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must instead be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the Civil Aviation Authority of New Zealand (CAA).

(h) Related Information

Refer to MCAI CAA AD DCA/750XL/28, dated March 22, 2018, for related information. You may examine the MCAI on the internet at: <https://www.regulations.gov/document?D=FAA-2018-0385-0002>.

(i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Pacific Aerospace Limited Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

(ii) [Reserved]

(3) For Pacific Aerospace Limited service information identified in this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: pacific@aerospace.co.nz; internet: www.aerospace.co.nz.

(4) You may view this service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on February 11, 2019.

Melvin J. Johnson,

Aircraft Certification Service, Deputy Director, Policy and Innovation Division, AIR-601.

[FR Doc. 2019-02916 Filed 2-20-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2018-0940; Airspace Docket No. 18-ASW-15]

RIN 2120-AA66

Amendment of Class E Airspace; Carrizo Springs, TX

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action amends Class E airspace extending upward from 700 feet above the surface at Dimmit County Airport, Carrizo Springs, TX. This action is a result of an airspace review caused by the decommissioning of the Dimmit non-directional beacon (NDB) and the cancellation of the associated instrument procedures. The geographic coordinates of the airport are also being updated to coincide with the FAA's aeronautical database.

DATES: Effective 0901 UTC, June 20, 2019. The Director of the Federal Register approves this incorporation by reference action under Title 1 Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.11 and publication of conforming amendments.

ADDRESSES: FAA Order 7400.11C, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at http://www.faa.gov/air_traffic/publications/. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11C at NARA, call (202) 741-6030, or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>. FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

FOR FURTHER INFORMATION CONTACT: John Witucki, Federal Aviation Administration, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5900.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it amends Class E airspace extending upward from 700 feet above the surface at Dimmit County Airport, Carrizo Springs, TX, to support instrument flight rules operations at this airport.

History

The FAA published a notice of proposed rulemaking in the **Federal Register** (83 FR 60380; November 26, 2018) for Docket No. FAA-2018-0940 to amend the Class E airspace extending upward from 700 feet above the surface at Dimmit County Airport, Carrizo Springs, TX. Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received.

Class E airspace designations are published in paragraphs 6005 of FAA Order 7400.11C, dated August 13, 2018, and effective September 15, 2018, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designations listed in this document will be published subsequently in the Order.

Availability and Summary of Documents for Incorporation by Reference

This document amends FAA Order 7400.11C, Airspace Designations and Reporting Points, dated August 13, 2018, and effective September 15, 2018. FAA Order 7400.11C is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11C lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.