

Figure 1 to paragraph (g) of this AD – Service information for modification

Airplane Model/Serial No.	Bombardier Service Information
BD-700-1A10 9002 through 9312 inclusive; 9314 through 9380 inclusive; 9384 through 9429 inclusive	Service Bulletin 700-24-089, Revision 01, dated August 21, 2018
BD-700-1A10 9313, 9381, and 9432 through 9831 inclusive	Service Bulletin 700-24-6014, Revision 01, dated August 21, 2018
BD-700-1A11 9127 through 9383 inclusive; 9389 through 9400 inclusive; 9404 through 9431 inclusive; and 9998	Service Bulletin 700-1A11-24-028, Revision 01, dated August 21, 2018
BD-700-1A11 9386, 9401, and 9445 through 9831 inclusive	Service Bulletin 700-24-5014, Revision 01, dated August 21, 2018

(h) Credit for Previous Actions

(1) This paragraph provides credit for the modification required by paragraph (g) of this AD for airplanes on which the modification specified in Bombardier Service Bulletin 700-24-6014, dated April 25, 2018, was performed before the effective date of this AD using Bombardier Service Request for Product Support Action (SRPSA) 000236314.

(2) This paragraph provides credit for the modification required by paragraph (g) of this AD, if the modification was performed before the effective date of this AD using the service information specified in paragraphs (h)(2)(i) through (h)(2)(iv) of this AD.

(i) Bombardier Service Bulletin 700-24-089, dated April 25, 2018.

(ii) Bombardier Service Bulletin 700-24-6014, dated April 25, 2018.

(iii) Bombardier Service Bulletin 700-1A11-24-028, dated April 25, 2018.

(iv) Bombardier Service Bulletin 700-24-5014, dated April 25, 2018.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your

appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2018-22, dated August 2, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0019.

(2) For more information about this AD, contact Steven Dzierzynski, Aerospace Engineer, Avionics and Electrical Systems Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7367; fax 516-794-5531; email 9-avs-nyacos@faa.gov.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone: 514-855-5000; fax: 514-855-7401; email: thd.crj@aero.bombardier.com; internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on February 1, 2019.

Michael Kaszycki,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-02937 Filed 2-21-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2019-0016; Product Identifier 2018-NM-168-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all Airbus SAS Model A350-941 and -1041 airplanes. This proposed AD was prompted by reports of loss of retention of the regulator inlet filter retainer on certain crew oxygen cylinder assemblies. This proposed AD would require an operational check of the crew oxygen cylinder assembly, replacement of an affected assembly, and eventual replacement of all affected assemblies with redesigned serviceable assemblies.

We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by April 8, 2019.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the incorporation by reference (IBR) material described in the “Related IBR material under 1 CFR part 51”

section in **SUPPLEMENTARY INFORMATION**, contact European Aviation Safety Agency (EASA), Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this

IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <http://www.regulations.gov>.

Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0016; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about

this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2019-0016; Product Identifier 2018-NM-168-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0245R1, dated December 5, 2018 (“EASA AD 2018-0245R1”) (also referred to as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Airbus SAS Model A350-941 and -1041 airplanes. The MCAI states:

Several occurrences were reported of loss of retention of the regulator inlet filter retainer on affected assemblies. The filter retainer detached from the regulator and dropped within the cylinder internal volume. The technical investigation identified a design defect which was the cause of these events.

This condition, if not detected and corrected, could lead to particle ingestion into the regulator during ground handling, possibly resulting in ignition/fire during system ground operational testing following cylinder (re)installation on an aeroplane.

To address this potential unsafe condition, Airbus issued the AOT [Airbus Alert Operators Transmission A35P010-17, dated December 20, 2017] to provide instructions for an operational check (OPC). Airbus also developed an improved oxygen cylinder assembly and issued the SB [Airbus Service Bulletin A350-35-P012, dated July 12, 2018] accordingly, to provide replacement instructions.

For the reasons described above, EASA issued AD 2018-0245 to require a one-time OPC of each affected assembly and, depending on findings, replacement. This [EASA] AD also requires replacement of all affected assemblies with improved serviceable assemblies.

Prompted by operator requests for clarification after that [EASA] AD was issued, this [EASA] AD is revised to introduce a new definition for ‘Groups’ of aeroplanes affected by this [EASA] AD, amending the [EASA] AD accordingly to reflect the intended requirements for each Group.

Related IBR Material Under 1 CFR Part 51

EASA AD 2018-0245R1 describes procedures for an operational check of the crew oxygen cylinder assembly, replacement of an affected assembly, and eventual replacement of all affected assemblies with redesigned serviceable assemblies. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section, and it is publicly available through the EASA website.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Proposed Requirements of This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2018-0245R1 described previously, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. As a result, EASA AD 2018-0245R1 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with the provisions specified in EASA AD 2018-0245R1, except for any differences identified as exceptions in the regulatory text of this proposed AD. Service information specified in EASA AD 2018-0245R1 that is required for compliance with EASA AD 2018-0245R1 will be available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0016 after the FAA final rule is published.

Costs of Compliance

We estimate that this proposed AD affects 11 airplanes of U.S. registry. We

estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
10 work-hours × \$85 per hour = \$850	* \$0	\$850	\$9,350

* We have received no definitive data regarding the parts cost.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all known costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the

distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Airbus SAS: Docket No. FAA–2019–0016; Product Identifier 2018–NM–168–AD.

(a) Comments Due Date

We must receive comments by April 8, 2019.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model A350–941 and –1041 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

(e) Reason

This AD was prompted by reports of loss of retention of the regulator inlet filter retainer on certain crew oxygen cylinder assemblies. We are issuing this AD to address loss of retention of the regulator inlet filter retainer on certain crew oxygen cylinder assemblies. This condition could lead to particle ingestion into the regulator during ground handling, possibly resulting in ignition/fire during system ground operational testing following crew oxygen cylinder (re)installation on an airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2018–0245R1.

(h) Exceptions to EASA AD 2018–0245R1

(1) For purposes of determining compliance with the requirements of this AD: Where EASA AD 2018–0245R1 refers to its effective date, or the effective date of EASA AD 2018–0245, dated November 13, 2018, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2018–0245R1 does not apply to this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2018–0245R1 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal

inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2018-0245R1 that contains RC procedures and tests: Except as required by paragraph (h)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

(1) For information about EASA AD 2018-0245R1, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this EASA AD at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. EASA AD 2018-0245R1 may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0016.

(2) For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

Issued in Des Moines, Washington, on February 1, 2019.

Michael Kaszycki,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2019-02931 Filed 2-21-19; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2019-0022; Product Identifier 2018-NM-162-AD]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737-200, -200C, -300, -400, and -500 airplanes. This proposed AD was prompted by reports of cracking in the lower lobe skin panel assemblies of the fuselage. This proposed AD would require replacement of lower lobe skin panel assemblies, and detailed inspections for scribe lines and applicable on-condition actions. We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by April 8, 2019.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0022.

Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0022; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

James Guo, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5357; fax: 562-627-5210; email: james.guo@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2019-0022; Product Identifier 2018-NM-162-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Fatigue damage can occur locally, in small areas or structural design details, or globally, in widespread areas. Multiple-site damage is widespread damage that occurs in a large structural element such as a single rivet line of a lap splice joining two large skin panels. Widespread damage can also occur in multiple elements such as adjacent frames or stringers. Multiple-site damage and multiple-element damage cracks are typically too small initially to be reliably detected with normal inspection methods. Without intervention, these cracks will grow, and eventually compromise the structural integrity of the airplane. This condition is known as widespread fatigue damage (WFD). It is associated