

**(l) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2018–0254R1, dated June 4, 2019, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0117.

(2) For more information about this AD, contact Todd Thompson, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3228.

**(m) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) 328 Support Services Alert Service Bulletin ASB–328–57–043, dated September 21, 2018.

(ii) [Reserved]

(3) For service information identified in this AD, contact 328 Support Services GmbH, Global Support Center, P.O. Box 1252, D–82231 Wessling, Federal Republic of Germany; telephone +49 8153 88111 6666; fax +49 8153 88111 6565; email [gsc.op@328support.de](mailto:gsc.op@328support.de); internet <http://www.328support.de>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on July 26, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division,  
Aircraft Certification Service.*

[FR Doc. 2019–17504 Filed 8–14–19; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA–2019–0575; Product Identifier 2019–NM–113–AD; Amendment 39–19690; AD 2019–14–12]**

**RIN 2120–AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is adopting an airworthiness directive (AD) for certain The Boeing Company Model 737–8 and 737–9 airplanes. This AD requires a maintenance records check to determine if any main slat track assembly has been removed, an inspection of the main slat track assemblies for a suspect lot number or a lot number that cannot be determined, and applicable on-condition actions. This AD was prompted by a report that certain main slat track assemblies were manufactured incorrectly and are affected by hydrogen embrittlement. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective August 30, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 30, 2019.

The FAA must receive comments on this AD by September 30, 2019.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0575.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0575; or in person at the Docket

Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3529; email: [Greg.Rutar@faa.gov](mailto:Greg.Rutar@faa.gov).

**SUPPLEMENTARY INFORMATION:****Discussion**

The FAA has received a report from Boeing indicating that 148 main slat track assemblies from a set of lot numbers were manufactured incorrectly and are affected by hydrogen embrittlement. Main slat track assemblies that are affected by hydrogen embrittlement have reduced strength. After reviewing information within the report provided from Boeing, the FAA determined on May 22, 2019, that this condition, if not addressed, could result in failure of main slat track assemblies, which could cause the slat to depart and potentially strike the airplane, resulting in injury to airplane occupants and/or preventing continued safe flight and landing.

**Other Relevant Rulemaking**

The FAA issued AD 2019–11–03, Amendment 39–19649 (84 FR 26743, June 10, 2019) (“AD 2019–11–03”), for certain The Boeing Company Model 737–700C, –800, and –900ER series airplanes. The FAA issued AD 2019–11–03 to address main slat track assemblies that have reduced strength due to hydrogen embrittlement. This condition, if not addressed, could result in failure of main slat track assemblies, which could cause the slat to depart and potentially strike the airplane, resulting in injury to airplane occupants and/or preventing continued safe flight and landing.

In the preamble of the final rule issuing AD 2019–11–03, the FAA stated that the identified unsafe condition also exists on Boeing Model 737–8 and 737–9 airplanes. The FAA also stated that Boeing was developing service information that would address the unsafe condition for these airplanes and that the FAA might consider additional rulemaking once that service information was developed, approved, and available. Boeing has since developed such service information and the FAA has determined that further rulemaking is indeed necessary.

**Related Service Information Under 1 CFR Part 51**

The FAA reviewed Boeing Alert Requirements Bulletin 737-27A1311 RB, dated June 24, 2019. This service information describes procedures for a maintenance records check to determine if any main slat track assembly has been removed, an inspection of the main slat track assemblies for a suspect lot number or a lot number that cannot be determined, sending the inspection results to Boeing, and applicable on-condition actions. On-condition actions include replacing main slat track assemblies having a suspect lot number, or having a lot number that cannot be determined, with serviceable main slat track assemblies; shipping main slat track assemblies with suspect lot numbers or with lot numbers that cannot be determined to Boeing; and contacting Boeing to report if any main slat track assembly has been removed. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination**

The FAA is issuing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**AD Requirements**

This AD requires accomplishment of the actions identified in Boeing Alert Requirements Bulletin 737-27A1311 RB, dated June 24, 2019, described previously, except for any differences identified as exceptions in the regulatory text of this AD.

For information on the procedures and compliance times, see this service information at [http://](http://www.regulations.gov)

[www.regulations.gov](http://www.regulations.gov) by searching for and locating Docket No. FAA-2019-0575.

**Justification for Immediate Adoption and Determination of the Effective Date**

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C.) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those procedures are “impracticable, unnecessary, or contrary to the public interest.” Under this section, an agency, upon finding good cause, may issue a final rule without seeking comment prior to the rulemaking. Similarly, Section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

The discrepant parts are “rotable” in that they could be removed from the 737-8 and 737-9 airplanes that are the subject of this AD, and installed on 737 Next Gen (Boeing Model 737-600/-700/-800/-900) airplanes. The current shortage of nondiscrepant parts makes this removal and reinstallation more likely to happen. Also, these parts are not serialized, and have been marked in a manner that has proven to be impermanent. Thus, if a discrepant part were to be removed from a 737-8 or 737-9 airplane and installed on a 737 Next Gen airplane before all of the discrepant parts have been identified, it could expose the entire 737 Next Gen fleet to the unsafe condition, and likely require fleetwide inspections to find the discrepant parts.

The FAA therefore considers the prompt identification and removal of these parts from 737-8 and 737-9 airplanes to be an urgent safety issue. Accordingly, notice and opportunity for prior public comment are impracticable and contrary to the public interest pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the reasons stated above,

the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

**Regulatory Flexibility Act (RFA)**

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

**Comments Invited**

This AD is a final rule that involves requirements affecting flight safety and was not preceded by notice and an opportunity for public comment. However, the FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under the **ADDRESSES** section. Include the docket number FAA-2019-0575 and Product Identifier 2019-NM-113-AD at the beginning of your comments. The FAA specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this final rule. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

The FAA will post all comments the agency receives, without change, to <http://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact the agency receives about this final rule.

**Costs of Compliance**

The FAA estimates that this AD affects 33 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Maintenance records check ....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85	\$2,805
Inspection .....	3 work-hours × \$85 per hour = \$255 .....	0	255	8,415
Reporting .....	1 work-hour × \$85 per hour = \$85 .....	0	85	2,805

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of the inspection. The FAA has no way of determining the number

of aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replacement and shipping ....	Up to 54 work-hours × \$85 per hour = Up to \$4,590 .....	Up to \$82,680 .....	Up to \$87,270.

According to the manufacturer, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all available known costs in the cost estimate.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120–0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW, Washington, DC 20591. ATTN: Information Collection Clearance Officer, AES–200.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs” describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2019–14–12 The Boeing Company:**  
 Amendment 39–19690; Docket No. FAA–2019–0575; Product Identifier 2019–NM–113–AD.

**(a) Effective Date**

This AD is effective August 30, 2019.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 737–8 and 737–9 airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight Controls.

**(e) Unsafe Condition**

This AD was prompted by a report that certain main slat track assemblies were manufactured incorrectly and are affected by hydrogen embrittlement. The FAA is issuing this AD to address main slat track assemblies that have reduced strength due to hydrogen embrittlement. This condition, if not addressed, could result in failure of main slat track assemblies, which could cause the slat to depart and potentially strike the airplane, resulting in injury to airplane occupants and/or preventing continued safe flight and landing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 737–27A1311, dated June 24, 2019, which is referred to in Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019.

**(h) Exceptions to Service Information Specifications**

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019, uses the phrase “the original issue date of requirements bulletin 737–27A1311 RB,” this AD requires using “the effective date of this AD.”

(2) Boeing Alert Requirements Bulletin 737–27A1311 RB, dated June 24, 2019, specifies to report inspection results to Boeing within a certain compliance time. For this AD, the compliance time to report inspection results is at the applicable time

specified in paragraph (h)(2)(i) or (h)(2)(ii) of this AD.

(i) If the inspection was done on or after the effective date of this AD: Submit the report within 3 days after the inspection.

(ii) If the inspection was done before the effective date of this AD: Submit the report within 3 days after the effective date of this AD.

(3) Boeing Alert Requirements Bulletin 737-27A1311 RB, dated June 24, 2019, specifies to ship affected parts to Boeing within a certain compliance time if, during the inspection, it has been determined that any main slat track assembly has a suspect lot number or has a lot number that cannot be determined. For this AD, the compliance time for shipping affected parts to Boeing is at the applicable time specified in paragraph (h)(3)(i) or (h)(3)(ii) of this AD.

(i) If the inspection was done on or after the effective date of this AD: Ship the affected part to Boeing within 30 days after removing the affected part.

(ii) If the inspection was done before the effective date of this AD: Ship the affected part to Boeing within 30 days after the effective date of this AD.

#### (i) Paperwork Reduction Act Burden Statement

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW, Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

#### (j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this

AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

#### (k) Related Information

For more information about this AD, contact Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3529; email: [Greg.Rutar@faa.gov](mailto:Greg.Rutar@faa.gov).

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Requirements Bulletin 737-27A1311 RB, dated June 24, 2019.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on July 23, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019-17508 Filed 8-14-19; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2019-0186; Product Identifier 2018-NM-153-AD; Amendment 39-19694; AD 2019-15-01]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc., Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Bombardier, Inc., Model CL-600-2B16 (601-3A, 601-3R, and 604 Variants) airplanes. This AD was prompted by a report that main landing gear (MLG) side stay actuators have been assembled using nonconforming split ball bearings. This AD requires verification of the serial numbers of the installed MLG side stay actuator assemblies, and replacement of the affected parts. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective September 19, 2019.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of September 19, 2019.

**ADDRESSES:** For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; fax 514-855-7401; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0186.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0186; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule,