

Jardim Esplanada, CEP 12242-431—São José dos Campos—SP, Brazil; telephone 55 (12) 3203-6600; email [pac@anac.gov.br](mailto:pac@anac.gov.br); internet [www.anac.gov.br/en/](http://www.anac.gov.br/en/). You may find this IBR material on the ANAC website at <https://sistemas.anac.gov.br/certificacao/DA/DAE.asp>. You may view this material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0975.

(2) For more information about this AD, contact Krista Greer, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3221.

Issued in Des Moines, Washington, on December 5, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019-27062 Filed 12-16-19; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2019-0984; Product Identifier 2019-NM-161-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2018-16-05, which applies to all The Boeing Company Model 757-200, -200PF, -200CB, and -300 series airplanes. AD 2018-16-05 requires repetitive inspections for skin cracking and shim migration at the upper link drag fittings, diagonal brace cracking, and fastener looseness; and applicable on-condition actions. Since the FAA issued AD 2018-16-05, an operator reported finding multiple cracks in the drag fitting at fastener holes while inspecting for cracking as required by AD 2018-16-05. This proposed AD would retain the actions required by AD 2018-16-05, reduce the compliance times for certain inspections, and add repetitive inspections at certain fastener hole locations and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by January 31, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0984.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0984; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Chandra Ramdoss, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5239; fax: 562-627-5210; email: [chandraduth.ramdoss@faa.gov](mailto:chandraduth.ramdoss@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed

under the **ADDRESSES** section. Include “Docket No. FAA-2019-0984; Product Identifier 2019-NM-161-AD” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

The FAA will post all comments, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact the agency receives about this proposed AD.

#### Discussion

The FAA issued AD 2018-16-05, Amendment 39-19345 (83 FR 38250, August 6, 2018) (“AD 2018-16-05”), for all The Boeing Company Model 757-200, -200PF, -200CB, and -300 series airplanes. AD 2018-16-05 requires repetitive inspections for skin cracking and shim migration at the upper link drag fittings, diagonal brace cracking, and fastener looseness; and applicable on-condition actions. AD 2018-16-05 resulted from reports of bolt rotation in the engine drag fitting joint and fastener heads; an inspection of the fastener holes revealed that cracks were found in the skin on two airplanes. The FAA issued AD 2018-16-05 to address cracking in the wing upper skin and forward drag fittings, which could lead to a compromised upper link and reduced structural integrity of the engine strut.

#### Actions Since AD 2018-16-05 Was Issued

Since the FAA issued AD 2018-16-05, an operator reported finding multiple cracks in the drag fitting at the fastener holes while inspecting for cracking as required by AD 2018-16-05. Subsequent analysis determined that additional repetitive open-hole high frequency eddy current (HFEC) inspections for cracking are necessary at the forward rows of fastener holes. Based on findings, it was also determined that more frequent inspections for cracking in the diagonal brace and diagonal brace fittings are necessary.

#### Related Service Information Under 14 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 757-57A0073 RB, Revision 1, dated August 1, 2019. This service information describes procedures for repetitive inspections,

including general visual, detailed, and HFEC inspections, for loose fasteners, skin cracking, and shim migration at the upper link drag fittings and for cracking in the diagonal brace and diagonal brace fittings and applicable on-condition actions. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination

The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2018–16–05, this proposed AD would

retain all of the requirements of AD 2018–16–05. Those requirements are referenced in the service information identified previously, which, in turn, is referenced in paragraph (g) of this proposed AD. This proposed AD would also require accomplishment of the actions identified in the Accomplishment Instructions of Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019, described previously.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0984.

#### Explanation of Requirements Bulletin

The FAA worked in conjunction with industry, under the Airworthiness Directive Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement is a process for annotating

which steps in the service information are “required for compliance” (RC) with an AD. Boeing has implemented this RC concept into Boeing service bulletins.

In an effort to further improve the quality of ADs and AD-related Boeing service information, a joint process improvement initiative was worked between the FAA and Boeing. The initiative resulted in the development of a new process in which the service information more clearly identifies the actions needed to address the unsafe condition in the “Accomplishment Instructions.” The new process results in a Boeing Requirements Bulletin, which contains only the actions needed to address the unsafe condition (*i.e.*, only the RC actions).

#### Costs of Compliance

The FAA estimates that this proposed AD affects 561 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Repetitive inspections (retained actions from AD 2018–16–05).	83 work-hours × \$85 per hour = \$7,055 per inspection cycle.	\$0	\$7,055 per inspection cycle.	\$3,957,855 per inspection cycle.
Repetitive HFEC inspections (new proposed action).	2 work-hours × \$85 per hour = \$170 per inspection cycle.	0	\$170 per inspection cycle.	\$95,370 per inspection cycle.

The FAA has received no definitive data that would enable the FAA to provide cost estimates for the on-condition actions specified in this proposed AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by

the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

#### Regulatory Findings

The FAA has determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative,

on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing Airworthiness Directive (AD) 2018–16–05, Amendment 39–19345 (83 FR 38250, August 6, 2018), and adding the following new AD:

**The Boeing Company:** Docket No. FAA–2019–0984; Product Identifier 2019–NM–161–AD.

**(a) Comments Due Date**

The FAA must receive comments on this AD action by January 31, 2020.

**(b) Affected ADs**

This AD replaces AD 2018–16–05, Amendment 39–19345 (83 FR 38250, August 6, 2018) (“AD 2018–16–05”).

**(c) Applicability**

This AD applies to all The Boeing Company Model 757–200, –200PF, –200CB, and –300 series airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 57, Wings.

**(e) Unsafe Condition**

This AD was prompted by reports of bolt rotation in the engine drag fitting joint and fastener heads; an inspection of the fastener holes revealed that cracks were found in the skin. This AD was also prompted by a report of multiple cracks found in the drag fitting at fastener holes during inspections required by AD 2018–16–05. The FAA is issuing this AD to address cracking in the wing upper skin and forward drag fittings, which could lead to a compromised upper link and reduced structural integrity of the engine strut.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019.

*Note 1 to paragraph (g):* Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 757–57A0073, Revision 1, dated August 1, 2019, which is referred to in Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019.

**(h) Exceptions to Service Information Specifications**

(1) Where Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019, uses the phrase “the Revision 1 date of Requirements Bulletin 757–57A0073 RB” this AD requires using “the effective date of this AD.”

(2) Where Boeing Alert Requirements Bulletin 757–57A0073 RB, Revision 1, dated August 1, 2019, specifies contacting Boeing for repair instructions: This AD requires doing the repair and applicable on-condition actions before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: *9-ANM-LAACO-AMOC-Requests@faa.gov*.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved previously for AD 2018–16–05 are not approved as AMOCs for this AD.

**(j) Related Information**

(1) For more information about this AD, contact Chandra Ramdoss, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5239; fax: 562–627–5210; email: *chandraduth.ramdoss@faa.gov*.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet *https://www.myboeingfleet.com*. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on December 5, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019–27061 Filed 12–16–19; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2019–0976; Product Identifier 2019–NM–177–AD]

RIN 2120–AA64

**Airworthiness Directives; Embraer S.A. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Embraer S.A. Model ERJ 190–100 STD, –100 LR, –100 ECJ, –100 IGW, –200 STD, –200 LR, and –200 IGW airplanes. This proposed AD was prompted by a report of erroneous indications of certain engine parameters and reports of “pitch up” and “pitch down” uncommanded attitudes with autopilot engaged in cruise flight. This proposed AD would require installing updated PRIMUS EPIC LOAD software, as specified in an Agência Nacional de Aviação Civil (ANAC) Brazilian AD, which will be incorporated by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by January 31, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *https://www.regulations.gov*. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material identified in this proposed AD that will be incorporated by reference (IBR), contact National Civil Aviation Agency, Aeronautical Products Certification Branch (GGCP), Rua Laurent Martins, n° 209, Jardim Esplanada, CEP 12242–431—São José dos Campos—SP, Brazil; telephone 55 (12) 3203–6600; email *pac@anac.gov.br*; internet *www.anac.gov.br/en/*. You may find this IBR material on the ANAC website at *https://sistemas.anac.gov.br/*