

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2020-03-24 Dassault Aviation:

Amendment 39-19848; Docket No. FAA-2019-0872; Product Identifier 2019-NM-156-AD.

(a) Effective Date

This AD is effective April 2, 2020.

(b) Affected ADs

This AD affects AD 2010-26-05, Amendment 39-16544 (75 FR 79952, December 21, 2010) (“AD 2010-26-05”).

(c) Applicability

This AD applies to Dassault Aviation Model MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes, certificated in any category, on which the Supplemental Structural Inspection Program (SSIP) (Dassault Service Bulletin 730) has been embodied into the airplane’s existing maintenance or inspection program.

(d) Subject

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

(e) Reason

This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The FAA is issuing this AD to address fatigue cracking, damage, and corrosion in principal structural elements, which could result in reduced structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Maintenance or Inspection Program Revision

Within 90 days after the effective date of this AD, revise the existing maintenance or inspection program, as applicable, to incorporate the information specified in Chapter 5-40-01, Airworthiness Limitations, of the Dassault Falcon 20 Retrofit 731 Maintenance Manual, Revision 10, dated January 1, 2019. The initial compliance time

for doing the tasks is at the time specified in Chapter 5-40-01, Airworthiness Limitations, of the Dassault Falcon 20 Retrofit 731 Maintenance Manual, Revision 10, dated January 1, 2019, or within 90 days after the effective date of this AD, whichever occurs later.

(h) No Alternative Actions or Intervals

After the existing maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections) or intervals may be used unless the actions or intervals are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j)(1) of this AD.

(i) Terminating Action for Certain Requirements of AD 2010-26-05

Accomplishing the actions required by this AD terminates the requirements of paragraph (g)(1) of AD 2010-26-05 only for Model MYSTERE-FALCON 20-C5, 20-D5, 20-E5, and 20-F5 airplanes on which the SSIP has been embodied into the airplane’s existing maintenance or inspection program.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Union Aviation Safety Agency (EASA); or Dassault Aviation’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2019-0201, dated August 20, 2019, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0872.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226; email Tom.Rodriguez@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Chapter 5-40-01, Airworthiness Limitations, of the Dassault Falcon 20 Retrofit 731 Maintenance Manual, Revision 10, dated January 1, 2019.

(ii) [Reserved]

(3) For service information identified in this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on February 14, 2020.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-03936 Filed 2-26-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2019-0871; Product Identifier 2019-NM-139-AD; Amendment 39-19846; AD 2020-03-22]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain The Boeing Company Model 787-8 airplanes. This AD was prompted by a report of fatigue cracking at certain frame tie rod locations of the wing. This AD requires repetitive inspections for cracking of the left- and right-side frame tie rod assemblies and stub beam upper chords, and applicable on-condition actions. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective April 2, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publications listed in this AD as of April 2, 2020.

ADDRESSES: For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0871.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0871; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3529; email: greg.rutar@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 787-8 airplanes. The NPRM published in the **Federal Register** on November 19, 2019 (84 FR 63825). The NPRM was prompted by a report of fatigue cracking at certain frame tie rod locations of the wing. The NPRM proposed to require repetitive inspections for cracking of the left- and right-side frame tie rod assemblies and stub beam upper chords, and applicable on-condition actions.

The FAA is issuing this AD to address cracking in the frame tie rod assemblies and consequent failure of a principal structural element to sustain limit load, which could adversely affect the structural integrity of the airplane and result in possible decompression of the airplane.

Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA has considered the comment received. Boeing indicated its support for the NPRM.

Conclusion

The FAA reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019. The service information describes procedures for repetitive high frequency eddy current (HFEC) inspections for cracking of the left- and right-side frame tie rod assemblies, repetitive ultrasonic (UT) inspections for cracking of the left- and right-side stub beam upper chords, and applicable on-condition actions. On-condition actions include repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 55 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspections	19 work-hours × \$85 per hour = \$1,615 per inspection cycle.	\$0	\$1,615 per inspection cycle.	\$88,825 per inspection cycle.

The FAA has received no definitive data that enables the agency to provide cost estimates for the on-condition actions specified in this AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under

that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national

government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2020-03-22 The Boeing Company:

Amendment 39-19846 ; Docket No. FAA-2019-0871; Product Identifier 2019-NM-139-AD.

(a) Effective Date

This AD is effective April 2, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 787-8 airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report of fatigue cracking at certain frame tie rod locations of the wing. The FAA is issuing this AD to address cracking in the frame tie rod assemblies and consequent failure of a principal structural element to sustain limit load, which could adversely affect the structural integrity of the airplane and result in possible decompression of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019.

Note 1 to paragraph (g) of this AD: Guidance for accomplishing the actions

required by this AD can be found in Boeing Alert Service Bulletin B787-81205-SB570041-00, Issue 001, dated March 7, 2019, which is referred to in Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019.

(h) Exceptions to Service Information Specifications

(1) For purposes of determining compliance with the requirements of this AD: Where Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019, uses the phrase "the issue 001 date of Requirements Bulletin B787-81205-SB570041-00 RB," this AD requires using the effective date of this AD.

(2) Where Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019, specifies contacting Boeing for repair instructions: This AD requires doing the repair and applicable on-condition actions before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

For more information about this AD, contact Greg Rutar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3529; email: greg.rutar@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Requirements Bulletin B787-81205-SB570041-00 RB, Issue 001, dated March 7, 2019.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on February 14, 2020.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-03964 Filed 2-26-20; 8:45 am]

BILLING CODE 4910-13-P

EQUAL EMPLOYMENT OPPORTUNITY COMMISSION**29 CFR Part 1601**

[3046-AB14]

2019 Adjustment of the Penalty for Violation of Notice Posting Requirements; Correction

AGENCY: Equal Employment Opportunity Commission.

ACTION: Final rule; correction and correcting amendment.

SUMMARY: The EEOC is correcting the RIN Number of its item titled "2019 Adjustment of the Penalty for Violation of Notice Posting Requirements," and adding to the authority citation to identify the statutory authority for the EEOC to make adjustments to the penalty for violating notice posting requirements.

DATES: Effective February 27, 2020.

FOR FURTHER INFORMATION CONTACT: Raymond L. Peeler, Assistant Legal Counsel, at (202) 663-4537 or John Gwynn, Attorney-Advisor, at (202) 663-4177. Requests for this notice in an alternative format should be made to the Office of Communications and Legislative Affairs at (202) 663-4191 (voice), 1-800-669-6820 (TTY), 1-844-234-5122 (ALS Video Phone), or the Publications Information Center at 1-800-669-3362 (toll free).