

supplies as have been manufactured in the United States or in any eligible country, substantially all from articles, materials, or supplies mined, produced, or manufactured, as the case may be, in the United States or in any eligible country. For purposes of this section, an “eligible country” is any country that applies with respect to the United States an agreement ensuring reciprocal access for United States products and services and United States suppliers to the markets of that country, as determined by the United States Trade Representative. The Buy American regulations may be found at, and any requests for waiver must be submitted pursuant to, 7 CFR part 1787.

■ 5. Amend § 1739.15 as follows:

■ a. In paragraph (d) introductory text, after the text “in accordance with 7 CFR part 1970” add the text “and as supplemented by 7 CFR 1738.108”;

■ b. Redesignate paragraph (l) as paragraph (m);

■ c. In newly redesignated paragraph (m)(8), after the text “in accordance with 7 CFR part 1970” add the text “and as supplemented by 7 CFR 1738.108”; and

■ d. Add a new paragraph (l).

The addition reads as follows:

**§ 1739.15 Completed application.**

\* \* \* \* \*

(l) *Public notice.* The Agency will publish a public notice of each application requesting assistance under this part. The application must provide a summary of the information required for such public notice. The information required can be found in 7 CFR 1738.106.

\* \* \* \* \*

■ 6. Amend § 1739.19 by adding paragraph (f) to read as follows:

**§ 1739.19 Reporting and oversight requirements.**

\* \* \* \* \*

(f) Entities that receive assistance from the Agency under this part to provide retail broadband service must submit annual reports for 3 years after project completion. The information required can be found in 7 CFR 1738.107(a) and (c).

**Chad Rupe,**

*Administrator, Rural Utilities Service.*

[FR Doc. 2020-04086 Filed 3-11-20; 8:45 am]

**BILLING CODE P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2019-0713; Product Identifier 2019-NM-116-AD; Amendment 39-19855; AD 2020-04-18]

**RIN 2120-AA64**

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Airbus SAS Model A330-941 airplanes. This AD was prompted by reports indicating premature aging of certain chemical oxygen generators. This AD requires repetitively removing the affected chemical oxygen generators and replacing them with serviceable parts, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective April 16, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of April 16, 2020.

**ADDRESSES:** For the material incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0713.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0713; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any

comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:**

Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email [vladimir.ulyanov@faa.gov](mailto:vladimir.ulyanov@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Discussion**

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019-0140, dated June 12, 2019 (“EASA AD 2019-0140”) (also referred to as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Airbus SAS Model A330-941 airplanes.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Airbus SAS Model A330-941 airplanes. The NPRM published in the *Federal Register* on October 9, 2019 (84 FR 54046). The NPRM was prompted by reports indicating premature aging of certain chemical oxygen generators. The NPRM proposed to require repetitively removing the affected chemical oxygen generators and replacing them with serviceable parts.

The FAA is issuing this AD to address premature aging of chemical oxygen generators. This condition, if not corrected, could lead to the generator failing to deliver oxygen during an emergency, possibly resulting in injury to airplane occupants. See the MCAI for additional background information.

**Comments**

The FAA gave the public the opportunity to participate in developing this final rule. The following presents the comments received on the NPRM and the FAA’s response to each comment.

**Support for the NPRM**

The Air Line Pilots Association, International, expressed support for the NPRM.

**Request To Revise the Proposed AD To Apply to All Affected Components Regardless of Airplane Model**

Delta Air Lines (DAL) requested that the proposed AD be revised to be applicable to all B/E Aerospace oxygen generators having part number 117042-XX, regardless of the airplanes on which

they are installed. DAL observed that three previous ADs, AD 2016–16–02, Amendment 39–18600 (81 FR 53255, August 12, 2016) (“AD 2016–16–02”), AD 2016–03–07, Amendment 39–18394 (81 FR 12405, March 9, 2016) (“AD 2016–03–07”), and AD 2016–10–13, Amendment 39–18524 (81 FR 33359, May 26, 2016) (“AD 2016–10–13”), affecting three different airplane models have been issued against these B/E Aerospace oxygen generators, which are used across multiple fleets, and that the same safety risk exists on all aircraft platforms on which it is installed.

The FAA disagrees with the request to revise this AD as indicated. A component AD would require any operator with B/E Aerospace oxygen generators installed on its airplanes to inspect the entire fleet to determine if an affected part number is installed. By limiting the applicability of this AD to the airplane model on which the affected part numbers are known to be

installed, the burden on operators is reduced.

When the unsafe condition results from the installation of a particular component or appliance on an aircraft, and the aircraft model is known, the AD action is issued against the aircraft. The unsafe condition has been identified on B/E Aerospace oxygen generators installed on the Airbus SAS airplane models identified in AD 2016–16–02, AD 2016–03–07, and AD 2016–10–13. The FAA is issuing this AD because the agency has determined that the unsafe condition also exists on Airbus SAS Model A330–941 airplanes. The FAA has not changed this AD in this regard.

**Conclusion**

The FAA reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

**Related IBR Material Under 1 CFR Part 51**

EASA AD 2019–0140 describes procedures for repetitively removing the affected chemical oxygen generators and replacing them with serviceable parts. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**Costs of Compliance**

The FAA estimates that this AD affects 2 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS \***

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
3 work-hours × \$85 per hour = \$255 .....	\$390	\$645	\$1,290

\* Costs given are for replacement of one chemical oxygen generator for each repetitive replacement. The number of affected generators depends on airplane configuration and cannot be estimated properly.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the

distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2020–04–18 Airbus SAS:** Amendment 39–19855; Docket No. FAA–2019–0713; Product Identifier 2019–NM–116–AD.

**(a) Effective Date**

This AD is effective April 16, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Airbus SAS Model A330–941 airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 35, Oxygen.

**(e) Reason**

This AD was prompted by reports indicating premature aging of certain chemical oxygen generators. The FAA is issuing this AD to address premature aging of chemical oxygen generators. This condition, if not corrected, could lead to the generator failing to deliver oxygen during an emergency, possibly resulting in injury to airplane occupants.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2019-0140, dated June 12, 2019 (“EASA AD 2019-0140”).

**(h) Exceptions to EASA AD 2019-0140**

(1) Where EASA AD 2019-0140 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2019-0140 does not apply to this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2019-0140 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Related Information**

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and

fax 206-231-3229; email [vladimir.ulyanov@faa.gov](mailto:vladimir.ulyanov@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2019-0140, dated June 12, 2019.

(ii) [Reserved]

(3) For information about EASA AD 2019-0140, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); Internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0713.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on February 27, 2020.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020-04998 Filed 3-11-20; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2019-1053; Product Identifier 2018-SW-037-AD; Amendment 39-19863; AD 2020-05-11]**

**RIN 2120-AA64**

**Airworthiness Directives; Robinson Helicopter Company Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for Robinson Helicopter Company Model R44 and R44 II helicopters with an agricultural spray system installed by Supplemental Type Certificate (STC) SR00286BO (spray system). This spray system is also known as a Simplex

Manufacturing Company (Simplex) Model 244 spray system. This AD was prompted by a report of an in-flight failure of the spray system elbow pump fitting (pump fitting). This AD requires repetitive inspections of the spray system pump fitting, corrective action if necessary, replacement of the spray system pump fitting, and installation of hose supports and a pump outlet cover. The FAA is issuing this AD to address the unsafe condition on these products. **DATES:** This AD is effective April 16, 2020.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of April 16, 2020.

**ADDRESSES:** For service information identified in this final rule, contact Simplex Manufacturing Company, 13340 NE Whitaker Way, Portland, OR 97230; phone 503-257-3511; fax 503-257-8556; internet [www.simplex.aero](http://www.simplex.aero). You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call 817-222-5110. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-1053.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-1053; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any service information that is incorporated by reference, any comments received, and other information. The address for Docket Operations is Docket Operations, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:**

Chris Bonar, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3521; email: [Christopher.Bonar@faa.gov](mailto:Christopher.Bonar@faa.gov).

**SUPPLEMENTARY INFORMATION:****Discussion**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would