

easier to understand? If so, what changes to the format would make the regulation easier to understand? What else could we do to make the regulation easier to understand?

List of Subjects

12 CFR Part 217

Administrative practice and procedure, Banks, Banking, Federal Reserve System, Holding companies, Reporting and recordkeeping requirements, Securities.

Authority and Issuance

For the reasons stated in the preamble, the Board of Governors of the Federal Reserve System amends 12 CFR chapter II as follows:

PART 217—CAPITAL ADEQUACY OF BANK HOLDING COMPANIES, SAVINGS AND LOAN HOLDING COMPANIES, AND STATE MEMBER BANKS (REGULATION Q)

■ 1. The authority citation for part 217 continues to read as follows:

Authority: 12 U.S.C. 248(a), 321–338a, 481–486, 1462a, 1467a, 1818, 1828, 1831n, 1831o, 1831p–1, 1831w, 1835, 1844(b), 1851, 3904, 3906–3909, 4808, 5365, 5368, 5371 and 5371 note.

Subpart G—Transition Provisions

■ 2. Add § 217.303 to read as follows:

§ 217.303 Temporary exclusions from total leverage exposure.

(a) *In general.* Subject to the limitations in paragraphs (b) and (c) of this section and notwithstanding any other requirement in this part, a Board-regulated institution that is a depository institution holding company or a U.S. intermediate holding company, when calculating on-balance sheet assets as of each day of a reporting quarter for purposes of determining the Board-regulated institution's total leverage exposure under § 217.10(c)(4), must exclude the balance sheet carrying value of the following items:

- (1) U.S. Treasury securities; and
- (2) Funds on deposit at a Federal Reserve Bank.

(b) *Termination of exclusions.* The exclusions required pursuant to paragraph (a) of this section terminate after the calendar quarter ending on March 31, 2021.

(c) *Custodial banking organizations.* A custodial banking organization that is a depository institution holding company or a U.S. intermediate holding company must reduce the amount in § 217.10(c)(4)(ii)(j)(1) (to no less than zero) by any amount excluded under paragraph (a)(2) of this section.

(d) *Disclosure.* Notwithstanding Table 13 to § 217.173, a Board-regulated institution that is a depository institution holding company or a U.S. intermediate holding company that is required to make the disclosures pursuant to § 217.173 must exclude the items excluded pursuant to paragraph (a) of this section from Table 13 to § 217.173.

By order of the Board of Governors of the Federal Reserve System.

Ann Misback,

Secretary of the Board.

[FR Doc. 2020–07345 Filed 4–13–20; 8:45 am]

BILLING CODE 6210–01–P

FARM CREDIT ADMINISTRATION

12 CFR Parts 600 and 604

RIN 3052–AD17

Organization and Functions; Farm Credit Administration Board Meetings

AGENCY: Farm Credit Administration.

ACTION: Notification of effective date.

SUMMARY: The Farm Credit Administration (FCA), on February 5, 2020, issued a final rule amending its regulations to reflect changes in FCA's organizational structure and to correct the mailing address for the McLean office. In accordance the law, the effective date of the rule is no earlier than 30 days from the date of publication in the **Federal Register** during which either or both Houses of Congress are in session.

DATES: The regulation amending 12 CFR part 600 and 604 published on February 5, 2020 (85 FR 6421) is effective April 1, 2020.

FOR FURTHER INFORMATION CONTACT:

Technical information: Paul K. Gibbs, Associate Director, Office of Regulatory Policy, (703) 883–4203, TTY (703) 883–4056, gibbsp@fca.gov.

Legal information: Autumn R. Agans, Senior Attorney, Office of General Counsel, (703) 883–4020, TTY (703) 883–4056, agansa@fca.gov.

SUPPLEMENTARY INFORMATION: On November 5, 2019, the FCA Board approved an organizational chart that created the Office of Data Analytics and Economics. Further, a street address has been added to 12 CFR 604.425(a) and 604.440, which list the address of the FCA Board.

In accordance with 12 U.S.C. 2252(c)(1), the effective date of the rule is no earlier than 30 days from the date of publication in the **Federal Register** during which either or both Houses of Congress are in session. Based on the

records of the sessions of Congress, the effective date of the regulations is April 1, 2020.

Dated: April 2, 2020.

Dale Aultman,

Secretary, Farm Credit Administration Board.

[FR Doc. 2020–07321 Filed 4–13–20; 8:45 am]

BILLING CODE 6705–01–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2019–0760; Project Identifier 2019–NE–18–AD; Amendment 39–21108; AD 2020–08–02]

RIN 2120–AA64

Airworthiness Directives; Thales AVS France SAS Global Positioning System/Satellite Based Augmentation System Receivers

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Thales AVS France SAS (Thales) Global Positioning System/Satellite Based Augmentation System (GPS/SBAS) receivers installed on airplanes and helicopters. This AD was prompted by reports that Thales GPS/SBAS receivers provided, under certain conditions, erroneous outputs on aircraft positions. This AD requires the installation of a software update to the aircraft navigation database and insertion of a change to the applicable airplane flight manual (AFM). The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective May 19, 2020.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of May 19, 2020.

ADDRESSES: For service information identified in this final rule, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1–800–Winged-S or 203–416–4299; email: wcs_cust_service_eng.gr-sik@lmco.com; Thales AVS France SAS, 75–77 Avenue Marcel Dassault, 33700 Mérignac—France, Tel: +33 (0)5 24 44 77 40, www.thalesgroup.com; or ATR—GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email

continued.airworthiness@atr-aircraft.com. You may view this service information at the FAA, Engine and Propeller Standards Branch, 1200 District Avenue, Burlington, MA, 01803. For information on the availability of this material at the FAA, call 781-238-7759. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0760.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0760; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC, 20590.

FOR FURTHER INFORMATION CONTACT: Kirk Gustafson, Aerospace Engineer, Boston ACO Branch, FAA, 1200 District Avenue, Burlington, MA, 01803; phone: 781-238-7190; fax: 781-238-7199; email: kirk.gustafson@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Thales GPS/SBAS receivers installed on airplanes and helicopters. The NPRM published in the **Federal Register** on January 31, 2020 (85 FR 5584). The NPRM was prompted by reports that Thales GPS/SBAS receivers provided, under certain conditions, erroneous outputs on aircraft positions. The NPRM proposed

to require the installation of a software update to the aircraft navigation database and insertion of a change to the applicable AFM. The FAA is issuing this AD to address the unsafe condition on these products.

The European Union Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA AD 2019-0004, dated January 11, 2019, corrected on January 17, 2019 (referred to after this as “the MCAI”), to address the unsafe condition on these products. The MCAI states:

It has been determined that, in SBAS areas, in specific conditions of the GPS satellite constellation in line of sight to the aircraft, the Thales Topstar 200 LPV GPS/SBAS receiver may provide an erroneous position on its outputs, which may not be detected by the integrity check. Depending on the aircraft installation, this error may not be noticed by the flight crew.

This condition, if not corrected, could possibly compromise the safety margins when the receiver is used for Localizer Performance with Vertical guidance (LPV) and/or RNP-AR (Required Navigation Performance—Authorization Required) operations.

For the reasons described above, this [EASA] AD requires removal from the navigation database of LPV procedures and all RNP-AR procedures in SBAS areas, listed in the SIL. To ensure a reset of all the GPS computations which may contribute to the erroneous GPS position output, this [EASA] AD also requires, for certain ATR aeroplanes (see Note 1 of this [EASA] AD), amendment of the applicable AFM.

You may obtain further information by examining the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0760.

Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

The FAA reviewed the relevant data and determined that air safety and the public interest require adopting this final rule as proposed.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Task 31-61-00-800-802, “2. FMS Database Update for Multifunction Display (MFD)” of the Sikorsky Aircraft Corporation, Aircraft Maintenance Manual (AMM) SA S76D-AMM-000, 31-61-00, dated November 30, 2017. This Task provides instructions for updating the MFD on affected Sikorsky aircraft.

The FAA also reviewed ATR72 AMM Job Instruction Cards, Doc. No. 45-11-00 LDG 10030-004, dated June 1, 2018, and ATR42-400/500 Series AMM Job Instruction Cards, Doc. No. 45-11-00 LDG 10030-004, dated July 1, 2018. These service documents provide instructions on updating the navigation databases installed on affected ATR airplanes.

The FAA also reviewed Thales Service Information Letter (SIL) Doc. No. THAV/SIL-1308, Issue 7, dated September 28, 2018. The SIL describes procedures to upload navigational database using Thales PMAT software on affected ATR airplanes.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 45 Thales GPS/SBAS receivers installed on, but not limited to, GIE Avions de Transport Régional model ATR42 airplanes and Sikorsky Aircraft Corporation model S-76D helicopters of U.S. registry.

The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Update navigation database for GPS/SBAS receiver.	1 work-hour × \$85 per hour = \$85	\$0	\$85	\$3,825
Update AFM	3 work-hours × \$85 per hour = \$255	0	255	11,475

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII:

Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section

44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds

necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2020–08–02 Thales AVS France SAS:
Amendment 39–21108; Docket No. FAA–2019–0760; Project Identifier 2019–NE–18–AD.

(a) Effective Date

This AD is effective May 19, 2020.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Thales AVS France SAS (Thales) Global Positioning System/Satellite Based Augmentation System (GPS/SBAS) receivers, Topstar 200 LPV, part numbers (P/Ns) C17149JA02 and C17149HA01. These GPS/SBAS receivers are installed on, but not limited to, ATR–GIE Avions de Transport Régional (ATR) model ATR42 and ATR72 airplanes and Sikorsky Aircraft Corporation model S–76D helicopters, respectively.

(d) Subject

Joint Aircraft System Component (JASC) Code 3457, Global Positioning System.

(e) Unsafe Condition

This AD was prompted by reports that Thales GPS/SBAS receivers provided, under certain conditions, erroneous outputs on aircraft positions. The FAA is issuing this AD to prevent erroneous aircraft position outputs from the Thales GPS/SBAS receivers. The unsafe condition, if not addressed, could result in controlled flight into terrain and loss of the aircraft.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

- (1) For operators of affected ATR model ATR42 and ATR72 airplanes:
 - (i) Update the aircraft’s navigation database within 30 days after the effective date of this AD using the software upload instructions, as applicable, in the following:
 - (A) ATR72 Aircraft Maintenance Manual (AMM) Job Instruction Cards, Doc. No. 45–11–00 LDG 10030–004, dated June 1, 2018.
 - (B) ATR42–400/500 Series AMM Job Instruction Cards, Doc. No. 45–11–00 LDG 10030–004, dated July 1, 2018.
 - (C) Thales Service Information Letter (SIL) Doc. No. THAV/SIL–1308, Issue 7, dated September 28, 2018.
 - (ii) [Reserved]
 - (2) For operators of affected ATR model ATR42 and ATR72 airplanes:
 - (i) Within 30 days after the effective date of this AD, amend Section 1.2 “Each Flight Checks” of the pre-flight section in the applicable airplane flight manual by inserting the change shown in Figure 1 and Figure 2 to paragraph (g)(2)(i) of this AD.

Figure 1 to Paragraph (g)(2)(i) – Reset Instructions for 1 GPS Receiver Installed

- ▶ DATA/INIT/POS INIT page..... DISPLAY
- ▶ GPS POS key..... SELECT
- ▶ C/B NAV/COM/SURV GPS 1..... PULL
- After 10 s
 - ▶ C/B NAV/COM/SURV GPS 1..... PUSH
 - ▶ SENSOR INIT< key..... SELECT

Figure 2 to Paragraph (g)(2)(i) – Reset Instructions for 2 GPS Receivers Installed

- ▶ DATA/INIT/POS INIT page..... DISPLAY
- ▶ GPS POS key..... SELECT
- ▶ C/B NAV/COM/SURV GPS 1..... PULL
- ▶ C/B NAV/COM/SURV GPS 2..... PULL
- **After 10 s**
 - ▶ C/B NAV/COM/SURV GPS 1..... PUSH
 - ▶ C/B NAV/COM/SURV GPS 2..... PUSH
 - ▶ SENSOR INIT< key..... SELECT

(ii) Before each flight, power cycle the Thales GPS/SBAS receiver unit.

(3) For operators of Sikorsky S-76D helicopters, within 30 days after the effective date of this AD, update the aircraft's navigation database using the instructions in TASK 31-61-00-800-802, "2. FMS Database Update for Multifunction Display (MFD)" of the Sikorsky Aircraft Corporation, AMM SA S76D-AMM-000, 31-61-00, dated November 30, 2017.

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Boston ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the Boston ACO Branch, send it to the attention of the person identified in paragraph (i)(1) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(i) Related Information

(1) For more information about this AD, contact Kirk Gustafson, Aerospace Engineer, Boston ACO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: 781-238-7190; fax: 781-238-7199; email: kirk.gustafson@faa.gov.

(2) Refer to European Union Aviation Safety Agency (EASA) AD 2019-0004, dated January 11, 2019 (corrected on January 17, 2019), for more information. You may examine the EASA AD in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0760.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Sikorsky Aircraft Corporation, Aircraft Maintenance Manual (AMM) SA S76D-

AMM-000, 31-61-00, dated November 30, 2017.

(ii) ATR72 AMM Job Instruction Cards, Doc. No. 45-11-00 LDG 10030-004, dated June 1, 2018.

(iii) ATR42-400/500 Series AMM Job Instruction Cards, Doc. No. 45-11-00 LDG 10030-004, dated July 1, 2018.

(iv) Thales Service Information Letter Doc. No. THAV/SIL-1308, Issue 7, dated September 28, 2018.

(3) For Sikorsky Aircraft Corporation service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1-800-Winged-S or 203-416-4299; email: wcs_cust_service_eng.gr-sik@lmco.com.

(4) For Thales service information identified in this AD, contact Thales AVS France SAS, 75-77 Avenue Marcel Dassault, 33700 Mérignac—France, Tel: +33 (0)5 24 44 77 40, www.thalesgroup.com.

(5) For ATR service information identified in this AD, contact ATR-GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email continued.airworthiness@atr-aircraft.com.

(6) You may view this service information at FAA, Engine & Propeller Standards Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781-238-7759.

(7) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on April 8, 2020.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2020-07746 Filed 4-13-20; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2020-0363; Product Identifier 2018-SW-010-AD; Amendment 39-19894; AD 2020-07-15]

RIN 2120-AA64

Airworthiness Directives; PZL Świdnik S.A. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all PZL Świdnik S.A. Model PZL W-3A helicopters. This AD was prompted by a report of a cracked nose landing gear (NLG) bellcrank assembly. This AD requires a one-time inspection of the NLG bellcrank assembly for discrepancies and replacement if necessary. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD becomes effective April 29, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of April 29, 2020.

The FAA must receive comments on this AD by May 29, 2020.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.