

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, Israeli AD ISR-I-53-19-10-5.

**(h) Exceptions and Clarifications to Israeli AD ISR-I-53-19-10-5**

(1) Where Israeli AD ISR-I-53-19-10-5 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where Israeli AD ISR-I-53-19-10-5 requires operators to “check . . . clearance between fuel probes and forward fuel tank structure,” this AD requires measuring the specified probes’ distance to the adjacent skin.

(3) Where Israeli AD ISR-I-53-19-10-5 requires operators to “adjust clearance” for the corrective action, this AD requires reinstallation of the probe at the correct distance.

(4) Israeli AD ISR-I-53-19-10-5 requires compliance “at the next suitable planned maintenance inspection within the next 36 months.” This AD requires compliance within 36 months after the effective date of this AD.

(5) The rework (reinstallation of the fuel probes at the correct distance) required for inadequate clearance must be done before further flight after the measurement.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or the CAAI; or CAAI’s authorized Designee. If approved by the CAAI Designee, the approval must include the Designee’s authorized signature.

**(j) Related Information**

For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, Large Aircraft Section, International

Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226; email [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) The Civil Aviation Authority of Israel (CAAI) AD ISR-I-53-19-10-5, dated October 10, 2019.

(ii) [Reserved]

(3) For information about Israeli AD ISR-I-53-19-10-5, contact the CAAI, P.O. Box 1101, Golan Street, Airport City, 70100, Israel; telephone 972-3-9774665; fax 972-3-9774592; email [aip@mot.gov.il](mailto:aip@mot.gov.il). You may find this IBR material on the CAAI website at [www.caa.gov.il](http://www.caa.gov.il).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0334.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on July 7, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020-15819 Filed 7-22-20; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2020-0578; Project Identifier MCAI-2020-00889-T; Amendment 39-21162; AD 2020-14-08]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Airbus SAS Model A318 series airplanes, Model A319 series airplanes, Model A320 series airplanes, and Model

A321 series airplanes. This AD was prompted by reports of main landing gear (MLG) torque link apex pin rupture in service. This AD requires replacement of certain MLG torque link apex pins and, for certain other pins, a one-time magnetic particle inspection (MPI) for cracking, and replacement if necessary, as specified in a European Union Aviation Safety Agency (EASA) AD 2020-0130, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD becomes effective August 7, 2020.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 7, 2020.

The FAA must receive comments on this AD by September 8, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For EASA material incorporated by reference (IBR) in this AD, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0578.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0578; or in person at Docket Operations

between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Discussion**

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0130, dated June 8, 2020 ("EASA AD 2020-0130") (also referred to as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes; A320-211, -212, -214, -215, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes; and A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N and -272NX airplanes. Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This AD was prompted by reports of MLG torque link apex pin rupture in service. The FAA is issuing this AD to address MLG torque link apex pin rupture, which could lead to disconnection of MLG torque links, possibly resulting in reduced braking efficiency and/or increased risk of tire burst during take-off or landing. See the MCAI for additional background information.

**Related IBR Material Under 1 CFR Part 51**

EASA AD 2020-0130 describes procedures for replacement of certain MLG torque link apex pins with serviceable parts and, for certain other pins, a one-time MPI for cracking and, depending on the findings, replacement with a serviceable part. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA's Determination**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD because the FAA evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

**Requirements of This AD**

This AD requires accomplishing the actions specified in EASA AD 2020-0130 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

**Explanation of Required Compliance Information**

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2020-0130 is incorporated by reference in this final rule. This AD, therefore, requires compliance with EASA AD 2020-0130 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA AD 2020-0130 that is required for compliance with EASA AD 2020-0130 is available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0578.

**Clarification of Parts Installation Limitation**

The intent of the "Parts Installation Limitation" specified in paragraph (j) of this AD is that operators replace parts with good parts rather than bad parts. Although the word "install" is generally

considered to be broader than the word "replace," for purposes of this AD it should be interpreted as meaning "replace" while remaining within the spirit and intent of the AD. Therefore, simply reinstalling the same part during maintenance activities is acceptable for compliance with the requirements specified in paragraph (j) of this AD for that reinstallation.

**Justification For Immediate Adoption and Determination of the Effective Date**

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for "good cause," finds that those procedures are "impracticable, unnecessary, or contrary to the public interest." Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

An unsafe condition exists that requires the immediate adoption of this AD without providing an opportunity for public comments prior to adoption. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because the MLG torque link apex pin rupture could lead to disconnection of MLG torque links, possibly resulting in reduced braking efficiency and/or increased risk of tire burst during take-off or landing. In addition, the compliance time for the required action is shorter than the time necessary for the public to comment and for publication of the final rule. Therefore this rule must be issued immediately, to ensure the safety of the flightcrews conducting such flights. Accordingly, notice and opportunity for prior public comment are impracticable and contrary to the public interest pursuant to 5 U.S.C. 553(b)(3)(B).

In addition, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days, for the same reasons the FAA found good cause.

**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-0578; Project Identifier MCAI-2020-00889-T" at the beginning of your comments. The most helpful comments reference a specific portion of

the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this AD based on those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments the FAA receives, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact the FAA receives about this AD.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner.

Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax

206–231–3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Regulatory Flexibility Act (RFA)**

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

**Costs of Compliance**

The FAA estimates that this AD affects 1,630 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
12 work-hours × \$85 per hour = \$1,020 .....	\$0	\$1,020	Up to \$1,662,600.

The FAA has received no definitive data that would enable us to provide cost estimates for the inspection and repair specified in paragraph (h)(5) of this AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and

the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2020–14–08 Airbus SAS:** Amendment 39–21162; Docket No. FAA–2020–0578; Project Identifier MCAI–2020–00889–T.

**(a) Effective Date**

This AD becomes effective August 7, 2020.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Airbus SAS airplanes specified in paragraphs (c)(1) through (4) of this AD, certificated in any category.

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, –133, –151N, –153N, and –171N airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, –233, –251N, –252N, –253N, –271N, –272N, and –273N airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, –251NX, –252N, –252NX, –253N, –253NX, –271N, –271NX, –272N, and –272NX airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 32, Landing Gear.

**(e) Reason**

This AD was prompted by reports of main landing gear (MLG) torque link apex pin rupture in service. The FAA is issuing this AD to address MLG torque link apex pin rupture, which could lead to disconnection of MLG torque links, possibly resulting in reduced braking efficiency and/or increased risk of tire burst during take-off or landing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and

compliance times specified in, and in accordance with, EASA AD 2020–0130.

**(h) Exceptions to EASA AD 2020–0130**

(1) Where EASA AD 2020–0130 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020–0130 does not apply to this AD.

(3) Where paragraph (3) of EASA AD 2020–0130 specifies a parts installation limitation, for this AD, comply with paragraph (j) of this AD.

(4) Where EASA AD 2020–0130 specifies to comply with “the instructions of the AOT,” this AD requires compliance with the procedures marked as “RC” (required for compliance) in the Alert Operators Transmission (AOT).

(5) Where step 3.B.(3) of the service information specified in EASA AD 2020–0130 states to do an inspection of the component interfaces and the adjacent area, if any damage (not in the correct condition) is found by the inspection, this AD requires repair using a method approved in accordance with the procedures specified in paragraph (k)(2) of this AD.

(6) The table header on the first page of Appendix 4 of the service information specified in EASA AD 2020–0130 is not aligned with the proper columns. The left-hand column is the part number of the affected MLG torque link apex pin, the center column is the serial number, and the right-hand column is the airplane’s manufacturer serial number.

**(i) No Reporting or Returning Parts Requirements**

Although the service information referenced in EASA AD 2020–0130 specifies to submit certain information and return affected parts to the manufacturer, this AD does not include those requirements.

**(j) Parts Installation Limitation**

As of the effective date of this AD, no person may install an affected part as defined in EASA AD 2020–0130 on any airplane unless that part meets the criteria of a serviceable part as specified in EASA AD 2020–0130.

**(k) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (l) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For service information that contains steps that are labeled as “RC” (required for compliance), the provisions of paragraphs (k)(3)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(l) Related Information**

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov).

**(m) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020–0130, dated June 8, 2020.

(ii) [Reserved]

(3) For information about EASA AD 2020–0130, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0578.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on July 2, 2020.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020–15816 Filed 7–22–20; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 71**

**[Docket No. FAA–2020–0350; Airspace Docket No. 18–AAL–2]**

**RIN 2120–AA66**

**Amendment of Class E Airspace; Kotzebue, AK**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies Class E airspace, designated as a surface area, at Ralph Wein Memorial Airport. This action also modifies the Class E airspace extending upward from 700 feet above the surface. Additionally, this action modifies the Class E airspace extending upward from 1,200 feet above the surface. Further, this action removes the Kotzebue VOR/DME from the airspace legal descriptions. Lastly, this action implements several administrative corrections to the airspace legal descriptions.

**DATES:** Effective 0901 UTC, November 5, 2020. The Director of the Federal Register approves this incorporation by reference action under Title 1 Code of Federal Regulations part 51, subject to the annual revision of FAA Order 7400.11 and publication of conforming amendments.

**ADDRESSES:** FAA Order 7400.11D, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [https://www.faa.gov/air\\_traffic/publications/](https://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267–8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11D at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov) or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

**FOR FURTHER INFORMATION CONTACT:** Matthew Van Der Wal, Federal Aviation Administration, Western Service Center,