

34282) is missing, perform a spot fluorescent penetrant inspection of the outer fuel manifold, part number (P/N) 2403M46G01, SIN 34302, using Accomplishment Instructions, paragraph 3.B.(4)(b), of GE GENx-1B SB 73-0080 R01, dated August 29, 2019.

(i) If a crack or a sign of fuel leakage is found, before further flight, remove the outer fuel manifold, P/N 2403M46G01, SIN 34302, from service and replace with a part eligible for installation.

(ii) [Reserved]

(3) Within 500 FCs after the effective date of this AD, and thereafter at intervals not to exceed 500 FCs from the last p-clamp replacement, replace the p-clamp (SIN 34282) with a new p-clamp (SIN 34282). Complete this required action after performing the visual inspections required by paragraphs (g)(1) and (g)(1)(i) of this AD.

#### (h) Definition

For the purpose of this AD, a p-clamp is a clamp, P/N J1432P12, with SIN 34282, located at the signal fuel tube hose, SIN 34200, as shown in Accomplishment Instructions, paragraph 3, Figure 1, "Outer Fuel Manifold and Clamp Location," of GE GENx-1B SB 73-0080 R01, dated August 29, 2019.

#### (i) No Repair Requirement

Sending a removed outer fuel manifold for repair, as set forth in the Accomplishment Instructions, paragraph 3.B.(4)(b), of GE GENx-1B SB 73-0080 R01, dated August 29, 2019, is not required by this AD.

#### (j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in Related Information. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

#### (k) Related Information

For more information about this AD, contact Mehdi Lamnyi, Aviation Safety Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: (781) 238-7743; fax: (781) 238-7199; email: [Mehdi.Lamnyi@faa.gov](mailto:Mehdi.Lamnyi@faa.gov).

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) General Electric Company (GE) GENx-1B Service Bulletin 73-0080 R01, dated August 29, 2019.

(ii) [Reserved]

(3) For GE service information identified in this AD, contact General Electric Company, 1 Neumann Way, Cincinnati, OH 45215; phone: (513) 552-3272; email: [aviation.fleetsupport@ae.ge.com](mailto:aviation.fleetsupport@ae.ge.com); website: [www.ge.com](http://www.ge.com).

(4) You may view this service information at FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (781) 238-7759.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on January 8, 2021.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021-03571 Filed 2-22-21; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2020-1110; Project Identifier MCAI-2020-01003-T; Amendment 39-21426; AD 2021-04-05]

**RIN 2120-AA64**

#### **Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is superseding Airworthiness Directive (AD) 2019-23-15, which applied to certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. AD 2019-23-15 required revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. This AD requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The FAA is issuing this AD

to address the unsafe condition on these products.

**DATES:** This AD is effective March 30, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of March 30, 2021.

**ADDRESSES:** For service information identified in this final rule, contact Airbus Canada Limited Partnership, 13100 Henri-Fabre Boulevard, Mirabel, Québec, J7N 3C6, Canada; telephone 450-476-7676; email [a220\\_crc@abc.airbus](mailto:a220_crc@abc.airbus); internet <http://a220world.airbus.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1110.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1110; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Andrea Jimenez, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7330; fax: 516-794-5531; email: [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2020-25, dated July 16, 2020 (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain Airbus Canada Limited Partnership Model BD-500-1A10 and BD-500-1A11 airplanes. You may examine the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for

and locating Docket No. FAA–2020–1110.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to supersede AD 2019–23–15, Amendment 39–19809 (84 FR 67830, December 12, 2019) (AD 2019–23–15). AD 2019–23–15 applied to certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. The NPRM published in the **Federal Register** on December 7, 2020 (85 FR 78805). The NPRM was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The NPRM proposed to require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA is issuing this AD to address reduced structural integrity of the airplane or reduced controllability of the airplane. See the MCAI for additional background information.

#### Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA has considered the comment received. The Air Line Pilots Association, International (ALPA) stated that it supports the NPRM.

#### Conclusion

The FAA reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

#### Related Service Information Under 14 CFR Part 51

Airbus Canada Limited Partnership has issued A220 Airworthiness Limitations BD500–3AB48–11400–02, Issue 011.00, dated June 18, 2020. This service information describes airworthiness limitations for fuel tank systems, safe life limits, and certification maintenance requirements. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### Costs of Compliance

The FAA estimates that this AD affects 11 airplanes of U.S. registry. The

FAA estimates the following costs to comply with this AD:

The FAA has determined that revising the maintenance or inspection program takes an average of 90 work-hours per operator, although the agency recognizes that this number may vary from operator to operator. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), the FAA has determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, the agency estimates the average total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour).

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
  - a. Removing Airworthiness Directive (AD) 2019–23–15, Amendment 39–19809 (84 FR 67830, December 12, 2019), and
  - b. Adding the following new AD:

**2021–04–05 Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.):** Amendment 39–21426; Docket No. FAA–2020–1110; Project Identifier MCAI–2020–01003–T.

#### (a) Effective Date

This airworthiness directive (AD) is effective March 30, 2021.

#### (b) Affected ADs

This AD replaces AD 2019–23–15, Amendment 39–19809 (84 FR 67830, December 12, 2019).

#### (c) Applicability

This AD applies to the Airbus Canada Limited Partnership (type certificate previously held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Model BD–500–1A10 and BD–500–1A11 airplanes, certificated in any category, identified in paragraphs (c)(1) and (2) of this AD.

(1) Model BD–500–1A10 airplanes, serial numbers 50001 and subsequent with an original airworthiness certificate or original export certificate of airworthiness issued on or before June 18, 2020.

(2) Model BD–500–1A11 airplanes, serial numbers 55001 and subsequent with an original airworthiness certificate or original export certificate of airworthiness issued on or before June 18, 2020.

#### (d) Subject

Air Transport Association (ATA) of America Code 05, Time Limits/Maintenance Checks.

#### (e) Reason

This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. The FAA is issuing this AD to address reduced structural integrity of the airplane or reduced controllability of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

**(g) New Maintenance or Inspection Program Revision**

Within 90 days after the effective date of this AD, revise the existing maintenance or inspection program, as applicable, to incorporate the information specified in Airbus Canada Limited Partnership A220 Airworthiness Limitations, BD500-3AB48-11400-02, Issue 011.00, dated June 18, 2020. The initial compliance time for doing the tasks is at the time specified in Airbus Canada Limited Partnership A220 Airworthiness Limitations, BD500-3AB48-11400-02, Issue 011.00, dated June 18, 2020, or within 90 days after the effective date of this AD, whichever occurs later.

**(h) New No Alternative Actions, Intervals, or Critical Design Configuration Control Limitations (CDCCLs)**

After the existing maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections), intervals, or CDCCLs may be used unless the actions, intervals, and CDCCLs are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (i)(1) of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Airbus Canada Limited Partnership's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2020-25, dated July 16, 2020, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-1110.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue,

Suite 410, Westbury, NY 11590; telephone: 516-228-7330; fax: 516-794-5531; email: [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Canada Limited Partnership A220 Airworthiness Limitations, BD500-3AB48-11400-02, Issue 011.00, dated June 18, 2020.

(ii) [Reserved]

(3) For service information identified in this AD, contact Airbus Canada Limited Partnership, 13100 Henri-Fabre Boulevard, Mirabel, Québec, J7N 3C6, Canada; telephone 450-476-7676; email [a220\\_crc@abc.airbus](mailto:a220_crc@abc.airbus); internet <http://a220world.airbus.com>.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fedreg.legal@nara.gov](mailto:fedreg.legal@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on February 4, 2021.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021-03578 Filed 2-22-21; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2020-0892; Airspace Docket No. 20-AWP-40]

RIN 2120-AA66

**Revocation and Amendment of Class E airspace; Bucholz Army Airfield Kwajalein Atoll, Republic of the Marshall Islands**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action removes the Class E airspace designated as an extension to the Class D airspace and amends the Class E airspace extending upward from 700 and 1200 feet AGL at Bucholz AAF, Kwajalein Atoll, Republic of the Marshall Islands. The Class E airspace

extending upward from 700 feet is amended to ensure it does not extend beyond 12 nautical miles from the outer shoreline of the Atoll into international airspace.

**DATES:** Effective 0901 UTC, April 22, 2021. The Director of the Federal Register approves this incorporation by reference action under Title 1 Code of Federal Regulations part 51, subject to the annual revision of FAA Order 7400.11 and publication of conforming amendments.

**ADDRESSES:** FAA Order 7400.11E, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [https://www.faa.gov/air\\_traffic/publications/](https://www.faa.gov/air_traffic/publications/). For further information, contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA).

For information on the availability of FAA Order 7400.11E at NARA, email: [federal.legal@nara.gov](mailto:federal.legal@nara.gov), or go to <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

**FOR FURTHER INFORMATION CONTACT:** Christopher McMullin, Rules and Regulations Group, Office of Policy, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

**SUPPLEMENTARY INFORMATION:****Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would modify the route structure as necessary to preserve the safe and efficient flow of air traffic within the National Airspace System.

**History**

The FAA published a notice of proposed rulemaking for Docket No. FAA-2020-0892 in the **Federal Register** (85 FR 67317; October 22, 2020) removing the Class E airspace