

# Proposed Rules

Federal Register

Vol. 86, No. 107

Monday, June 7, 2021

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2021-0376; Project Identifier AD-2021-00062-T]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 747-100, -100B, -100B SUD, -200B, -200C, -200F, -300, -400, -400D, -400F, 747SR, and 747SP airplanes. This proposed AD was prompted by reports of cracks found in the front spar shear tie and at the intercostal lug fitting at certain locations. This proposed AD would require repetitive detailed and surface high frequency eddy current (HFEC) inspections of the front spar shear tie and intercostal lug fitting at certain locations for any cracking, and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by July 22, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0376.

#### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0376; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:** Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3964; email: [Stefanie.N.Roesli@faa.gov](mailto:Stefanie.N.Roesli@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0376; Project Identifier AD-2021-00062-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any

personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206 231 3964; email: [Stefanie.N.Roesli@faa.gov](mailto:Stefanie.N.Roesli@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

The FAA has received reports indicating cracks were found in the station (STA) 1000 front spar shear tie at the left and right side buttock line (BL) 11.33, BL 33.99, BL 57.50, and BL 75.92, and in the intercostal lug fitting at the left and right side BL 11.33. The cause of the cracks in the front spar shear tie was fatigue at the holes of the system standoff brackets and front spar shear tie radius details. In addition, the cracks on the longitudinal lug fitting were caused by fatigue at the radius between the lug and the fitting base.

This condition, if not addressed, could result in the loss of limit load capability in a principal structural element, the potential inability to restrain the cargo for certain cargo configurations, and the potential for a center fuel tank rupture for certain cargo configurations under limit load conditions, which could adversely affect the structural integrity of the airplane.

**FAA’s Determination**

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

**Related Service Information Under 1 CFR Part 51**

The FAA reviewed Boeing Alert Requirements Bulletin 747–53A2904 RB, dated December 16, 2020. This service information specifies procedures for repetitive detailed and surface HFEC inspections of the STA 1000 front spar shear tie at the left and right side BL 11.33, BL 33.99, BL 57.50, and BL 75.92,

and of the intercostal lug fitting at the left and right side BL 11.33, for any cracking, and applicable on-condition actions. On-condition actions include repair, installing a new front spar shear tie, and installing a new intercostal lug fitting. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in

the service information already described except for any differences identified as exceptions in the regulatory text of this proposed AD. For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0376.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 117 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspections .....	Up to 314 work-hours × \$85 per hour = Up to \$26,690 .....	\$0	Up to \$26,690 .....	Up to \$3,122,730.

The FAA estimates the following costs to do any necessary installations and repairs that would be required

based on the results of the proposed inspection. The agency has no way of determining the number of aircraft that

might need these installations and repairs:

**ON-CONDITION COSTS**

Action	Labor cost	Parts cost	Cost per product
Installations .....	Up to 368 work-hour × \$85 per hour = Up to \$31,280.	Up to \$38,446 (for shear ties and intercostal lug fittings).	Up to \$69,726.

The FAA has received no definitive data on which to base the cost estimates for the repairs specified in this proposed AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**The Boeing Company:** Docket No. FAA–2021–0376; Project Identifier AD–2021–00062–T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by July 22, 2021.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all The Boeing Company Model 747–100, –100B, –100B SUD, –200B, –200C, –200F, –300, –400, –400D, –400F, 747SR, and 747SP airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by reports of cracks in the station (STA) 1000 front spar shear tie at the left and right side buttock line (BL) 11.33, BL 33.99, BL 57.50, and BL 75.92, and in the intercostal lug fitting at the left and right side BL 11.33. The FAA is issuing this AD to address any cracking in these areas that could result in the loss of limit load capability in a principal structural element, the potential inability to restrain the cargo for certain cargo configurations, and the potential for a center fuel tank rupture for certain cargo configurations under limit load conditions, which could adversely affect the structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 747-53A2904 RB, dated December 16, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 747-53A2904 RB, dated December 16, 2020.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 747-53A2904, dated December 16, 2020, which is referred to in Boeing Alert Requirements Bulletin 747-53A2904 RB, dated December 16, 2020.

**(h) Exceptions to Service Information Specifications**

(1) Where Boeing Alert Requirements Bulletin 747-53A2904 RB, dated December 16, 2020, uses the phrase "the original issue date of Requirements Bulletin 747-53A2904 RB," this AD requires using "the effective date of this AD."

(2) Where Boeing Alert Requirements Bulletin 747-53A2904 RB, dated December 16, 2020, specifies contacting Boeing for repair instructions: This AD requires doing the repair using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in Related Information. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector,

or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(j) Related Information**

(1) For more information about this AD, contact Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3964; email: [Stefanie.N.Roesli@faa.gov](mailto:Stefanie.N.Roesli@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on May 18, 2021.

**Lance T. Gant,**

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-11844 Filed 6-4-21; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2021-0450; Project Identifier 2017-SW-100-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Helicopters Deutschland GmbH (AHD) Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for Airbus Helicopters Deutschland GmbH (AHD) Model MBB-BK 117 D-2 helicopters. This proposed AD was prompted by the discovery that certain parts that are approved for installation on multiple helicopter models are life limited parts when installed on Model MBB-BK 117 D-2 helicopters and some helicopter delivery documents excluded

the life limit information. This proposed AD would require determining the total hours time-in-service (TIS) of a certain part-numbered rotor mast nut and re-identifying a certain part-numbered rotor mast nut. This proposed AD would also require establishing a life limit for a certain part-numbered rotor mast nut and helical gear support, and removing each part from service before reaching its life limit. Additionally, this proposed AD would require replacing a certain part-numbered main gearbox (MGB) with a not affected MGB as specified in a European Aviation Safety Agency (now European Union Aviation Safety Agency) (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by July 22, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that is proposed for IBR in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0450.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0450; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other