

“*Workout Loan*” means a loan to a borrower in financial difficulty that has been formally restructured so as to be reasonably assured of repayment (of principal and interest) and of performance according to its restructured terms. A workout loan typically involves a *re-aging*, *extension*, *deferral*, *renewal*, or *rewrite* of a loan.¹⁷ For purposes of this policy statement, workouts do not include loans made to market rates and terms such as refinances, borrower retention actions, or new loans.¹⁸

“*Extension*” means extending monthly payments on a closed-end loan and rolling back the maturity by the number of months extended. The account is shown current upon granting the extension. If extension fees are assessed, they must be collected at the time of the extension and not added to the balance of the loan.

“*Deferral*” means deferring a contractually due payment on a closed-end loan without affecting the other terms, including maturity, of the loan. The account is shown current upon granting the deferral.

“*Renewal*” means underwriting a matured, closed-end loan generally at its outstanding principal amount and on similar terms.

“*Rewrite*” means significantly changing the terms of an existing loan, including payment amounts, interest rates, amortization schedules, or its final maturity.

[FR Doc. 2021-13906 Filed 6-29-21; 8:45 am]

BILLING CODE 7535-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2020-0790; Project Identifier 2020-NM-077-AD; Amendment 39-21604; AD 2021-12-17]

RIN 2120-AA64

Airworthiness Directives; ATR-GIE Avions de Transport Régional Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain ATR-GIE Avions de Transport Régional Model ATR42-300, -320, and -500 airplanes; and all Model ATR72-101, -102, -201, -202, -211, -212, and

-212A airplanes. This AD was prompted by reports of defective seat tracks. This AD requires a detailed visual inspection of each affected part for deficiencies (sealant blockage and out of tolerance ligaments), and depending on findings, accomplishment of applicable corrective actions, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective August 4, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 4, 2021.

ADDRESSES: For material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0790.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0790; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3220; email: shahram.daneshmandi@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-

0097R1, dated May 28, 2020 (EASA AD 2020-0097R1) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain ATR-GIE Avions de Transport Régional Model ATR42-300, -320, -400, and -500 airplanes; and all Model ATR72-101, -102, -201, -202, -211, -212, and -212A airplanes. Model ATR42-400 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain ATR-GIE Avions de Transport Régional Model ATR42-300, -320, and -500 airplanes; and all Model ATR72-101, -102, -201, -202, -211, -212, and -212A airplanes. The NPRM published in the **Federal Register** on September 9, 2020 (85 FR 55619). The NPRM was prompted by reports of defective seat tracks. The NPRM proposed to require a detailed visual inspection of each affected part for deficiencies (sealant blockage and out of tolerance ligaments), and depending on findings, accomplishment of applicable corrective actions, as specified in EASA AD 2020-0097R1.

The FAA is issuing this AD to address a structural failure of the seat track attachment during an emergency landing, possibly resulting in injury to occupants, and affecting emergency evacuation. See the MCAI for additional background information.

Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

The FAA reviewed the relevant data and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 14 CFR Part 51

EASA AD 2020-0097R1 specifies procedures for a detailed visual inspection of each affected seat track for deficiencies (sealant blockage and out of

¹⁷ “*Re-Age*” means returning a past due account to current status without collecting the total amount of principal, interest, and fees that are contractually due.

¹⁸ There may be instances where a workout loan is not a TDR even though the borrower is experiencing financial hardship. For example, a workout loan would not be a TDR if the fair value of cash or other assets accepted by a credit union from a borrower in full satisfaction of its receivable is at least equal to the credit union’s recorded investment in the loan, e.g., due to charge-offs.

tolerance ligaments), and corrective actions if necessary. Corrective actions include replacement of seat track sections, and replacement of the entire seat track. This material is reasonably

available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 59 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 28 work-hours × \$85 per hour = Up to \$2,380	\$0	Up to \$2,380	Up to \$140,420.

The FAA estimates the following costs to do any necessary on-condition replacements that would be required

based on the results of any required actions. The FAA has no way of determining the number of aircraft that

might need these on-condition replacements:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
172 work-hours × \$85 per hour = \$14,620	(*)	\$14,620

* The FAA has received no definitive data that would enable us to provide parts cost estimates for the on-condition replacements specified in this AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and

(3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2021–12–17 ATR–GIE Avions de Transport Régional: Amendment 39–21604; Docket No. FAA–2020–0790; Project Identifier 2020–NM–077–AD.

(a) Effective Date

This airworthiness directive (AD) is effective August 4, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to the ATR–GIE Avions de Transport Regional airplanes identified in

paragraphs (c)(1) and (2) of this AD, certificated in any category.

(1) Model ATR42–300, –320, and –500 airplanes, all manufacturer serial numbers, except manufacturer serial numbers 001 through 362 inclusive.

(2) ATR72–101, –102, –201, –202, –211, –212, and –212A airplanes, all manufacturer serial numbers.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Reason

This AD was prompted by reports of defective seat tracks. The FAA is issuing this AD to address a structural failure of the seat track attachment during an emergency landing, possibly resulting in injury to occupants, and affecting emergency evacuation.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2020–0097R1, dated May 28, 2020 (EASA AD 2020–0097R1).

(h) Exceptions to EASA AD 2020–0097R1

(1) Where EASA AD 2020–0097R1 refers to May 18, 2020 (the effective date of its original issue), this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2020–0097R1 does not apply to this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2020-0097R1 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or ATR-GIE Avions de Transport Régional's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (j)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

For more information about this AD, contact Shahram Daneshmandi, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3220; email: shahram.daneshmandi@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020-0097R1, dated May 28, 2020.

(ii) [Reserved]

(3) For EASA AD 2020-0097R1, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0790.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on June 6, 2021.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-13782 Filed 6-29-21; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2021-0184; Project Identifier MCAI-2020-01599-T; Amendment 39-21605; AD 2021-12-18]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Airbus SAS Model A330-200, A330-200 Freighter, A330-300, A340-200, and A340-300 series airplanes. This AD was prompted by a report that the auxiliary power unit (APU) aft fuel pump printed circuit board (PCB) varnish had deteriorated; the varnish is one of the layers of protection against development of an ignition source. This AD requires replacing each affected APU aft fuel pump, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective August 4, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 4, 2021.

ADDRESSES: For material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0184.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0184; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email Vladimir.Ulyanov@faa.gov.

SUPPLEMENTARY INFORMATION:**Background**

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0265, dated December 2, 2020 (EASA AD 2020-0265) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for all Airbus SAS Model A330-201, A330-202, A330-203, A330-223, A330-243, A330-223F, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342, A330-343, A340-211, A340-212, A340-213, A340-311, A340-312, and A340-313 airplanes.