

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2021-0722; Project Identifier MCAI-2021-00329-T]

RIN 2120-AA64

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. This proposed AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. This proposed AD would require modifying the waste compartment door of each affected galley, as specified in a European Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 18, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>.

For Zodiac Galleys Europe and Safran service information identified in this proposed AD, contact Safran Cabin CZ s.r.o., Univerzitni 1119/34, 301 00 Plzen, Czech Republic; telephone: +420 377 664 111; internet <https://www.safran-group.com/companies/safran-cabin>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0722.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0722; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:**

Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

**SUPPLEMENTARY INFORMATION:****Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0722; Project Identifier MCAI-2021-00329-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

**Background**

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0255, dated November 27, 2018 (EASA AD 2018-0255) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. Investigation revealed that the opening was caused by a galley global deflection on which the latch bolts of the door were pushed inwards by the striker. The FAA is proposing this AD to address failure of the galley door and release of trolleys during a rejected take-off or an emergency landing, which could result in injury to occupants. See

the MCAI for additional background information.

**Related Service Information Under 1 CFR Part 51**

EASA AD 2018–0255 describes procedures for modifying the waste compartment door of each affected galley. The modification includes installing a door catch bracket and a new striker.

Safran has issued Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision B, dated January 28, 2018; Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision C, dated May 24, 2018; and Safran Service Bulletin 213510–25–001, Revision D, dated August 15, 2019. This service information describes procedures for modifying the waste compartment door of each affected galley by installing a door catch bracket and striker. These documents are distinct because they contain revised instructions and figures.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another

country, and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishing the actions specified in EASA AD 2018–0255 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

**Explanation of Required Compliance Information**

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and

CAAs. As a result, the FAA proposes to incorporate EASA AD 2018–0255 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2018–0255 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2018–0255 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2018–0255. Service information required by EASA AD 2018–0255 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0722 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this proposed AD affects 141 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
5 work-hours × \$85 per hour = \$425 .....	\$0	\$425	\$59,925

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing

regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus SAS:** Docket No. FAA–2021–0722; Project Identifier MCAI–2021–00329–T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by October 18, 2021.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus SAS Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes, certificated in any category, as identified in European Aviation Safety Agency (EASA) AD 2018–0255, dated November 27, 2018 (EASA AD 2018–0255).

**(d) Subject**

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

**(e) Reason**

This AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. The FAA is issuing this AD to address failure of the galley door and release of trolleys during a rejected take-off or an emergency landing, which could result in injury to occupants and damage to airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2018–0255.

**(h) Exceptions to EASA AD 2018–0255**

(1) Where EASA AD 2018–0255 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2018–0255 does not apply to this AD.

**(h) Clarification of Required Service Information**

Where Paragraph (1) of EASA AD 2018–0255 requires using, among other service information, “Zodiac Galleys Europe SB 213510–25–001 rev. B,” this AD requires using “Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision B, dated January 28, 2018; or Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision C, dated May 24, 2018; or Safran Service Bulletin 213510–25–001, Revision D, dated August 15, 2019.”

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2018–0255 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Related Information**

(1) For information about EASA AD 2018–0255, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0722.

(2) For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

(3) For Zodiac Galleys Europe and Safran service information in this AD, contact

Safran Cabin CZ s.r.o., Univerzitni 1119/34, 301 00 Plzen, Czech Republic; telephone: +420 377 664 111; internet <https://www.safran-group.com/companies/safran-cabin>.

Issued on August 26, 2021.

**Lance T. Gant,**

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–18803 Filed 8–31–21; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA–2021–0703; Airspace Docket No. 21–AGL–28]

RIN 2120–AA66

**Proposed Amendment of Class E Airspace; Frankfort, MI**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to amend the Class E airspace extending upward from 700 feet above the surface at Frankfort Dow Memorial Field, Frankfort, MI. The FAA is proposing this action as the result of airspace reviews caused by the decommissioning of the Manistee very high frequency (VHF) omnidirectional range (VOR) as part of the VOR Minimal Operational Network (MON) Program. The name and geographic coordinates of the airport would also be updated to coincide with the FAA’s aeronautical database.

**DATES:** Comments must be received on or before October 18, 2021.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590; telephone (202) 366–9826, or (800) 647–5527. You must identify FAA Docket No. FAA–2021–0703/Airspace Docket No. 21–AGL–28 at the beginning of your comments. You may also submit comments through the internet at <https://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays.