

any bulk cargo door seals having p/n D5237200220000 or D5237200220200, as those actions are now required by paragraph (1) of EASA AD 2021-0049.

(3) Where paragraph (4) of EASA AD 2021-0049 specifies amending the aircraft flight manual (AFM) and “operating that aeroplane accordingly,” this AD does not include a requirement for “operating that aeroplane accordingly” as that action is already required by existing FAA operating regulations.

(4) Paragraph (4) of EASA AD 2021-0049 specifies amending “the Aircraft Flight Manual (AFM) of the aeroplane,” however, this AD requires amending “the existing AFM and applicable corresponding operational procedures.” Inserting a copy of EASA AD 2021-0049 into the existing AFM and applicable corresponding operational procedures is an acceptable method to comply with this requirement.

(5) The “Remarks” section of EASA AD 2021-0049 does not apply to this AD.

#### (i) Terminating Action for AD 2020-16-01

Accomplishing the terminating action on an airplane, as specified in paragraph (6) of EASA AD 2021-0049, for the affected parts defined in EASA AD 2021-0049 terminates all requirements of AD 2020-16-01 for forward and aft cargo door seals having part number (p/n) D5237106020000, D5237106020200, D5237106020400, D5237300120000, or D5237300120200; and bulk cargo door seals having p/n D5237200220000 or D5237200220200 only.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2021-0049 that contains RC procedures and tests: Except as required by paragraph (j)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures

or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (k) Related Information

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2021-0049, dated February 18, 2021.

(ii) [Reserved]

(3) For EASA AD 2021-0049, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0368.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 19, 2021.

#### Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-19816 Filed 9-14-21; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2021-0698; Project Identifier MCAI-2021-00284-T; Amendment 39-21703; AD 2021-18-02]

RIN 2120-AA64

#### Airworthiness Directives; Fokker Services B.V. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Fokker Services B.V. Model F28 Mark 0070 and Mark 0100 airplanes. This AD was prompted by a report of a crack found on the forward pressure bulkhead web plate, at the edge of a bonded doubler. This AD requires a one-time inspection of the forward bulkhead for cracking, repair if necessary, and a report of inspection results, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD becomes effective September 30, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of September 30, 2021.

The FAA must receive comments on this AD by November 1, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax*: 202-493-2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the

FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0698.

#### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0698; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:** Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3405; email [ho-joon.lim@faa.gov](mailto:ho-joon.lim@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0064 dated March 5, 2021, to correct an unsafe condition for certain Fokker Services B.V. Model F28 Mark 0070 and Mark 0100 airplanes.

This AD was prompted by a report of a crack found on the forward pressure bulkhead web plate, at the edge of a bonded doubler of a Model F28 Mark 0070. The airplane had accumulated approximately 37,000 total flight cycles at the time of the finding. The threshold for the applicable Airworthiness Limitations Section (ALS) inspection task is currently 60,000 flight cycles. The FAA is issuing this AD to address cracking of the forward pressure bulkhead, which could result in reduced structural integrity and consequent rapid decompression of the airplane. See the MCAI for additional background information.

##### Related Service Information Under 1 CFR Part 51

EASA AD 2021-0064 describes procedures for a one-time detailed inspection of the forward bulkhead for cracking, a report of inspection results, and repair of any crack found. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD because the FAA evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Requirements of This AD

This AD requires accomplishing the actions specified in EASA AD 2021-0064 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

#### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use certain civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, EASA AD 2021-0064 is incorporated by reference in this AD. This AD, therefore, requires compliance with EASA AD 2021-0064 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021-0064 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2021-0064. Service information specified in EASA AD 2021-0064 that is required for compliance with it is available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0698.

#### FAA's Justification and Determination of the Effective Date

There are currently no domestic operators of these products. Therefore, the FAA finds that notice and opportunity for prior public comment are unnecessary and that good cause exists for making this amendment effective in less than 30 days.

#### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under ADDRESSES. Include "Docket No. FAA-2021-0698; Project Identifier MCAI-2021-00284-T" at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3405; email [ho-joon.lim@faa.gov](mailto:ho-joon.lim@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Regulatory Flexibility Act (RFA)

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

**Interim Action**

The FAA considers this AD interim action. If final action is later identified, the FAA may consider further rulemaking at that time.

**Costs of Compliance**

Currently, there are no affected U.S.-registered airplanes. For any affected airplane that may be imported and placed on the U.S. Register in the future,

the FAA provides the following cost estimates to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS \***

Labor cost	Parts cost	Cost per product
8 work-hours × \$85 per hour = \$255 .....	\$0	\$680

\* Table does not include estimated costs for reporting.

The FAA estimates that it takes about 1 work-hour per product to comply with the reporting requirement in this AD. The average labor rate is \$85 per hour. Based on these figures, the FAA estimates the cost of reporting the inspection results on U.S. operators to be \$85 per product.

The FAA has received no definitive data that would enable the agency to provide cost estimates for the on-condition actions specified in this AD.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120-0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under

that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2021-18-02 Fokker Services B.V.:**  
Amendment 39-21703; Docket No.

FAA-2021-0698; Project Identifier MCAI-2021-00284-T.

**(a) Effective Date**

This airworthiness directive (AD) becomes effective September 30, 2021.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Fokker Services B.V. Model F28 Mark 0070 and Mark 0100 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2021-0064, dated March 5, 2021.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Reason**

This AD was prompted by a report of a crack found on the forward pressure bulkhead web plate, at the edge of a bonded doubler. The FAA is issuing this AD to address cracking of the forward pressure bulkhead, which could result in reduced structural integrity and consequent rapid decompression of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2021-0064.

**(h) Exceptions to EASA AD 2021-0064**

(1) Where EASA AD 2021-0064 refers to its effective date, this AD requires using the effective date of this AD.

(2) Paragraph (3) of EASA AD 2021-0064 specifies to report inspection results to Fokker Services within a certain compliance time. For this AD, report inspection results at the applicable time specified in paragraph (h)(2)(i) or (ii) of this AD.

(i) If the inspection was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(ii) If the inspection was done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

(3) The “Remarks” section of EASA AD 2021–0064 does not apply to this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Fokker Services B.V.’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Paperwork Reduction Act Burden Statement*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120–0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory as required by this AD. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

**(j) Related Information**

For more information about this AD, contact Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3405; email [ho-joon.lim@faa.gov](mailto:ho-joon.lim@faa.gov).

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this

paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2021–0064, dated March 5, 2021.

(ii) [Reserved]

(3) For EASA AD 2021–0064, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0698.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 18, 2021.

**Ross Landes,**

*Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–19817 Filed 9–14–21; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF JUSTICE**

**Parole Commission**

**28 CFR Part 2**

[Docket No. USPC–2021–04]

RIN 1104–AA09

**Paroling, Recommitting, and Supervising Federal Prisoners: Prisoners Serving Sentences Under the United States and District of Columbia Codes**

**AGENCY:** United States Parole Commission, Justice.

**ACTION:** Interim rule with request for comments.

**SUMMARY:** The United States Parole Commission is revising its regulations to permit findings by a Residential Reentry Center’s Disciplinary Committee to be used as conclusive evidence of prisoner misconduct while in a Residential Reentry Center.

**DATES:** This regulation is effective September 15, 2021. Comments due on or before November 15, 2021.

**ADDRESSES:** Submit your comments, identified by docket identification number USPC–2021–04 by one of the following methods:

1. *Federal eRulemaking Portal*: <http://www.regulations.gov>. Follow the online instructions for submitting comments.

2. *Mail*: Office of the General Counsel, U.S. Parole Commission, attention: USPC Rules Group, 90 K Street NE, Washington, DC 20530.

**FOR FURTHER INFORMATION CONTACT:**

Helen H. Krapels, General Counsel, U.S. Parole Commission, 90 K Street NE, Third Floor, Washington, DC 20530, telephone (202) 346–7030. Questions about this publication are welcome, but inquiries concerning individual cases cannot be answered over the telephone.

**SUPPLEMENTARY INFORMATION:** After the U.S. Parole Commission has granted a prisoner a parole effective date, but before the prisoner signed the parole certificate, if the prisoner violates the rules of the institution, the Parole Commission may reopen the case and schedule a rescission hearing. 28 CFR 2.34(a). At that hearing, the Parole Commission may consider the report of the Bureau of Prisons (“BOP”) Disciplinary Hearing Officer (“DHO”) following a disciplinary hearing, that a prisoner has violated disciplinary rules as “conclusive evidence of institutional misconduct,” and does not need to conduct a full hearing to consider witnesses and evidence. 28 CFR 2.34(c). The disciplinary hearing conducted by the DHO complies with the procedural due process requirements established by the Supreme Court in *Wolff v. McDonnell*, i.e., the prisoner has notice of the alleged violations at least 24 hours in advance of hearing, a statement of factfinding, the right to call witnesses and present documentary evidence. Thus, the Parole Commission may rely on the findings and conclusions of the DHO to take action in response to the information.

For prisoners who are housed at a Residential Reentry Center (“RRC”) prior to their release and violate the rules, the in-person disciplinary hearing is conducted before the RRC’s Center Disciplinary Committee (“CDC”). Under the BOP’s Program Statement 7300.09, the CDC then refers its findings to the DHO for review, final action, and sanctions. Every court which has examined the procedures established by Program Statement 7300.09 has held that hearing procedures used by the CDC satisfy the procedural due process requirements established by the Supreme Court in *Wolff v. McDonnell*.

Thus far, the Parole Commission has not taken the step to amend its