

# Rules and Regulations

Federal Register

Vol. 86, No. 199

Tuesday, October 19, 2021

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2021-0837; Project Identifier MCAI-2021-00762-R; Amendment 39-21756; AD 2021-20-18]

RIN 2120-AA64

#### Airworthiness Directives; Leonardo S.p.a. Helicopters

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain serial-numbered Leonardo S.p.a. Model AW119 MKII helicopters. This AD was prompted by the discovery that the passenger cabin windows (windows) on a batch of helicopters were improperly installed during production. This AD requires removing and reinstalling the windows. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD becomes effective November 3, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain document listed in this AD as of November 3, 2021.

The FAA must receive comments on this AD by December 3, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and

5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this final rule, contact Leonardo S.p.a. Helicopters, Emanuele Bufano, Head of Airworthiness, Viale G. Agusta 520, 21017 C. Costa di Samarate (Va) Italy; telephone +39-0331-225074; fax +39-0331-229046; or at <https://customerportal.leonardocompany.com/en-US/>. You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0837.

#### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0837; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the European Aviation Safety Agency (now European Union Aviation Safety Agency) (EASA) AD, any comments received, and other information. The street address for Docket Operations is listed above.

#### FOR FURTHER INFORMATION CONTACT:

Kristi Bradley, Program Manager, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222-5110; email [kristin.bradley@faa.gov](mailto:kristin.bradley@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0270, dated December 12, 2018 (EASA AD 2018-0270), to correct an unsafe condition for Leonardo S.p.a. Helicopters, formerly Finmeccanica S.p.a., AgustaWestland S.p.a., Agusta S.p.a.; and AgustaWestland Philadelphia Corporation, formerly Agusta Aerospace Corporation, Model AW119MKII helicopters, serial numbers 14831, 14834, 14838, 14840, 14841, 14842, 14843, 14844, 14901, 14904, 14905, 14906, and 14918. EASA advises that during maintenance of a helicopter,

removal of passenger windows could only be accomplished with difficulty. EASA further advises that subsequent investigation identified a batch of helicopters on which passenger windows have been improperly installed during production. According to Leonardo Helicopters service information, an investigation concluded that the gasket was bonded to the window (or on both sides) instead of to the door frame.

This condition, if not corrected, could prevent the jettisoning of the windows, possibly preventing the evacuation of passengers during an emergency situation. Accordingly, EASA AD 2018-0270 requires removal and reinstallation of the passenger windows with the approved design data.

#### FAA's Determination

The applicable model helicopter has been approved by EASA and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the European Union, EASA has notified the FAA about the unsafe condition described in its AD. The FAA is issuing this AD after evaluating all known relevant information and determining that the unsafe condition described previously is likely to exist or develop on other helicopters of the same type design.

#### Related Service Information Under 14 CFR Part 51

The FAA reviewed Leonardo Helicopters Alert Service Bulletin No. 119-094, dated November 15, 2018. This service information specifies procedures for removing the standard windows installed on the affected helicopters and reinstalling them in accordance with approved design data.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### AD Requirements

This AD requires, within 100 hours time-in-service after the effective date of this AD, removing and reinstalling the left-hand and right-hand windows by following certain procedures in the service information.

### Differences Between This AD and the EASA AD

EASA AD 2018–0270 requires discarding certain seal fillers and gaskets, whereas this AD requires removing those parts from service instead.

### Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those procedures are “impracticable, unnecessary, or contrary to the public interest.” Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

There are no helicopters with this type certificate on the U.S. Registry. Accordingly, notice and opportunity for prior public comment are unnecessary, pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the foregoing reasons, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

### Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2021–0837; Project Identifier MCAI–2021–00762–R” at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner.

Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Kristi Bradley, Program Manager, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222–5110; email [kristin.bradley@faa.gov](mailto:kristin.bradley@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

### Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without prior notice and comment, RFA analysis is not required.

### Costs of Compliance

There are no costs of compliance with this AD because there are no helicopters with this type certificate on the U.S. Registry.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or

develop on products identified in this rulemaking action.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2021–20–18 Leonardo S.p.a.:** Amendment 39–21756; Docket No. FAA–2021–0837; Project Identifier MCAI–2021–00762–R.

#### (a) Effective Date

This airworthiness directive (AD) is effective November 3, 2021.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Leonardo S.p.a. Model AW119 MKII helicopters, certificated in any category, with serial number 14831, 14834, 14838, 14840, 14841, 14842, 14843, 14844, 14901, 14904, 14905, 14906, or 14918.

#### (d) Subject

Joint Aircraft Service Component (JASC) Code: 5620, Passenger compartment doors.

#### (e) Unsafe Condition

This AD was prompted by the discovery of improperly installed passenger cabin windows (windows). The FAA is issuing this AD to ensure that each window is properly installed and opens properly. The unsafe condition, if not addressed, could result in

occupants not being able to exit the helicopter during an emergency situation.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 100 hours time in service after the effective date of this AD, replace the left-hand and right-hand windows by following the Accomplishment Instructions, paragraphs 2. and 3., of Leonardo Helicopters Alert Service Bulletin No. 119–094, dated November 15, 2018 (ASB119–094), except where ASB 119–094 specifies to discard the seal filler and gasket, remove those parts from service.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (i)(1) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(i) Related Information**

(1) For more information about this AD, contact Kristi Bradley, Program Manager, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222–5110; email [kristin.bradley@faa.gov](mailto:kristin.bradley@faa.gov).

(2) The subject of this AD is addressed in European Aviation Safety Agency (now European Union Aviation Safety Agency) (EASA) AD 2018–0270, dated December 12, 2018. You may view the EASA AD at <https://www.regulations.gov> in Docket No. FAA–2021–0837.

**(j) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Leonardo Helicopters Alert Service Bulletin No. 119–094, dated November 15, 2018.

(ii) [Reserved]

(3) For service information identified in this AD, contact Leonardo S.p.A. Helicopters, Emanuele Bufano, Head of Airworthiness, Viale G. Agusta 520, 21017 C. Costa di Samarate (Va) Italy; telephone +39–0331–225074; fax +39–0331–229046; or at <https://customerportal.leonardocompany.com/en-US/>.

[customerportal.leonardocompany.com/en-US/](https://customerportal.leonardocompany.com/en-US/).

(4) You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on September 23, 2021.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–22510 Filed 10–18–21; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF THE TREASURY**

**Internal Revenue Service**

**26 CFR Part 300**

**[TD 9957]**

**RIN 1545–BP75**

**User Fee for Estate Tax Closing Letter; Correction**

**AGENCY:** Internal Revenue Service (IRS), Treasury.

**ACTION:** Final regulations; correction.

**SUMMARY:** This document contains a correction to Treasury Decision 9957, which was published in the **Federal Register** on Tuesday, September 28, 2021. Treasury Decision 9957 establishes a new user fee of \$67 for persons requesting the issuance of IRS Letter 627, also referred to as an estate tax closing letter.

**DATES:** The correction is effective on October 28, 2021, and applicable as of September 28, 2021.

**FOR FURTHER INFORMATION CONTACT:** Juli Ro Kim at (202) 317–6859 (not a toll-free number).

**SUPPLEMENTARY INFORMATION:**

**Background**

The final regulations (TD 9957) that are the subject of this correction are issued under section 6103 of the Internal Revenue Code.

**Need for Correction**

As published the final regulations (TD 9957) contain an error that needs to be corrected.

**Correction of Publication**

Accordingly, the final regulations (TD 9957) that are the subject of FR Doc. 2021–21029, published on September 28, 2021 (86 FR 53539), are corrected as follows:

On page 53539, in the second column, footnote 1 is corrected to read:

<sup>1</sup> For an overview of the procedure applicable to a request for an estate tax closing letter before October 28, 2021, see part D of the Background and Explanation of Provisions of the proposed regulations.

**Oluwafunmilayo A. Taylor,**

*Chief, Publications and Regulations Branch, Legal Processing Division, Associate Chief Counsel, (Procedure and Administration).*

[FR Doc. 2021–22780 Filed 10–18–21; 8:45 am]

**BILLING CODE 4830–01–P**

**ENVIRONMENTAL PROTECTION AGENCY**

**40 CFR Part 180**

**[EPA–HQ–OPP–2020–0347; FRL–8871–01–OCSPP]**

**Propamocarb; Pesticide Tolerances**

**AGENCY:** Environmental Protection Agency (EPA).

**ACTION:** Final rule.

**SUMMARY:** This regulation establishes a tolerance for residues of propamocarb in or on Vegetable, *Brassica*, head and stem, group 5–16. The Interregional Project Number 4 (IR–4) requested this tolerance under the Federal Food, Drug, and Cosmetic Act (FFDCA).

**DATES:** This regulation is effective October 19, 2021. Objections and requests for hearings must be received on or before December 20, 2021, and must be filed in accordance with the instructions provided in 40 CFR part 178 (see also Unit I.C. of the **SUPPLEMENTARY INFORMATION**).

**ADDRESSES:** The docket for this action, identified by docket identification (ID) number EPA–HQ–OPP–2020–0347, is available at <https://www.regulations.gov> or at the Office of Pesticide Programs Regulatory Public Docket (OPP Docket) in the Environmental Protection Agency Docket Center (EPA/DC), West William Jefferson Clinton Bldg., Rm. 3334, 1301 Constitution Ave. NW, Washington, DC 20460–0001. The Public Reading Room is open from 8:30 a.m. to 4:30 p.m., Monday through Friday, excluding legal holidays. The telephone number for the Public Reading Room is (202) 566–1744, and the telephone number for the OPP Docket is (703) 305–5805.

Due to the public health emergency, the EPA Docket Center (EPA/DC) and