

**(c) Applicability**

This AD applies to Leonardo S.p.a. Model A109E helicopters, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020–0256, dated November 17, 2020 (EASA AD 2020–0256).

**(d) Subject**

Joint Aircraft Service Component (JASC) Code: 5300, Fuselage Structure.

**(e) Unsafe Condition**

This AD was prompted by reports of cracking in the center fuselage frame assembly in the intersection of the lateral pylon and floor spar at station (STA) 1815 on the left- and right-hand sides. The FAA is issuing this AD to address cracking in the intersection of the lateral pylon and floor spar at STA 1815 on the left- and right-hand sides, which, if not addressed, could affect the structural integrity of the helicopter.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020–0256.

**(h) Exceptions to EASA AD 2020–0256**

(1) Where EASA AD 2020–0256 requires compliance in terms of flight hours, this AD requires using hours time-in-service.

(2) Where EASA AD 2020–0256 AD refers to its effective date, this AD requires using the effective date of this AD.

(3) Where Figure 1 of the service information referenced in EASA AD 2020–0256 depicts the AFT bulkhead twice, for clarification, the FWD bulkhead is mislabeled as AFT and depicted on the left side of Figure 1, below 109–0320–96 POST ASSY (REF) and above FWD CAP.

(4) Where the service information referenced in EASA AD 2020–0256 specifies discarding parts, this AD requires removing those parts from service.

(5) Where paragraph (2) of EASA AD 2020–0256 or the service information referenced in EASA AD 2020–0256 specifies to contact the manufacturer for repair information, for this AD: Before further flight, do the repair using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Leonardo S.p.a.'s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(6) This AD does not mandate compliance with the "Remarks" section of EASA AD 2020–0256.

**(i) No Reporting Requirement**

Although the service information referenced in EASA AD 2020–0256 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(k) Related Information**

For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228–7330; email [andrea.jimenez@faa.gov](mailto:andrea.jimenez@faa.gov).

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2020–0256, dated November 17, 2020.

(ii) [Reserved].

(3) For EASA AD 2020–0256, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find the EASA material on the EASA website at <https://ad.easa.europa>.

(4) You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0697.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on October 26, 2021.

**Lance T. Gant,**

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–26333 Filed 12–3–21; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2021–0722; Project Identifier MCAI–2021–00329–T; Amendment 39–21813; AD 2021–23–15]

RIN 2120–AA64

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Airbus SAS Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes. This AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. This AD requires modifying the waste compartment door of each affected galley, as specified in a European Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective January 10, 2022.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 10, 2022.

**ADDRESSES:** For material incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0722.

For Zodiac Galleys Europe and Safran service information identified in this AD, contact Safran Cabin CZ s.r.o., Univerzitni 1119/34, 301 00 Plzen, Czech Republic; telephone: +420 377

664 111; internet <https://www.safran-group.com/companies/safran-cabin>.

**Examining the AD Docket**

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0722; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Background**

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0255, dated November 27, 2018 (EASA AD 2018-0255) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. Model A320-215 airplanes are not certificated by the FAA

and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. The NPRM published in the **Federal Register** on September 1, 2021 (86 FR 48919). The NPRM was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. The NPRM proposed to require modifying the waste compartment door of each affected galley, as specified in EASA AD 2018-0255.

The FAA is issuing this AD to address failure of the galley door and release of trolleys during a rejected take-off or an emergency landing, which could result in injury to occupants. See the MCAI for additional background information.

**Discussion of Final Airworthiness Directive**

**Comments**

The FAA received no comments on the NPRM or on the determination of the cost to the public.

**Conclusion**

The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Except

for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products.

**Related Service Information Under 1 CFR Part 51**

EASA AD 2018-0255 describes procedures for modifying the waste compartment door of each affected galley. The modification includes installing a door catch bracket and a new striker.

Safran has issued Zodiac Galleys Europe Service Bulletin 213510-25-001, Revision B, dated January 28, 2018; Zodiac Galleys Europe Service Bulletin 213510-25-001, Revision C, dated May 24, 2018; and Safran Service Bulletin 213510-25-001, Revision D, dated August 15, 2019. This service information describes procedures for modifying the waste compartment door of each affected galley by installing a door catch bracket and striker. These documents are distinct because they contain revised instructions and figures.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**Costs of Compliance**

The FAA estimates that this AD affects 141 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

| Labor cost                                 | Parts cost | Cost per product | Cost on U.S. operators |
|--|------------|------------------|------------------------|
| 5 work-hours × \$85 per hour = \$425 ..... | \$0        | \$425            | \$59,925               |

According to the manufacturer, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or

develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Will not affect intrastate aviation in Alaska, and

(3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2021–23–15 Airbus SAS:** Amendment 39–21813; Docket No. FAA–2021–0722; Project Identifier MCAI–2021–00329–T.

#### (a) Effective Date

This airworthiness directive (AD) is effective January 10, 2022.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus SAS Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes; certificated in any category; as identified in European Aviation Safety Agency (EASA) AD 2018–0255, dated November 27, 2018 (EASA AD 2018–0255).

#### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

#### (e) Reason

This AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached. The FAA is issuing this AD to address failure of the galley door and release of trolleys during a rejected take-off or an emergency landing, which could result in injury to occupants and damage to the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2018–0255.

#### (h) Exceptions to EASA AD 2018–0255

(1) Where EASA AD 2018–0255 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2018–0255 does not apply to this AD.

#### (h) Clarification of Required Service Information

Where Paragraph (1) of EASA AD 2018–0255 requires using, among other service information, “Zodiac Galleys Europe SB 213510–25–001 rev. B,” this AD requires using “Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision B, dated January 28, 2018; or Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision C, dated May 24, 2018; or Safran Service Bulletin 213510–25–001, Revision D, dated August 15, 2019.”

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2018–0255 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining

approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Related Information

For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Aviation Safety Agency (EASA) AD 2018–0255, dated November 27, 2018.

(ii) Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision B, dated January 28, 2018.

(iii) Zodiac Galleys Europe Service Bulletin 213510–25–001, Revision C, dated May 24, 2018.

(iv) Safran Service Bulletin 213510–25–001, Revision D, dated August 15, 2019.

(3) For EASA AD 2018–0255, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) For Zodiac Galleys Europe and Safran service information identified in this AD, contact Safran Cabin CZ s.r.o., Univerzitni 1119/34, 301 00 Plzen, Czech Republic; telephone: +420 377 664 111; internet <https://www.safran-group.com/companies/safran-cabin>.

(5) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(6) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on November 2, 2021.

**Lance T. Gant,**

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–26394 Filed 12–3–21; 8:45 am]

**BILLING CODE 4910–13–P**