

response to the petition because all of the changes it sought have already been made.

Dated: March 23, 2022.

On behalf of the Commission.

Allen J. Dickerson,

Chairman, Federal Election Commission.

[FR Doc. 2022-06594 Filed 3-28-22; 8:45 am]

BILLING CODE 6715-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0381; Project Identifier MCAI-2021-01314-R]

RIN 2120-AA64

Airworthiness Directives; Airbus Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus Helicopters Model AS355E, AS355F, AS355F1, AS355F2, AS-365N2, AS 365 N3, SA-365N, SA-365N1, EC 155B, and EC155B1 helicopters. This proposed AD was prompted by investigation results from an engine compartment fire, which determined some of the internal parts of the engine upper fixed cowling (engine cowling) were painted with finish paint on top of the primer layer. This proposed AD would require a one-time inspection of certain part-numbered engine cowlings, and corrective actions if necessary, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 13, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

For EASA material that is proposed for IBR in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find the EASA material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. This material is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0381.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0381; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the EASA AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0381; Project Identifier MCAI-2021-01314-R" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The

agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0265, dated November 23, 2021 (EASA AD 2021-0265), to correct an unsafe condition for Airbus Helicopters (AH), formerly Eurocopter, Eurocopter France, Aerospatiale, Sud Aviation, Model SA 365 N, SA 365 N1, AS 365 N2, AS 365 N3, EC 155 B, EC 155 B1, AS 355 E, AS 355 F, AS 355 F1 and AS 355 F2 helicopters, all serial numbers.

This proposed AD was prompted by investigation results from an engine compartment fire, which determined some of the internal parts of the engine cowling were painted with finish paint on top of the primer layer. The FAA is proposing this AD to detect finish paint inside the duct of the engine cowling. The unsafe condition, if not addressed, could result in fire propagation in case of exposure to high temperature, damage to the helicopter, and injury to the occupants. See EASA AD 2021-0265 for additional background information.

Related Service Information Under 14 CFR Part 51

EASA AD 2021–0265 requires a one-time inspection of certain part-numbered engine cowlings (*e.g.*, an affected part as defined in EASA AD 2021–0265) for finish paint and depending on the inspection results, accomplishment of applicable corrective actions. EASA AD 2021–0265 also allows an affected part to be installed on any helicopter, provided it is a serviceable part as defined in EASA AD 2021–0265. Corrective actions include repainting the affected part and replacing the affected part.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Other Related Service Information

The FAA reviewed Airbus Helicopters Alert Service Bulletin (ASB) No. AS355–53.00.38, ASB No. AS365–53.00.65, and ASB No. EC155–53A040, all Revision 0, and all dated October 27, 2021, which specify procedures for inspecting the inside of the duct of the engine cowling for finish paint and corrective actions.

FAA’s Determination

These helicopters have been approved by EASA and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the European Union, EASA has notified the FAA about the unsafe condition described in its AD. The FAA is proposing this AD after evaluating all known relevant information and determining that the unsafe condition described previously is likely to exist or develop on other helicopters of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2021–0265, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD and except as discussed under “Differences Between this Proposed AD and EASA AD 2021–0265.”

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with

requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2021–0265 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2021–0265 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021–0265 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2021–0265. Service information referenced in EASA AD 2021–0265 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0381 after the FAA final rule is published.

Differences Between This Proposed AD and EASA AD 2021–0265

Service information referenced in EASA AD 2021–0265 specifies recording compliance of the applicable ASBs, whereas this proposed AD would not.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 93 helicopters of U.S. Registry. Labor rates are estimated at \$85 per work-hour. Based on these numbers, the FAA estimates the following costs to comply with this proposed AD.

Inspecting each engine cowling would take about 1 work-hour for an estimated cost of \$85 per helicopter and \$7,905 for the U.S. fleet.

Repainting each engine cowling with primer only would take about 8 work-hours for an estimated cost of \$680 per helicopter.

Replacing an engine cowling with a “serviceable part” as defined in EASA AD 2021–0265 would take about 4 work-hours and parts would cost up to \$7,800 for an estimated cost of up to \$8,140 per replacement.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus Helicopters: Docket No. FAA–2022–0381; Project Identifier MCAI–2021–01314–R.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by May 13, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus Helicopters Model AS355E, AS355F, AS355F1, AS355F2, AS-365N2, AS 365 N3, SA-365N, SA-365N1, EC 155B, and EC155B1 helicopters, certificated in any category.

(d) Subject

Joint Aircraft Service Component (JASC) Code: 7110, Engine Cowling System.

(e) Unsafe Condition

This AD was prompted by investigation results from an engine compartment fire, which determined some of the internal parts of the engine upper fixed cowling (engine cowling) were painted with finish paint on top of the primer layer. The FAA is issuing this AD to detect finish paint inside the duct of the engine cowling. The unsafe condition, if not addressed, could result in fire propagation in case of exposure to high temperature, damage to the helicopter, and injury to the occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2021-0265, dated November 23, 2021 (EASA AD 2021-0265).

(h) Exceptions to EASA AD 2021-0265

(1) Where EASA AD 2021-0265 requires compliance in terms of flight hours (FH), this AD requires using hours time-in-service.

(2) Where EASA AD 2021-0265 refers to its effective date, this AD requires using the effective date of this AD.

(3) Where paragraph (1) of EASA AD 2021-0265 specifies “in accordance with the instructions of paragraph 3.B of the applicable ASB,” for this AD replace “in accordance with the instructions of paragraph 3.B of the applicable ASB” with “in accordance with the Accomplishment Instructions, paragraphs 3.B.2.a. through 3.B.2.b. of the applicable ASB.”

(4) Where paragraph (2) of EASA AD 2021-0265 specifies to repaint or replace the affected part, replace the text “repaint (with primer layer only) that affected part or replace it with a serviceable part in accordance with the instructions of paragraph 3.B. of the applicable ASB,” with “repaint (with primer layer only) that affected part in accordance with the instructions of paragraph 3.B.2.b. of the applicable ASB, or replace the affected part with a ‘serviceable part’ as defined in EASA AD 2021-0265.”

(5) Where the service information referenced in EASA AD 2021-0265 specifies

“identify again the engine upper fixed cowling (a), refer to paragraph 3.C.,” this AD does require modifying your helicopter by marking “ASB No. 53.00.38,” “ASB No. 53A40,” or “ASB No. 53.00.65,” as applicable to your helicopter, after the old P/N on the engine cowling with indelible ink, but does not require compliance with paragraph 3.C. of the “applicable ASB” as defined in EASA AD 2021-0265.

(6) Where the service information referenced in EASA AD 2021-0265 specifies during the interpretation of results from the visual check of the inside of the duct of the engine cowling, if there is any finish paint inside the duct, obey with paragraph 3.B.2.b. (*i.e.*, perform corrective actions) not more than 6 months after you complied with paragraph 3.B.2.a., for this AD, if there is any finish paint inside the duct of the engine cowling, perform the corrective actions not more than 6 months after you complied with paragraph 3.B.2.a. Work Card 20-04-05-402 (MTC), referenced in the Accomplishment Instructions, paragraph 3.B.2.b. of the “applicable ASB” as defined in EASA AD 2021-0265 is for reference only and is not required for the actions in this AD.

(7) Where the Accomplishment Instructions, paragraph 3.B.2.b of Airbus Helicopters Alert Service Bulletin (ASB) No. AS365-53.00.65, and ASB EC155-53A040, both Revision 0, and both dated October 27, 2021, specify to refer to Work Card 53-50-00-402 (MET), or Task 53-54-00-061 (AMM), to remove and install the engine cowling, for this AD those instructions are for reference only and are not required for the actions in this AD.

(9) This AD does not mandate compliance with the “Remarks” section of EASA AD 2021-0265.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2021-0265 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Special Flight Permit

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199, provided no passengers are onboard.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (l)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(l) Related Information

(1) For EASA AD 2021-0265, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find EASA AD 2021-0265 on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0381.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov.

Issued on March 24, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-06577 Filed 3-28-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF HOMELAND SECURITY**Coast Guard****33 CFR Part 100**

[Docket Number USCG-2022-0086]

RIN 1625-AA08

Special Local Regulations; Recurring Marine Events, Sector St. Petersburg

AGENCY: Coast Guard, DHS.

ACTION: Notice of proposed rulemaking.

SUMMARY: The Coast Guard proposes to revise existing regulations by removing an event that no longer takes place, and by updating the location of an existing event in the geographic boundaries of the Seventh Coast Guard District Captain of the Port (COTP) St. Petersburg Zone. The Coast Guard invites your comments on this proposed rulemaking.

DATES: Comments and related material must be received by the Coast Guard on or before April 28, 2022.

ADDRESSES: You may submit comments identified by docket number USCG-2022-0086 using the Federal eRulemaking Portal at <http://www.regulations.gov>. See the “Public Participation and Request for Comments” portion of the **SUPPLEMENTARY INFORMATION** section for further instructions on submitting comments.