

Mississauga, Ontario, Canada, L4W 5K9; telephone North America (toll-free): +1 855-310-1013, Direct: +1 647-277-5820; email thd@dehavilland.com; internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on August 4, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-17120 Filed 8-11-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0995; Project Identifier MCAI-2021-01365-T]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD-700-1A10 and BD-700-1A11 airplanes. This proposed AD was prompted by reports of the passenger door failing to dampen during opening at regularly scheduled maintenance checks, causing the door to open more rapidly than normal. An investigation found that a contributing factor was erroneous aircraft maintenance manual (AMM) procedures. This proposed AD would prohibit using certain versions of certain aircraft maintenance manual (AMM) tasks for the passenger door. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by September 26, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to www.regulations.gov. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket at www.regulations.gov by searching for and locating Docket No. FAA-2022-0995; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Chirayu Gupta, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-0995; Project Identifier MCAI-2021-01365-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to www.regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated

as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Chirayu Gupta, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2021-41, dated November 24, 2021 (TCCA AD CF-2021-41) (also referred to after this as the MCAI), to correct an unsafe condition for certain Bombardier, Inc., Model BD-700-1A10 and BD-700-1A11 airplanes. You may examine the MCAI in the AD docket at www.regulations.gov by searching for and locating Docket No. FAA-2022-0995.

This proposed AD was prompted reports of the passenger door failing to dampen during opening at regularly scheduled maintenance checks, causing the door to open more rapidly than normal. An investigation found that a contributing factor was erroneous AMM procedures. The AMM tasks related to passenger door maintenance have since been corrected, and only versions of these tasks dated May 19, 2021, or later have the correct procedures. The FAA is proposing this AD to prevent rapid opening of the passenger door, which can result in damage to the door and consequent injury to maintenance personnel. See the MCAI for additional background information.

FAA’s Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition

described previously is likely to exist or develop on other products of the same type design.

Proposed Requirements of This NPRM

This proposed AD would prohibit using versions issued prior to May 19, 2021 of certain AMM tasks for the passenger door.

Costs of Compliance

The FAA estimates that this proposed AD affects 408 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hour × \$85 per hour = \$85	\$0	\$85	\$34,680

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Bombardier Inc.: Docket No. FAA–2022–0995; Project Identifier MCAI–2021–01365–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by September 26, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc., Model BD–700–1A10 and BD–700–1A11 airplanes, certificated in any category, serial numbers (S/Ns) 9002 through 9998 inclusive, and S/Ns 60001 through 60045 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 52, Doors.

(e) Reason

This AD was prompted by reports of the passenger door failing to dampen during opening at regularly scheduled maintenance checks, causing the door to open more rapidly than normal. An investigation found that a contributing factor was erroneous aircraft maintenance manual (AMM) procedures. The FAA is issuing this AD to prevent rapid opening of the passenger door, which can result in damage to the door and consequent injury to maintenance personnel.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Maintenance or Inspection Program Task Restrictions

As of 30 days after the effective date of this AD, when performing the maintenance tasks identified in figure 1 to paragraph (g) of this AD, do not use any version of any task identified in figure 1 to paragraph (g) of this AD that was issued prior to May 19, 2021.

BILLING CODE 4910–13–P

Figure 1 to paragraph (g) – AMM Tasks

AMM Task Number	Task Title
52-11-00-280-801	Rigging Check of the Passenger Door
52-11-00-400-801	Installation of the Passenger Door
52-11-00-710-801	Operational Test of the Passenger Door
52-11-00-820-801	Rigging of the Passenger Door
52-11-25-000-801	Removal of the Passenger Door Actuator
52-11-25-400-801	Installation of the Passenger Door Actuator
52-11-25-820-801	Rigging of the Passenger Door Actuator
52-11-33-000-801	Removal of the Passenger Door Chain
52-11-33-400-801	Installation of the Passenger Door Chain
52-11-41-000-801	Removal of the Passenger Door Tensator-Springs

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2021-41, dated November 24, 2021; for

related information. This MCAI may be found in the AD docket at www.regulations.gov by searching for and locating Docket No. FAA-2022-0995.

(2) For more information about this AD, contact Chirayu Gupta, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

Issued on August 4, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-17122 Filed 8-11-22; 8:45 am]

BILLING CODE 4910-13-C

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2022-0773; Airspace Docket No. 22-ACE-14]

RIN 2120-AA66

Proposed Amendment of Class E Airspace; Bloomfield, IA

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This action proposes to amend the Class E airspace at Bloomfield, IA. The FAA is proposing this action as the result of an airspace review as part of the decommissioning of the Bloomfield non-directional beacon (NDB).

DATES: Comments must be received on or before September 26, 2022.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590; telephone (202) 366-9826, or (800) 647-5527. You must identify FAA Docket No. FAA-2022-0773/Airspace Docket No. 22-ACE-14 at the beginning of your comments. You may also submit comments through the internet at www.regulations.gov. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays.

FAA Order JO 7400.11F, Airspace Designations and Reporting Points, and subsequent amendments can be viewed