

subset?¹¹ Is it possible to exclude political committees without also excluding any non-political committees that might also fall under MCC 8651? Who would request the political committees' exclusion, and who would be responsible for putting their exclusion into effect?

What other means do political committees have to limit or decline contributions made by prepaid cards? Can individual merchants set limits on the amounts of payments they will accept using prepaid cards? Are there other factors relating to the mechanisms of prepaid card transactions that the Commission should take into consideration?

Finally, the Commission invites comments on whether it should consider any other post-NPRM developments in the processing of electronic payments in general, or prepaid cards in particular, before promulgating final rules.

Conclusion

The Commission's goal in this rulemaking is to promulgate final rules that are flexible enough to encompass both traditional and electronic forms of payments and communications, and that remain relevant as new forms of information storage and payment methods emerge in the future. Accordingly, the Commission welcomes comment on any other recent innovations in technologies used for recordkeeping, payment processing, or communications that would affect issues addressed by this rulemaking.

Dated: August 31, 2022.

On behalf of the Commission.

Allen J. Dickerson,

Chairman, Federal Election Commission.

[FR Doc. 2022-19382 Filed 9-7-22; 8:45 am]

BILLING CODE 6715-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0816; Project Identifier AD-2022-00355-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

¹¹ See Visa Merchant Data Standards Manual, Visa Supp. Requirements 101 (2021), [visa-merchant-data-standards-manual.pdf](https://www.visa.com/merchant-data-standards-manual.pdf) (listing "political organizations" as Merchant Category Code 8651).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 747-8 and -8F series airplanes. This proposed AD was prompted by reports of cracking in stringers and splice fittings located at stringer splices at multiple body stations. This proposed AD would require an inspection of each free flange of the stringers at the stringer splice for the presence of radius fillers at fastener locations, an inspection for cracking of the stringers and stringer splice fittings at certain stringer splice locations, and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by October 24, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to www.regulations.gov. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet www.myboeingfleet.com. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at www.regulations.gov by searching for and locating Docket No. FAA-2022-0816.

Examining the AD Docket

You may examine the AD docket at www.regulations.gov by searching for and locating Docket No. FAA-2022-0816; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other

information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3964; email: stefanie.n.roesli@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0816; Project Identifier AD-2022-00355-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to www.regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3964; email: stefanie.n.roesli@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA has received a report indicating that during inspections for foreign object debris (FOD), two airplanes were found to have cracking at multiple stringers at splice locations. Nine additional airplanes were also found to have similar cracking in stringer splices at multiple body stations. The cracking was attributed to sustained internal tensile stresses in the splice joints induced during assembly, which, over time and under normal operating conditions, caused a localized rupture of the material from stress corrosion cracking. This condition, if not addressed, could result in inability of a structural element to sustain limit load and could affect structural integrity of the airplane.

FAA’s Determination

The FAA is issuing this NPRM after determining that the unsafe condition

described previously is likely to exist or develop on other products of the same type design.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022. This service information specifies procedures for an inspection of each free flange of the stringers at the stringer splice for the presence of radius fillers at fastener locations, an inspection for cracking of the stringers and stringer splice fittings at certain stringer splice locations, and applicable on-condition actions. On-condition actions include follow-on detailed inspections for cracking or the presence of radius fillers, removal or installation of radius fillers, and repair.

This service information is reasonably available because the interested parties have access to it through their normal

course of business or by the means identified in **ADDRESSES**.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described and except for any differences identified as exceptions in the regulatory text of this proposed AD. For information on the procedures and compliance times, see this service information at www.regulations.gov by searching for and locating Docket No. FAA–2022–0816.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 40 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection for radius filler	1 work-hour × \$85 per hour = \$85	None	\$85	\$3,400
Inspection for cracking	1 work-hour × \$85 per hour = \$85	None	85	3,400

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of the proposed inspection. The agency has no way of determining

the number of aircraft that might need these actions:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Inspection for cracking or for radius fillers	1 work-hour × \$85 per hour = \$85	None	\$85
Removing radius fillers and inspection	7 work-hours × \$85 per hour = \$595	None	595
Replacement of cracked splice channel	300 work-hours × \$85 per hour = \$85	\$809	26,309

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under

that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

The Boeing Company: Docket No. FAA–2022–0816; Project Identifier AD–2022–00355–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by October 24, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 747–8, and –8F series airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022.

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Unsafe Condition

This AD was prompted by reports of cracking in stringers and splice fittings located at stringer splices at multiple body stations. The FAA is issuing this AD to address such cracking, which could result in the inability of a structural element to sustain limit load and could affect structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 747–53A2907, dated March 3, 2022, which is referred to in Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022.

(h) Exceptions to Service Information Specifications

(1) Where the Compliance Time columns of the tables in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 747–

53A2907 RB, dated March 3, 2022, use the phrase “the original issue date of Requirements Bulletin 747–53A2907 RB,” this AD requires using “the effective date of this AD.”

(2) Where Boeing Alert Requirements Bulletin 747–53A2907 RB, dated March 3, 2022, specifies contacting Boeing for repair instructions: This AD requires doing the repair using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: *9-ANM-Seattle-ACO-AMOC-Requests@faa.gov*.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Stefanie Roesli, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone: 206–231–3964; email: *stefanie.n.roesli@faa.gov*.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet *www.myboeingfleet.com*. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on July 5, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–19297 Filed 9–7–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2022–1058; Project Identifier AD–2022–00256–T]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2021–07–09, which applies to all The Boeing Company Model 747–100, 747–100B, 747–100B SUD, 747–200B, 747–200C, 747–200F, 747–300, 747–400, 747–400D, 747–400F, 747SR, and 747SP series airplanes. AD 2021–07–09 requires repetitively inspecting all trim air diffuser ducts or sidewall riser duct assemblies (collectively referred to as TADDs) for damage, including repetitive structural inspections of the center fuel tanks for damage, and applicable on-condition actions. Since the FAA issued AD 2021–07–09, the agency has determined that the existing requirements do not adequately address the unsafe condition. This proposed AD would continue to require repetitive inspections of the TADDs for damage with revised compliance times, and repair if applicable. This proposed AD would also require repetitive replacement of the TADDs and would remove the structural inspections of the center fuel tanks. This proposed AD would also prohibit the installation of affected parts. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by October 24, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *regulations.gov*. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.