

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by:
 ■ a. Removing Airworthiness Directive (AD) 2019–26–11, Amendment 39–21022 (85 FR 6755, February 6, 2020); and AD 2021–23–15, Amendment 39–21813 (86 FR 68894, December 6, 2021); and
 ■ b. Adding the following new AD:

2022–18–09 Airbus SAS: Amendment 39–22160; Docket No. FAA–2022–0689; Project Identifier MCAI–2022–00215–T.

(a) Effective Date

This airworthiness directive (AD) is effective October 20, 2022.

(b) Affected ADs

This AD replaces AD 2019–26–11, Amendment 39–21022 (85 FR 6755, February 6, 2020) (AD 2019–26–11); and AD 2021–23–15, Amendment 39–21813 (86 FR 68894, December 6, 2021) (AD 2021–23–15).

(c) Applicability

This AD applies to the Airbus SAS airplanes specified in paragraphs (c)(1) through (3) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2022–0026, dated February 16, 2022 (EASA AD 2022–0026).

(1) Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes.

(2) Model A320–211, –212, –214, –216, –231, –232, –233, –251N, and –271N airplanes.

(3) Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, and –253N airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

(e) Unsafe Condition

This AD was prompted by a report that during re-engineering of galley G5, a 9G forward full scale qualification test was performed, and the door of the waste compartment opened before the required load was reached, and by reports of finding container/galley end stop bumpers damaged in service. This AD was also prompted by the determination that additional airplanes are subject to the unsafe condition. The FAA is issuing this AD to address potential failure of the galley door and release of waste bins during a rejected take-off or an emergency landing, and potential container detachment from the galley under certain forward loading

conditions, possibly resulting in damage to the airplane and injury to occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022–0026.

(h) Exceptions to EASA AD 2022–0026

(1) Where EASA AD 2022–0026 refers to December 11, 2018 (the effective date of EASA AD 2018–0255), this AD requires using January 10, 2022 (the effective date of AD 2021–23–15).

(2) Where EASA AD 2022–0026 refers to May 29, 2019 (the effective date of EASA AD 2019–0106), this AD requires using March 12, 2020 (the effective date of AD 2019–26–11).

(3) Where EASA AD 2022–0026 refers to its effective date, this AD requires using the effective date of this AD.

(4) The “Remarks” section of EASA AD 2022–0026 does not apply to this AD.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (i)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in

an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3223; email vladimir.ulyanov@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0026, dated February 16, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0026, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on August 19, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–19810 Filed 9–14–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2022–0687; Project Identifier MCAI–2021–01405–T; Amendment 39–22161; AD 2022–18–10]

RIN 2120–AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD-700-2A12 airplanes. This AD was prompted by a determination that the baggage bay line fire extinguishing tube assembly might not have been installed with the correct torque. This AD requires re-torquing the baggage bay line fire extinguishing tube assembly to the correct torque values, and applying corrosion inhibiting compound on the discharge tubes. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective October 20, 2022.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 20, 2022.

ADDRESSES:

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-0687; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For service information identified in this final rule, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-2999; email ac.yul@aero.bombardier.com; website [bombardier.com](https://www.bombardier.com).
- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des

Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-0687.

FOR FURTHER INFORMATION CONTACT:

Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc., Model BD-700-2A12 airplanes. The NPRM published in the **Federal Register** on June 21, 2022 (87 FR 36773). The NPRM was prompted by TCCA AD CF-2021-48, dated December 15, 2021, issued by Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada (referred to after this as the MCAI). The MCAI states that the baggage bay line fire extinguishing tube assembly may not have been installed in production with the correct torque. Although the baggage bay is accessible to the crew during flight with portable fire extinguishers, incorrect torquing of the baggage bay line fire extinguishing tube assembly could lead to loss of the built-in fire extinguishing system for the baggage bay.

In the NPRM, the FAA proposed to require re-torquing the baggage bay line fire extinguishing tube assembly to the correct torque values, and applying corrosion inhibiting compound on the discharge tubes. The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-0687.

Discussion of Final Airworthiness Directive

Comments

The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on this product. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

Related Service Information Under 1 CFR Part 51

Bombardier Inc. has issued Service Bulletin 700-26-7503, dated April 22, 2021. This service information describes procedures for re-torquing the baggage bay line fire extinguishing tube assembly to the correct torque values, and applying corrosion inhibiting compound on the discharge tubes. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 42 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hour × \$85 per hour = \$85	\$5	\$90	\$3,780

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds

necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2022–18–10 Bombardier, Inc.: Amendment 39–22161; Docket No. FAA–2022–0687; Project Identifier MCAI–2021–01405–T.

(a) Effective Date

This airworthiness directive (AD) is effective October 20, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc., Model BD–700–2A12 airplanes, certificated in any category, serial numbers (S/Ns) 70006 through 70044 inclusive, S/Ns 70046 through 70052 inclusive, and S/Ns 70055, 70056, and 70062.

(d) Subject

Air Transport Association (ATA) of America Code 26, Fire protection.

(e) Unsafe Condition

This AD was prompted by a determination that the baggage bay line fire extinguishing tube assembly might not have been installed

with the correct torque. The FAA is issuing this AD to address improper torquing, which may lead to loss of the fire extinguishing system, which could prevent extinguishing a fire and possibly result in damage to the airplane and injury to occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Re-Torque Fire Extinguishing Tube Assembly

Within 28 months after the effective date of this AD: Re-torque the baggage bay line fire extinguishing tube assembly to the correct torque values, and apply corrosion inhibiting compound on the discharge tubes, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 700–26–7503, dated April 22, 2021.

(h) No Reporting Requirement

Although Bombardier Service Bulletin 700–26–7503, dated April 22, 2021, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(i) Other AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Additional Information

(1) Refer to TCCA AD CF–2021–48, dated December 15, 2021, for related information. This TCCA AD may be found in the AD docket at [regulations.gov](https://www.regulations.gov) by searching for and locating Docket No. FAA–2022–0687.

(2) For more information about this AD, contact Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone

516–228–7300; email 9-avs-nyaco-cos@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 700–26–7503, dated April 22, 2021.

(ii) [Reserved]

(3) For service information identified in this AD, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–2999; email ac.yul@aero.bombardier.com; website [bombardier.com](https://www.bombardier.com).

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: [archives.gov/federal-register/cfr/ibr-locations.html](https://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on August 19, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–19807 Filed 9–14–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2022–1162; Project Identifier MCAI–2022–01087–A; Amendment 39–22180; AD 2022–19–11]

RIN 2120–AA64

Airworthiness Directives; Costruzioni Aeronautiche Tecnam S.P.A. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Costruzioni Aeronautiche Tecnam S.P.A. (Tecnam) Model P2006T airplanes. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. This AD