

# Rules and Regulations

Federal Register

Vol. 88, No. 178

Friday, September 15, 2023

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2023-1398; Project Identifier AD-2023-00472-P; Amendment 39-22525; AD 2023-16-06]

RIN 2120-AA64

#### Airworthiness Directives; Hamilton Sundstrand Corporation Propellers

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Hamilton Sundstrand Corporation (Hamilton Sundstrand) Model 14SF-17 and 14SF-19 propellers. This AD was prompted by a report of an auxiliary motor and pump failing to feather a propeller in flight. This AD requires replacement of a certain auxiliary motor and pump. This AD also prohibits installation of a certain auxiliary motor and pump on any propeller. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective October 20, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 20, 2023.

**ADDRESSES:**

*AD Docket:* You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1398; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S.

Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

*Material Incorporated by Reference:*

- For service information identified in this final rule, contact Hamilton Sundstrand, One Hamilton Road, Windsor Locks, CT 06096; phone: (877) 808-7575; email: [CRC@collins.com](mailto:CRC@collins.com).

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1398.

**FOR FURTHER INFORMATION CONTACT:**

Isabel Saltzman, Aviation Safety Engineer, FAA, 1701 Columbia Avenue, College Park, GA 30337; phone: (781) 238-7649; email: [9-AVS-AIR-BACOCOS@faa.gov](mailto:9-AVS-AIR-BACOCOS@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Background**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Hamilton Sundstrand Model 14SF-17 and 14SF-19 propellers. The NPRM published in the **Federal Register** on June 27, 2023 (88 FR 41513). The NPRM was prompted by a report of an auxiliary motor and pump installed on a non-Hamilton Sundstrand propeller failing to feather the propeller in flight through either the primary or the backup means. The failure was caused by motor magnets in the auxiliary motor and pump that were debonded due to corrosion at the magnet and housing interface. The debonded motor magnets prevented motor rotation. Hamilton Sundstrand Model 14SF-17 and 14SF-19 propellers use the same auxiliary motor and pump. These propellers are installed on, but not limited to, Viking Air Limited (type certificate previously held by Bombardier Inc.; Canadair Limited) Model CL-215-6B11 (CL-215T & CL-415 Variants) airplanes. In the NPRM, the FAA proposed to require the

removal from service of an auxiliary motor and pump having part number (P/N) 782655-3 (Aerocontrex P/N 4122-006009) and replacement with an auxiliary motor and pump having P/N 782655-4 (Aerocontrex P/N 4122-056000). In the NPRM, the FAA also proposed to prohibit installation of an auxiliary motor and pump having P/N 782655-3 (Aerocontrex P/N 4122-006009) on any propeller. The FAA is issuing this AD to address the unsafe condition on these products.

**Discussion of Final Airworthiness Directive**

**Comments**

The FAA received no comments on the NPRM or on the determination of the costs.

**Conclusion**

The FAA reviewed the relevant data and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products. Except for minor editorial changes, this AD is adopted as proposed in the NPRM.

**Related Service Information Under 14 CFR Part 51**

The FAA reviewed Hamilton Sundstrand Corporation Service Bulletin (SB) 14SF-61-168, Revision 1, dated December 21, 2016. This service information specifies instructions for replacing the auxiliary motor and pump. Hamilton Sundstrand Corporation is a UTC Aerospace Systems Company. This service information is identified as both Hamilton Sundstrand Corporation and UTC Aerospace Systems. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**Costs of Compliance**

The FAA estimates that this AD affects 20 propellers installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replace auxiliary motor and pump .....	2 work-hours × \$85 per hour = \$170 .....	\$11,000	\$11,170	\$223,400
Perform post-installation system test .....	1 work-hour × \$85 per hour = \$85 .....	0	85	1,700

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2023–16–06 Hamilton Sundstrand**

**Corporation:** Amendment 39–22525; Docket No. FAA–2023–1398; Project Identifier AD–2023–00472–P.

**(a) Effective Date**

This airworthiness directive (AD) is effective October 20, 2023.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Hamilton Sundstrand Corporation (Hamilton Sundstrand) Model 14SF–17 and 14SF–19 propellers.

**Note 1 to paragraph (c):** These propellers are known to be installed on, but not limited to, Viking Air Limited (type certificate previously held by Bombardier Inc.; Canadair Limited) Model CL–215–6B11 (CL–215T and CL–415 Variants) airplanes.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 6123, Propeller Feathering/Reversing.

**(e) Unsafe Condition**

This AD was prompted by a report of an auxiliary motor and pump failing to feather a propeller in flight. The FAA is issuing this AD to prevent the failure of a certain auxiliary motor and pump to feather propellers. The unsafe condition, if not addressed, could result in reduced controllability of the aircraft and consequent loss of control of the aircraft.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

(1) Within 90 days after the effective date of this AD, remove from service an auxiliary motor and pump having part number (P/N) 782655–3 (Aerocontrex P/N 4122–006009) and replace with an auxiliary motor and pump having P/N 782655–4 (Aerocontrex P/N 4122–056000) in accordance with the Accomplishment Instructions, paragraphs 3.B., 3.C., and 3.E. of Hamilton Sundstrand Corporation Service Bulletin (SB) 14SF–61–

168, Revision 1, dated December 21, 2016 (Hamilton Sundstrand SB 14SF–61–168, Revision 1).

(2) After replacement of the auxiliary motor and pump, perform a post-installation system test in accordance with the Accomplishment Instructions, paragraph 3.F. of Hamilton Sundstrand SB 14SF–61–168, Revision 1.

**(h) Installation Prohibition**

After the effective date of this AD, do not install an auxiliary motor and pump having P/N 782655–3 (Aerocontrex P/N 4122–006009) on any propeller.

**(i) No Return of Parts**

Where the service information referenced in the Accomplishment Instructions, paragraph 3.B. of Hamilton Sundstrand SB 14SF–61–168, Revision 1, specifies returning certain parts to the manufacturer for modification, this AD does not include that requirement.

**(j) Credit for Previous Actions**

You may take credit for the actions required by paragraph (g) of this AD if you performed those actions before the effective date of this AD using Hamilton Sundstrand SB 14SF–61–168, Original Issue, dated December 14, 2016.

**(k) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, East Certification Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the branch office, send it to the attention of the person identified in paragraph (l)(1) of this AD. Information may be emailed to: 9-AVS-AIR-BACO-COS@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(l) Related Information**

(1) For more information about this AD, contact Isabel Saltzman, Aviation Safety Engineer, FAA, 1701 Columbia Avenue, College Park, GA 30337; phone: (781) 238–7649; email: 9-AVS-AIR-BACO-COS@faa.gov.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (m)(3) and (4) of this AD.

**(m) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference

(IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Hamilton Sundstrand Corporation Service Bulletin 14SF-61-168, Revision 1, dated December 21, 2016.

**Note 2 to paragraph (m)(2)(i):** Hamilton Sundstrand Corporation is a UTC Aerospace Systems Company. This service information is identified as both Hamilton Sundstrand Corporation and UTC Aerospace Systems.

(ii) [Reserved]

(3) For service information identified in this AD, contact Hamilton Sundstrand, One Hamilton Road, Windsor Locks, CT 06096; phone: (877) 808-7575; email: [CRC@collins.com](mailto:CRC@collins.com).

(4) You may view this service information at FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email: [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: [www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on August 24, 2023.

**Victor Wicklund,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2023-19932 Filed 9-14-23; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2023-0763; Airspace Docket No. 22-ANM-81]

RIN 2120-AA66

#### Modification of Class E Airspace; Burley Municipal Airport, Burley, ID

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies Class E airspace designated as a surface area, modifies Class E airspace extending upward from at least 700 feet above the surface, and modifies Class E airspace extending upwards from 1,200 feet above the surface at Burley Municipal Airport, Burley, ID. Additionally, this action makes administrative amendments to update the airport's existing Class E airspace legal descriptions. These actions support the safety and management of instrument

flight rules (IFR) operations at the airport.

**DATES:** Effective date 0901 UTC, November 30, 2023. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order JO 7400.11 and publication of conforming amendments.

**ADDRESSES:** A copy of the Notice of Proposed Rulemaking (NPRM), all comments received, this final rule, and all background material may be viewed online at [www.regulations.gov](http://www.regulations.gov) using the FAA Docket number. Electronic retrieval help and guidelines are available on the website. It is available 24 hours each day, 365 days each year.

FAA Order JO 7400.11H, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). You may also contact the Rules and Regulations Group, Office of Policy, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

**FOR FURTHER INFORMATION CONTACT:** Keith T. Adams, Federal Aviation Administration, Western Service Center, Operations Support Group, 2200 S 216th Street, Des Moines, WA 98198; telephone (206) 231-2428.

#### SUPPLEMENTARY INFORMATION:

##### Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it modifies Class E airspace to support IFR operations at Burley Municipal Airport, Burley, ID.

##### History

The FAA published a notice of proposed rulemaking for Docket No. FAA-2023-0763 in the **Federal Register** (88 FR 29569; May 8, 2023), proposing to modify Class E airspace at Burley Municipal Airport, Burley, ID. Interested parties were invited to participate in this rulemaking effort by submitting written comments on the

proposal to the FAA. No comments were received.

##### Differences From the NPRM

Subsequent to the publication of the NPRM, the FAA discovered that the proposed legal description for Burley's Class E airspace designated as a surface area required editing to better align with the intended airspace design, as well as to better match the Airspace Class definition. The legal description titled "ANM ID E2 Burley, ID [Amended]" (88 FR 29571; May 8, 2023) has been revised in this final rule to read: "That airspace extending upward from the surface within a 5-mile radius of Burley Municipal Airport, and that airspace extending upward from the surface between a 5-mile radius to a 7-mile radius southwest of the airport, from the 208° bearing clockwise to the 274° bearing from the airport."

Additionally, the FAA discovered that the proposed legal description for Burley's Class E airspace extending upward from 700 feet or more above the surface required editing to better align with adjacent airspace and to correct geographical coordinates. The legal description titled "ANM ID E5 Burley, ID [Amended]" (88 FR 29571; May 8, 2023) has been revised in this final rule to read: "That airspace extending upward from 700 feet above the surface within a 5.6-mile radius of the airport, and within a 6.5-mile radius of the airport between the 274° bearing clockwise to the 074° bearing, and within a 7-mile radius of the airport, from the 208° bearing clockwise to the 274° bearing; That airspace extending upward from 1,200 feet above the surface beginning at lat. 42°36'45" N, long. 114°14'48" W; to lat. 43°0'1" N, long. 114°2'9" W; to lat. 42°59'59" N, long. 112°59'57" W; to lat. 42°29'59" N, long. 113°0'0" W; to lat. 42°4'13" N, long. 114°30'42" W; lat. 42°36'20" N, long. 114°14'35" W; lat. 42°36'27" N, long. 114°14'55" W, thence to the point of beginning."

None of these edits make substantive changes to the airspace volumes the FAA proposed.

##### Incorporation by Reference

Class E2 and E5 airspaces areas are published in paragraphs 6002 and 6005, respectively, of FAA Order JO 7400.11, Airspace Designations and Reporting Points, which is incorporated by reference in 14 CFR 71.1 on an annual basis. This document amends the current version of that order, FAA Order JO 7400.11H, dated August 11, 2023, and effective September 15, 2023. FAA Order JO 7400.11H is publicly available as listed in the **ADDRESSES** section of this