

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2023-1994; Project Identifier MCAI-2023-00658-T; Amendment 39-22636; AD 2023-25-09]

RIN 2120-AA64

**Airworthiness Directives; Airbus SAS Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Airbus SAS Model A318, A319, A321, A330-200, A330-200 Freighter, A330-300, A330-800, A330-900, A340-200, and A340-300 series airplanes; Model A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes; and Model A340-541 and A340-642 airplanes. This AD was prompted by a report that a production deficiency of some SafeLav gaseous oxygen container (SLGOC) batches was identified during production testing of newly manufactured oxygen containers. This AD requires replacing affected SLGOCs and prohibiting the installation of affected SLGOCs, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective February 7, 2024.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of February 7, 2024.

**ADDRESSES:**

*AD Docket:* You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1994; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

*Material Incorporated by Reference:*

- For material incorporated by reference in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](https://easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](https://ad.easa.europa.eu).

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1994.

**FOR FURTHER INFORMATION CONTACT:** Tim Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 206-231-3667; email: [timothy.p.dowling@faa.gov](mailto:timothy.p.dowling@faa.gov).

**SUPPLEMENTARY INFORMATION:****Background**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Airbus SAS Model:

- A318-111, -112, -121, and -122 airplanes;
- A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes;
- A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes;
- A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX airplanes;
- A330-201, -202, -203, -223, -223F, -243, -243F, -301, -302, -303, -321, -322, -323, -341, -342, -343, -841, and -941 airplanes; and
- A340-211, -212, -213, -311, -312, -313, -541, and -642 airplanes.

The NPRM published in the **Federal Register** on October 13, 2023 (88 FR 70913). The NPRM was prompted by AD 2023-0094, dated May 8, 2023, issued by EASA, which is the Technical Agent for the Member States of the European Union (EASA AD 2023-0094) (also referred to as the MCAI). The MCAI states that a production deficiency of some SLGOC batches was identified during production testing of newly manufactured oxygen containers. Subsequent investigation identified missing heat treatment of the actuation pin of the SLGOC, which could cause its jamming, with consequent failure of

oxygen flow activation. This condition, if not corrected, could prevent supplemental oxygen supply in case of decompression in the cabin/lavatory, possibly resulting in injury to lavatory occupants.

In the NPRM, the FAA proposed to require replacing affected SLGOCs and prohibiting the installation of affected SLGOCs, as specified in EASA AD 2023-0094. The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2023-1994.

**Discussion of Final Airworthiness Directive****Comments**

The FAA received a comment from Air Line Pilots Association, International (ALPA) who supported the NPRM without change.

**Conclusion**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA reviewed the relevant data, considered the comment received, and determined that air safety requires adopting this AD as proposed. Accordingly, the FAA is issuing this AD to address the unsafe condition on this product. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator.

**Related Service Information Under 14 CFR Part 51**

EASA AD 2023-0094 specifies procedures for replacing affected SLGOCs and prohibiting the installation of affected SLGOCs. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**Costs of Compliance**

The FAA estimates that this AD affects 728 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
2 work-hours × \$85 per hour = \$170 .....	\$4,570	\$4,740	\$3,450,720

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected operators.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Amendment**

Accordingly, under the authority delegated to me by the Administrator,

the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2023–25–09 Airbus SAS:** Amendment 39–22636; Docket No. FAA–2023–1994; Project Identifier MCAI–2023–00658–T.

**(a) Effective Date**

This airworthiness directive (AD) is effective February 7, 2024.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Airbus SAS airplanes identified in paragraphs (c)(1) through (6) of this AD, certificated in any category.

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, –133, –151N, –153N, and –171N airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, –233, –251N, –252N, –253N, –271N, –272N, and –273N airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, –251NX, –252N, –252NX, –253N, –253NX, –271N, –271NX, –272N, and –272NX airplanes.

(5) Model A330–201, –202, –203, –223, –223F, –243, –243F, –301, –302, –303, –321, –322, –323, –341, –342, –343, –841, and –941 airplanes.

(6) Model A340–211, –212, –213, –311, –312, –313, –541, and –642 airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 35, Oxygen.

**(e) Unsafe Condition**

This AD was prompted by a report that a production deficiency of some SafeLav gaseous oxygen container (SLGOC) batches was identified during production testing of newly manufactured oxygen containers. The FAA is issuing this AD to address missing heat treatment of the actuation pin of the SLGOC, which could cause its jamming, with consequent failure of oxygen flow activation. The unsafe condition, if not addressed, could result in lack of supplemental oxygen supply in case of decompression in the cabin/

lavatory, possibly resulting in injury to lavatory occupants.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraphs (h) and (i) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2023–0094, dated May 8, 2023 (EASA AD 2023–0094).

**(h) Exceptions to EASA AD 2023–0094**

(1) Where EASA AD 2023–0094 refers to its effective date, this AD requires using the effective date of this AD.

(2) This AD does not adopt the “Remarks” section of EASA AD 2023–0094.

**(i) No Reporting Requirement**

Although the service information referenced in EASA AD 2023–0094 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

**(j) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, mail it to the address identified in paragraph (k) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraphs (j)(2) and (i) of this AD, if any service information referenced in EASA AD 2023–0094 contains paragraphs that are labeled as RC, the instructions in RC paragraphs, including subparagraphs under an RC paragraph, must be done to comply with this AD; any paragraphs, including

subparagraphs under those paragraphs, that are not identified as RC are recommended. The instructions in paragraphs, including subparagraphs under those paragraphs, not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the instructions identified as RC can be done and the airplane can be put back in an airworthy condition. Any identified as RC require approval of an AMOC.

#### (k) Additional Information

For more information about this AD, contact Tim Dowling, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 206-231-3667; email: [timothy.p.dowling@faa.gov](mailto:timothy.p.dowling@faa.gov).

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023-0094, dated May 8, 2023.

(ii) [Reserved]

(3) For EASA AD 2023-0094, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this EASA AD on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibrlocations.html](http://www.archives.gov/federal-register/cfr/ibrlocations.html), or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on December 14, 2023.

#### Victor Wicklund,

Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023-28854 Filed 1-2-24; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2023-1502; Project Identifier MCAI-2023-00380-T; Amendment 39-22634; AD 2023-25-07]

RIN 2120-AA64

#### Airworthiness Directives; Dassault Aviation Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

**SUMMARY:** The FAA is superseding Airworthiness Directive (AD) 2023-04-10, which applied to all Dassault Aviation Model MYSTERE-FALCON 900 airplanes. AD 2023-04-10 required revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. This AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. This AD continues to require the actions in AD 2023-04-10, and requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations; as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products. **DATES:** This AD is effective February 7, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of February 7, 2023.

The Director of the Federal Register approved the incorporation by reference of a certain other publication listed in this AD as of May 12, 2023 (88 FR 20743, April 7, 2023).

#### ADDRESSES:

**AD Docket:** You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2023-1502; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**Material Incorporated by Reference:**

- For material incorporated by reference in this AD, contact EASA,

Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu)

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2023-1502.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 206-231-3226; email [tom.rodriguez@faa.gov](mailto:tom.rodriguez@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Background

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to supersede AD 2023-04-10, Amendment 39-22357 (88 FR 20743, April 7, 2023) (AD 2023-04-10). AD 2023-04-10 applied to all Dassault Aviation Model MYSTERE-FALCON 900 airplanes. AD 2023-04-10 required revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations. The FAA issued AD 2023-04-10 to address reduced structural integrity of the airplane. AD 2023-04-10 specifies that accomplishing the revision required by that AD terminates the requirements of paragraph (g)(1) of AD 2010-26-05, Amendment 39-16544 (75 FR 79952, December 21, 2010) (AD 2010-26-05) for Dassault Aviation Model MYSTERE-FALCON 900 airplanes only. This AD therefore continues to allow that terminating action.

The NPRM published in the **Federal Register** on July 21, 2023 (88 FR 47086); corrected August 14, 2023 (88 FR 54933). The NPRM was prompted by AD 2023-0046, dated March 2, 2023, issued by EASA, which is the Technical Agent for the Member States of the European Union (EASA AD 2023-0046) (also referred to as the MCAI). The MCAI states that new or more restrictive airworthiness limitations have been developed.

In the NPRM, the FAA proposed to continue to require the actions in AD 2023-04-10 and to require revising the existing maintenance or inspection program, as specified in EASA AD 2023-0046. The FAA is issuing this AD to address reduced structural integrity of the airplane.